

JOB NO.: TCS00694/13

AGREEMENT NO. CE 45/2008 (CE) LIANTANG/HEUNG YUEN WAI BOUNDARY CONTROL POINT AND ASSOCIATED WORKS

MONTHLY ENVIRONMENTAL MONITORING AND AUDIT REPORT (NO.51) – OCTOBER 2017

PREPARED FOR
CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT
(CEDD)


Date Reference No. Prepared By Certified By

13 November 2017

TCS00694/13/600/R1307v2

Nicola Hon Tam Tak Wing (Environmental Consultant) (Environmental Team Leader)

Version	Date	Remarks
1	9 November 2017	First Submission
2	13 November 2017	Amended according to the IEC's comments on 10 November 2017

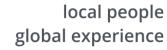



Our ref: 7076192/L22473/AB/AW/MC/rw

14 November 2017

AECOM 8/F, Grand Central Plaza, Tower 2 138 Shatin Rural Committee Road Shatin, N.T.

By Email & Post

Attention: Mr Simon LEUNG

Dear Sir

Agreement No. CE 45/2008 (CE)
Liantang/Heung Yuen Wai Boundary Control Point and Associated Works
Independent Environmental Checker – Investigation
Monthly EM&A Report (No. 51) – October 2017

With reference to the Monthly EM&A Report No. 51 for October 2017 (Version 2) certified by the ET Leader, please be noted that we have no adverse comments on the captioned submission. We herewith verify the captioned submission in accordance with Condition 5.4 of the Environmental Permit No. EP-404/2011/D.

Thank you for your attention and please do not hesitate to contact the undersigned on tel. 3995-8120 or by email to antony.wong@smec.com; or our Mr Man CHEUNG on tel. 3995 8132 or by email to man.cheung@smec.com.

Yours faithfully

Antony WONG

Independent Environmental Checker

cc CEDD/BCP - Mr LU Pei Yu / Mr William CHEUNG by fax: 3547 1659 ArchSD - Mr William WL CHENG by fax: 2804 6805

AECOM Mr Pat LAM / Mr Perry YAM by email Mr Peter YAM / Mr Justin CHEUNG Ronald Lu by email CW Mr Daniel HO by email DHK Mr Daniel ALTIER by email CCKJV Mr Vincent CHAN by email KRSJV Mr Matthew TSANG by email Leighton Mr Ray HO by email Mr Patrick LEUNG Siemens by email **AUES** Mr TW TAM by email



27/F Ford Glory Plaza
37-39 Wing Hong Street
Cheung Sha Wan, Kowloon, Hong Kong
T+852 3995 8100 F+852 3995 8101 E hongkong@smec.com
www.smec.com





EXECUTIVE SUMMARY

ES01 This is the 51st monthly EM&A report presenting the monitoring results and inspection findings for the reporting period from 1 to 31 October 2017 (hereinafter 'the Reporting Period').

ENVIRONMENTAL MONITORING AND AUDIT ACTIVITIES

- ES02 To facilitate the project management and implementation, Liantang/Heung Yuen Wai Boundary Control Point and Associated Works of the Project is divided to seven CEDD contracts including Contract 2 (CV/2012/08), Contract 3 (CV/2012/09), Contract 4 (NE/2014/02), Contract 5 (CV/2013/03), Contract 6 (CV/2013/08) and Contract 7 (NE/2014/03) and an ArshSD contract (Contract SS C505).
- ES03 In the Reporting Period, the major construction works under Liantang/Heung Yuen Wai Boundary Control Point and Associated Works of the Project included Contract 2, Contract 3, Contract 4, Contract 6, Contract 7 and Contract SS C505. Environmental monitoring activities under the EM&A programme in the Reporting Period are summarized in the following table.

Environmental	Environmental Monitoring	Reporting Period			
Aspect	Parameters / Inspection	Number of Monitoring Locations to undertake	Total Occasions		
A in Ovolity	1-hour TSP	9	135		
Air Quality	24-hour TSP	9	45		
Construction Noise	$L_{eq(30min)}$ Daytime	10	45		
		WM1 & WM1-C	13 Scheduled & 1 extra		
	33 777	WM2A(a) & WM2A-Cx	13 Scheduled & 3 extra		
Water Quality	Water in-situ measurement and/or sampling	WM2B & WM2B-C	(*) 13 Scheduled		
		WM3x &WM3-C	13 Scheduled & 0 extra		
		WM4, WM4-CA &WM4-CB	13 Scheduled & 2 extra		
Ecology	Woodland compensationi) General Health condition of planted speciesii) Survival of planted species	9 Quadrats	0		
	•	Contract 2	4		
T : 4 G:4	IEC, ET, the Contractor	Contract 3	4		
Joint Site	and RE joint site	Contract 4	4		
Inspection / Audit	Environmental Inspection	Contract 6	4		
Audit	and Auditing	Contract 7	4		
		Contract SS C505 (#)	4		

Note: Extra monitoring day was due to measurement results exceedance

ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE

ES04 In the Reporting Period, no air quality and construction noise exceedance and valid noise complaint were recorded. For water quality monitoring, a total of eleven (11) Action level/Limit Level exceedances were recorded under the Project. The summary of exceedance in the Reporting Period is shown below.

Empirormontol	Manitanina Astia		a T ::4	Event & Action			
Environmental Aspect	Parameters Parameters	Level	Limit	NOE Issued	Investigation Result	Project related exceedance	Corrective Actions

^(#) IEC only joined one (1) event of site inspection for Contract SS C505.

^(*) Water sampling was unable to carry out at WM2B and WM2B-C due to shallow water (water depth under 150mm)



Environmental	Manitanina	Action	Action Limit		Event & Action			
Aspect	Monitoring Parameters	Level	Level	NOE Issued	Investigation Result	Project related exceedance	Corrective Actions	
Air Quality	1-hour TSP	0	0	0				
7 in Quanty	24-hour TSP	0	0	0				
Construction Noise	$\begin{array}{c} L_{eq(30min)} \\ Daytime \end{array}$	0	0	0				
	DO	0	0	0	-			
	Turbidity	1	4	5	- All	0	The Contractors	
Water Quality	SS	0	6	6	exceedances were non-project related.		were reminded to implement water quality mitigation measure.	

ENVIRONMENTAL COMPLAINT

ES05 In this Reporting Period, one (1) documented environmental complaint was received under the EM&A Programme. Subsequent joint site inspection was carried out for investigation of the complaint and the investigation report revealed that the complaint was not valid to the project.

NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

ES06 No environmental summons or successful prosecutions were recorded in the Reporting Period.

REPORTING CHANGE

ES07 No reporting changes were made in the Reporting Period.

SITE INSPECTION

- ES08 In this Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract 2* has been carried out by the RE, IEC, ET and the Contractor on 6, 13, 20 and 27 October 2017. No non-compliance was noted during the site inspection.
- ES09 In the Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract 3* has been carried out by the RE, IEC, ET and the Contractor on 3, 12, 18 and 26 October 2017. No non-compliance was noted during the site inspection.
- ES10 In the Reporting Period, joint site inspection to evaluate the site environmental performance at Contract 4 has been carried out by the RE, IEC, ET and the Contractor on 6, 13, 16 and 27 October 2017. No non-compliance was noted.
- ES11 In the Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract 6* has been carried out by the RE, IEC, ET and the Contractor on 3, 12, 19 and 26 October 2017. No non-compliance was noted during the site inspection.
- ES12 In the Reporting Period, joint site inspection for Contract 7 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 6, 13, 17 and 27 October 2017. No non-compliance was noted during the site inspection.
- ES13 In the Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract SS C505* has been carried out by the RE, ET and the Contractor on **4, 11, 18 and 25**October 2017 in which IEC joined the site inspection on **25 October 2017**. No non-compliance was noted during the site inspection.



FUTURE KEY ISSUES

- ES14 During dry season, special attention should be paid on the potential construction dust impact since most of the construction sites are adjacent to villages. The Contractor should fully implement the construction dust mitigation measures as appropriately.
- ES15 Preventive measures for muddy water or other water pollutants from site surface flow to local stream such as Kong Yiu Channel, Ma Wat Channel, Ping Yuen River, Kwan Tei River or public area should be properly maintained. The Contractors should paid special attention on water quality mitigation measures and fully implement according ISEMM of the EM&A Manual, in particular for working areas near Ma Wat Channel and Ping Yuen River.
- ES16 In addition, all effluent discharge shall be ensure to fulfill Technical Memorandum of Effluent Discharged into Drainage and Sewerage Systems, inland and Coastal Waters criteria or discharge permits stipulation.
- ES17 Construction noise would be a key environmental issue during construction work of the Project. Noise mitigation measures such as using quiet plants should be implemented in accordance with the EM&A requirement.



Table of Contents

1	INTROD	UCTION	1
	1.1	PROJECT BACKGROUND	1
	1.2	REPORT STRUCTURE	1
2	PROJEC	T ORGANIZATION AND CONSTRUCTION PROGRESS	3
	2.1	CONSTRUCTION CONTRACT PACKAGING	3
	2.2	PROJECT ORGANIZATION	5
	2.3	CONCURRENT PROJECTS	7
	2.4	CONSTRUCTION PROGRESS	7
	2.5	SUMMARY OF ENVIRONMENTAL SUBMISSIONS	9
3	SUMMA	RY OF IMPACT MONITORING REQUIREMENTS	13
	3.1	GENERAL	13
	3.2	MONITORING PARAMETERS	13
	3.3	MONITORING LOCATIONS	13
	3.4	MONITORING FREQUENCY AND PERIOD	15
	3.5	MONITORING EQUIPMENT	16
	3.6	MONITORING METHODOLOGY	18
	3.7	EQUIPMENT CALIBRATION PERMATERNAL OF A CENTRAL ALL ALL ALL ALL ALL ALL ALL ALL ALL	20
	3.8 3.9	DERIVATION OF ACTION/LIMIT (A/L) LEVELS DATA MANAGEMENT AND DATA QA/QC CONTROL	21 21
4	_	ALITY MONITORING	23
	4.1	GENERAL	23
	4.2	AIR QUALITY MONITORING RESULTS	23
5	CONSTR	RUCTION NOISE MONITORING	26
	5.1	GENERAL	26
	5.2	NOISE MONITORING RESULTS (NORMAL DAYTIME)	26
6	WATER	QUALITY MONITORING	27
	6.1	GENERAL	27
	6.2	RESULTS OF WATER QUALITY MONITORING	27
7	ECOLOG	GY MONITORING	31
•	7.1	GENERAL	31
0			
8		MANAGEMENT CENTER AT WAS CENTERED.	32
	8.1 8.2	GENERAL WASTE MANAGEMENT	32 32
		RECORDS OF WASTE QUANTITIES	
9		SPECTION	33
	9.1	REQUIREMENTS	33
	9.2	FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH	33
10	ENVIRO	NMENTAL COMPLAINT AND NON-COMPLIANCE	37
	10.1	ENVIRONMENTAL COMPLAINT, SUMMONS AND PROSECUTION	37
11	IMPLEM	IENTATION STATUS OF MITIGATION MEASURES	40
	11.1	GENERAL REQUIREMENTS	40
	11.2	TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH	40
	11.3	KEY ISSUES FOR THE COMING MONTH	42
12	CONCLI	JSIONS AND RECOMMENDATIONS	43
14	12.1	CONCLUSIONS	43
	12.1	RECOMMENDATIONS	43
			73



LIST OF TABLES

TABLE 3-1	SUMMARY OF EM&A REQUIREMENTS
TABLE 3-2	IMPACT MONITORING STATIONS - AIR QUALITY
TABLE 3-3	IMPACT MONITORING STATIONS - CONSTRUCTION NOISE
TABLE 3-4	IMPACT MONITORING STATIONS - WATER QUALITY
TABLE 3-5	AIR QUALITY MONITORING EQUIPMENT
TABLE 3-6	CONSTRUCTION NOISE MONITORING EQUIPMENT
TABLE 3-7	WATER QUALITY MONITORING EQUIPMENT
TABLE 3-8	ACTION AND LIMIT LEVELS FOR AIR QUALITY MONITORING
TABLE 3-9	ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE
TABLE 3-10	ACTION AND LIMIT LEVELS FOR WATER QUALITY
Table 4-1	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM1A
TABLE 4-2	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM2
TABLE 4-3	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM3
Table 4-4	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM4B
Table 4-5	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM5A
Table 4-6	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM6
Table 4-7	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM7A
TABLE 4-8	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM8
Table 4-9	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM9B
Table 5-1	SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS
TABLE 5-2	SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS
Table 6-1	SUMMARY OF WATER QUALITY MONITORING RESULTS FOR CONTRACT 2 AND 3
TABLE 6-2	SUMMARY OF WATER QUALITY MONITORING RESULTS FOR CONTRACT 6 AND SS C505
TABLE 6-3	SUMMARY OF WATER QUALITY MONITORING RESULTS FOR CONTRACT 6
Table 6-4	Summary of Water Quality Monitoring Results for Contract 2 and 6
Table 6-5	ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE RECORDED
TABLE 6-6	SUMMARY OF WATER QUALITY EXCEEDANCE IN THE REPORTING PERIOD
Table 8-1	SUMMARY OF QUANTITIES OF INERT C&D MATERIALS
TABLE 8-2	SUMMARY OF QUANTITIES OF C&D WASTES
TABLE 9-1	SITE OBSERVATIONS FOR CONTRACT 2
TABLE 9-2	SITE OBSERVATIONS FOR CONTRACT 3
TABLE 9-3	SITE OBSERVATIONS FOR CONTRACT 4
TABLE 9-4	SITE OBSERVATIONS FOR CONTRACT 5
TABLE 9-5	SITE OBSERVATIONS FOR CONTRACT 6
TABLE 9-6	SITE OBSERVATIONS FOR CONTRACT SS C505
TABLE 9-7	SITE OBSERVATIONS FOR CONTRACT 7
TABLE 10-1	STATISTICAL SUMMARY OF ENVIRONMENTAL COMPLAINTS
TABLE 10-2	STATISTICAL SUMMARY OF ENVIRONMENTAL SUMMONS
TABLE 10-3	STATISTICAL SUMMARY OF ENVIRONMENTAL PROSECUTION
Table 11-1	ENVIRONMENTAL MITIGATION MEASURES



LIST OF APPENDICES

APPENDIX A	LAYOUT PLAN OF THE PROJECT
APPENDIX B	ORGANIZATION CHART
APPENDIX C	3-MONTH ROLLING CONSTRUCTION PROGRAM
APPENDIX D	DESIGNATED MONITORING LOCATIONS AS RECOMMENDED IN THE APPROVED EM&A MANUAL
APPENDIX E	MONITORING LOCATIONS FOR IMPACT MONITORING
APPENDIX F	CALIBRATION CERTIFICATE OF MONITORING EQUIPMENT AND HOKLAS-ACCREDITATION CERTIFICATE OF THE TESTING LABORATORY
APPENDIX G	EVENT AND ACTION PLAN
APPENDIX H	IMPACT MONITORING SCHEDULE
APPENDIX I	DATABASE OF MONITORING RESULT
APPENDIX J	GRAPHICAL PLOTS FOR MONITORING RESULT
APPENDIX K	METEOROLOGICAL DATA
APPENDIX L	WASTE FLOW TABLE
APPENDIX M	IMPLEMENTATION SCHEDULE FOR ENVIRONMENTAL MITIGATION MEASURES
APPENDIX N	INVESTIGATION REPORT FOR EXCEEDANCE
APPENDIX O	INVESTIGATION REPORT FOR COMPLAINT



1 INTRODUCTION

1.1 PROJECT BACKGROUND

- 1.1.1 Civil Engineering and Development Department is the Project Proponent and the Permit Holder of Agreement No. CE 45/2008 (CE) Liantang / Heung Yuen Wai Boundary Control Point and Associated Works, which is a Designated Project to be implemented under Environmental Permit number EP-404/2011/D granted on 20 January 2017.
- 1.1.2 The Project consists of two main components: Construction of a Boundary Control Point (hereinafter referred as "BCP"); and Construction of a connecting road alignment. Layout plan of the Project is shown in *Appendix A*.
- 1.1.3 The proposed BCP is located at the boundary with Shenzhen near the existing Chuk Yuen Village, comprising a main passenger building with passenger and cargo processing facilities and the associated customs, transport and ancillary facilities. The connecting road alignment consists of six main sections:
 - 1) Lin Ma Hang to Frontier Closed Area (FCA) Boundary this section comprises at-grade and viaducts and includes the improvement works at Lin Ma Hang Road;
 - 2) Ping Yeung to Wo Keng Shan this section stretches from the Frontier Closed Area Boundary to the tunnel portal at Cheung Shan and comprises at-grade and viaducts including an interchange at Ping Yeung;
 - 3) North Tunnel this section comprises the tunnel segment at Cheung Shan and includes a ventilation building at the portals on either end of the tunnel;
 - 4) Sha Tau Kok Road this section stretches from the tunnel portal at Wo Keng Shan to the tunnel portal south of Loi Tung and comprises at-grade and viaducts including an interchange at Sha Tau Kok and an administration building;
 - 5) South Tunnel this section comprises a tunnel segment that stretches from Loi Tung to Fanling and includes a ventilation building at the portals on either end of the tunnel as well as a ventilation building in the middle of the tunnel near Lau Shui Heung;
 - 6) Fanling this section comprises the at-grade, viaducts and interchange connection to the existing Fanling Highway.
- 1.1.4 Action-United Environmental Services & Consulting has been commissioned as an Independent ET to implement the relevant EM&A program in accordance with the approved EM&A Manual, as well as the associated duties. As part of the EM&A program, the baseline monitoring has carried out between 13 June 2013 and 12 July 2013 for all parameters including air quality, noise and water quality before construction work commencement. The Baseline Monitoring Report summarized the key findings and the rationale behind determining a set of Action and Limit Levels (A/L Levels) from the baseline data. Also, the Project baseline monitoring report which verified by the IEC has been submitted to EPD on 16 July 2013 for endorsement. The major construction works of the Project was commenced on 16 August 2013 in accordance with the EP Section 5.3 stipulation.
- 1.1.5 This is 51st monthly EM&A report presenting the monitoring results and inspection findings for reporting period from 1 to 31 October 2017.

1.2 REPORT STRUCTURE

1.2.1 The Monthly Environmental Monitoring and Audit (EM&A) Report is structured into the following sections:-

Section 1 Introduction

Section 2 Project Organization and Construction Progress

Section 3 Summary of Impact Monitoring Requirements

Section 4 Air Quality Monitoring

Section 5 Construction Noise Monitoring

Section 6 Water Quality Monitoring

Agreement No. CE 45/2008 (CE) Liantang/Heung Yuen Wai Boundary Control Point and Associated Works Monthly Environmental Monitoring & Audit Report (No.51) – October 2017



Section 7	Ecology Monitoring
Section 8	Waste Management
Section 9	Site Inspections
Section 10	Environmental Complaints and Non-Compliance
Section 11	Implementation Status of Mitigation Measures
Section 12	Conclusions and Recommendations



2 PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS

2.1 CONSTRUCTION CONTRACT PACKAGING

- 2.1.1 To facilitate the project management and implementation, the Project would be divided by the following contracts:
 - Contract 2 (CV/2012/08)
 - Contract 3 (CV/2012/09)
 - Contract 4 (NE/2014/02)
 - Contract 5 (CV/2013/03)
 - Contract 6 (CV/2013/08)
 - Contract 7 (NE/2014/03)
 - ArchSD Contract No. SS C505
- 2.1.2 The details of each contracts is summarized below and the delineation of each contracts is shown in *Appendix A*.

Contract 2 (CV/2012/08)

- 2.1.3 Contract 2 has awarded in December 2013 and construction work was commenced on 19 May 2014. Major Scope of Work of the Contract 2 is listed below:
 - construction of an approximately 5.2km long dual two-lane connecting road (with about 0.4km of at-grade road and 4.8km of tunnel) connecting the Fanling Interchange with the proposed Sha Tau Kok Interchange;
 - construction of a ventilation adit tunnel and the mid-ventilation building:
 - construction of the north and south portal buildings of the Lung Shan Tunnel and their associated slope works;
 - provision and installation of ventilation system, E&M works and building services works for Lung Shan tunnel and Cheung Shan tunnel and their portal buildings;
 - construction of Tunnel Administration Building adjacent to Wo Keng Shan Road and the associated E&M and building services works; and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 3 (CV/2012/09)

- 2.1.4 Contract 3 was awarded in July 2013 and construction work was commenced on 5 November 2013. Major Scope of Work of the Contract 3 is listed below:
 - construction of four link roads connecting the existing Fanling Highway and the south portal of the Lung Shan Tunnel;
 - realignment of the existing Tai Wo Service Road West and Tai Wo Service Road East;
 - widening of the existing Fanling Highway (HyD's entrustment works);
 - demolishing existing Kiu Tau vehicular bridge and Kiu Tau footbridge and reconstruction of the existing Kiu Tau Footbridge (HyD's entrustment works); and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 4 (NE/2014/02)

- 2.1.5 Contract 4 has awarded in mid-April 2016 and construction work was commenced on 2 May 2017. The scope of work of the Contract 4 includes:
 - design, supply, delivery, installation, testing and commissioning of a traffic control and surveillance system for the connecting road linking up the Liantang / Heung Yuen Wai Boundary Control Point and the existing Fanling Highway.



Contract 5 (CV/2013/03)

- 2.1.6 Contract 5 has awarded in April 2013 and construction work was commenced in August 2013. Major Scope of Work of the Contract 5 is listed below:
 - site formation of about 23 hectares of land for the development of the BCP;
 - construction of an approximately 1.6 km long perimeter road at the BCP including a 175m long depressed road;
 - associated diversion/modification works at existing local roads and junctions including Lin Ma Hang Road;
 - construction of pedestrian subway linking the BCP to Lin Ma Hang Road;
 - provision of resite area with supporting infrastructure for reprovisioning of the affected village houses; and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 6 (CV/2013/08)

- 2.1.7 Contract 6 has awarded in June 2015 and construction work was commenced on 23 October 2015. Major Scope of Work of the Contract 6 would be included below:
 - construction of an approximately 4.6km long dual two-lane connecting road (with about 0.6km of at-grade road, 3.3km of viaduct and 0.7km of tunnel) connecting the BCP with the proposed Sha Tau Kok Road Interchange and the associated ventilation buildings;
 - associated diversion/modification works at access roads to the resite of Chuk Yuen Village;
 - provision of sewage collection, treatment and disposal facilities for the BCP and the resite of Chuk Yuen Village;
 - construction of a pedestrian subway linking the BCP to Lin Ma Hang Road;
 - provisioning of the affected facilities including Wo Keng Shan Road garden; and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 7 (NE/2014/03)

- 2.1.8 Contract 7 has awarded in December 2015 and the construction works of Contract 7 was commenced on 15 February 2016. Major Scope of Work of the Contract 7 would be included below:
 - construction of the Hong Kong Special Administrative Region (HKSAR) portion of four vehicular bridge
 - construction of one pedestrian bridge crossing Shenzhen (SZ) River (cross boundary bridges)

ArchSD Contract No. SS C505

- 2.1.9 SS C505 has awarded in July 2015 and construction work was commenced on 1 September 2015. Major Scope of Work of the SS C505 would be included below:
 - passenger-related facilities including processing kiosks and examination facilities for private cars and coaches, passenger clearance building and halls, the interior fitting works for the pedestrian bridge crossing Shenzhen River, etc.;
 - cargo processing facilities including kiosks for clearance of goods vehicles, customs inspection platforms, X-ray building, etc.;
 - accommodation for the facilities inside of the Government departments providing services in connection with the BCP:
 - transport-related facilities inside the BCP including road networks, public transport interchange, transport drop-off and pick-up areas, vehicle holding areas and associated road furniture etc;
 - a public carpark; and



• other ancillary facilities such as sewerage and drainage, building services provisions and electronic systems, associated environmental mitigation measure and landscape works.

2.2 PROJECT ORGANIZATION

2.2.1 The project organization is shown in *Appendix B*. The responsibilities of respective parties are:

Civil Engineering and Development Department (CEDD)

2.2.2 CEDD is the Project Proponent and the Permit Holder of the EP of the development of the Project and will assume overall responsibility for the project. An Independent Environmental Checker (IEC) shall be employed by CEDD to audit the results of the EM&A works carried out by the ET.

<u>Architectural Services Department (ArchSD)</u>

2.2.3 ArchSD acts as the works agent for Development Bureau (DEVB), for Contract SS C505 Liantang/ Heung Yuen Wai Boundary Control Point (BCP) – BCP Buildings and Associated Facilities

Environmental Protection Department (EPD)

2.2.4 EPD is the statutory enforcement body for environmental protection matters in Hong Kong.

Ronald Lu & Partners (Hong Kong) Ltd (The Architect)

- 2.2.5 Ronald Lu & Partners (Hong Kong) Ltd is appointed by ArchSD as an Architect for Contract SS C505 Liantang/ Heung Yuen Wai Boundary Control Point (BCP) BCP Buildings and Associated Facilities. It responsible for overseeing the construction works of Contract SS C505 and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the Architect with respect to EM&A are:
 - Monitor the Contractors' compliance with contract specifications, including the implementation and operation of the environmental mitigation measures and their effectiveness
 - Monitor Contractors' and ET's compliance with the requirements in the Environmental Permit (EP) and EM&A Manual
 - Facilitate ET's implementation of the EM&A programme
 - Participate in joint site inspection by the ET and IEC
 - Oversee the implementation of the agreed Event / Action Plan in the event of any exceedance
 - Adhere to the procedures for carrying out complaint investigation
 - Liaison with DSD, Engineer/Engineer's Representative, ET, IEC and the Contractor of the "Construction of the DSD's Regulation of Shenzhen River Stage 4 (RSR 4)" Project discussing regarding the cumulative impact issues.

Engineer or Engineers Representative (ER)

- 2.2.6 The ER is responsible for overseeing the construction works and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the ER with respect to EM&A are:
 - Monitor the Contractors' compliance with contract specifications, including the implementation and operation of the environmental mitigation measures and their effectiveness
 - Monitor Contractors's, ET's and IEC's compliance with the requirements in the Environmental Permit (EP) and EM&A Manual
 - Facilitate ET's implementation of the EM&A programme
 - Participate in joint site inspection by the ET and IEC
 - Oversee the implementation of the agreed Event / Action Plan in the event of any exceedance



- Adhere to the procedures for carrying out complaint investigation
- Liaison with DSD, Engineer/Engineer's Representative, ET, IEC and the Contractor of the "Construction of the DSD's Regulaiton of Shenzhen River Stage 4 (RSR 4)" Project discussing regarding the cumulative impact issues.

The Contractor(s)

- 2.2.7 There will be one contractor for each individual works contract. Once the contractors are appointed, EPD, ET and IEC will be notified the details of the contractor.
- 2.2.8 The Contractor for Contracts under CEDD should report to the ER. For ArchSD Contract, the Contractor should report to the Architect or Architect's Representative (AR). The duties and responsibilities of the Contractor are:
 - Comply with the relevant contract conditions and specifications on environmental protection
 - Employ an Environmental Team (ET) to undertake monitoring, laboratory analysis and reporting of EM &A Facilitate ET's monitoring and site inspection activities
 - Participate in the site inspections by the ET and IEC, and undertake any corrective actions
 - Provide information / advice to the ET regarding works programme and activities which may contribute to the generation of adverse environmental impacts
 - Submit proposals on mitigation measures in case of exceedances of Action and Limit levels in accordance with the Event / Action Plans
 - Implement measures to reduce impact where Action and Limit levels are exceeded
 - Adhere to the procedures for carrying out complaint investigation

Environmental Team (ET)

- 2.2.9 Once the ET is appointed, the EPD, CEDD, ER, Architect and IEC will be notified the details of the ET.
- 2.2.10 The ET shall not be in any way an associated body of the Contractor(s), and shall be employed by the Project Proponent/Contractor to conduct the EM&A programme. The ET should be managed by the ET Leader. The ET Leader shall be a person who has at least 7 years' experience in EM&A and has relevant professional qualifications. Suitably qualified staff should be included in the ET, and resources for the implementation of the EM&A programme should be allocated in time under the Contract(s), to enable fulfillment of the Project's EM&A requirements as specified in the EM&A Manual during construction of the Project. The ET shall report to the Project Proponent and the duties shall include:
 - Monitor and audit various environmental parameters as required in this EM&A Manual
 - Analyse the environmental monitoring and audit data, review the success of EM&A programme and the adequacy of mitigation measures implemented, confirm the validity of the EIA predictions and identify any adverse environmental impacts arising
 - Carry out regular site inspection to investigate and audit the Contractors' site practice, equipment/plant and work methodologies with respect to pollution control and environmental mitigation, and effect proactive action to pre-empt problems
 - Monitor compliance with conditions in the EP, environmental protection, pollution prevention and control regulations and contract specifications
 - Audit environmental conditions on site
 - Report on the environmental monitoring and audit results to EPD, the ER, the Architect, the IEC and Contractor or their delegated representatives
 - Recommend suitable mitigation measures to the Contractor in the case of exceedance of Action and Limit levels in accordance with the Event and Action Plans
 - Liaise with the IEC on all environmental performance matters and timely submit all relevant EM&A proforma for approval by IEC
 - Advise the Contractor(s) on environmental improvement, awareness, enhancement measures etc., on site
 - Adhere to the procedures for carrying out complaint investigation



• Liaison with the client departments, Engineer/Engineer's Representative, ET, IEC and the Contractor(s) of the concurrent projects as listed under Section 2.3 below regarding the cumulative impact issues.

Independent Environmental Checker (IEC)

- 2.2.11 One IEC will be employed for this Project. Once the IEC is appointed, EPD, ER, the Architect and ET will be notified the details of the IEC.
- 2.2.12 The Independent Environmental Checker (IEC) should not be in any way an associated body of the Contractor or the ET for the Project. The IEC should be employed by the Permit Holder (i.e., CEDD) prior to the commencement of the construction of the Project. The IEC should have at least 10 years' experience in EM&A and have relevant professional qualifications. The appointment of IEC should be subject to the approval of EPD. The IEC should:
 - Provide proactive advice to the ER and the Project Proponent on EM&A matters related to the project, independent from the management of construction works, but empowered to audit the environmental performance of construction
 - Review and audit all aspects of the EM&A programme implemented by the ET
 - Review and verify the monitoring data and all submissions in connection with the EP and EM&A Manual submitted by the ET
 - Arrange and conduct regular, at least monthly site inspections of the works during construction phase, and ad hoc inspections if significant environmental problems are identified
 - Check compliance with the agreed Event / Action Plan in the event of any exceedance
 - Check compliance with the procedures for carrying out complaint investigation
 - Check the effectiveness of corrective measures
 - Feedback audit results to ET by signing off relevant EM&A proforma
 - Check that the mitigation measures are effectively implemented
 - Verify the log-book(s) mentioned in Condition 2.2 of the EP, notify the Director by fax, within one working day of receipt of notification from the ET Leader of each and every occurrence, change of circumstances or non-compliance with the EIA Report and/or the EP, which might affect the monitoring or control of adverse environmental impacts from the Project
 - Report the works conducted, the findings, recommendation and improvement of the site inspections, after reviewing ET's and Contractor's works, and advices to the ER and Project Proponent on a monthly basis
 - Liaison with the client departments, Engineer/Engineer's Representative, the Architect, ET, IEC and the Contractor of the concurrent projects as listed under Section 2.3 below regarding the cumulative impact issues.

2.3 CONCURRENT PROJECTS

- 2.3.1 The concurrent construction works that may be carried out include, but not limited to, the following:
 - (a) Regulation of Shenzhen River Stage IV;
 - (b) Widening of Fanling Highway Tai Hang to Wo Hop Shek Interchange Contract No. HY/2012/06;
 - (c) Construction of BCP facilities in Shenzhen.

2.4 CONSTRUCTION PROGRESS

2.4.1 In the Reporting Period, the major construction activity conducted under the Project is located in Contracts 2, 3, 6, 7 and SS C505 and they are summarized in below. Moreover, 3-month rolling construction program for all the current contracts is enclosed in *Appendix C*.



Contract 2 (CV/2012/08)

2.4.2 The contract commenced in May 2014. In this Reporting Period, construction activities conducted are listed below:

Mid-Vent Portal	 Cavern internal structure Stud tunnel post-excavation and earthworks Structure connecting adit and ventilation building and backfilling Ventilation building superstructure Ventilation building internal structure
North Portal	 Southbound tunnel waterproofing and lining Southbound tunnel bench enlargement Southbound tunnel internal structure, backfilling and cross passage Tunnel Boring Machine (TBM) North drive excavation Northbound tunnel top heading and bench excavation, water proofing and lining North ventilation building structure Construction of retaining wall Mucking out from tunnels D1500 drainage pipe jacking
South Portal Admin Building	 Post-excavation tunnel activities South ventilation building superstructure and internal structure Tunnel invert, waterproofing, lining, internal structure and cross passage Construction of retaining wall Mucking out from tunnels Construction of fence wall, curtain wall, drainage, internal structure,
	underground utilities and E&M installation

Contract 3 (CV/2012/09)

- 2.4.3 The Contract commenced in November 2013. In this Reporting Period, construction activities conducted are listed below:
 - Cable detection and Trial Trenches
 - Remaining works on New Kiu Tau Footbridge
 - Noise barrier construction
 - Roadworks
 - Viaduct Segment Erection
 - Water Main Laying
 - Installation of Noise Barrier Steel Column & Panel
 - Parapet installation on bridge deck
 - Drainage Work
 - Mini-pile Installation
 - Construction of profile barrier & Planter wall on Bridge deck
 - Stressing of External Tendon
 - Construction of Retaining Wall behind Abutment

Contract 4 (NE/2014/02)

- 2.4.4 The Contract was awarded in mid-April 2016 and the construction work was commenced on 2 May 2017. In this Reporting Period, construction activities conducted are listed below:
 - System design
 - E&M installation at Admin Building

Contract 5 (CV/2013/03)

2.4.5 As advised by the ER, the construction works under Contract 5 was substantially completed on 31 August 2016.



Contract 6 (CV/2013/08)

- 2.4.6 Contract 6 has awarded in June 2015 and construction work was commenced on 23 October 2015. In this Reporting Period, construction activities conducted are listed below:
 - Bridge Segment Erection
 - Bridge Installation Works
 - Tunnel Works
 - Sewage Treatment Plant Construction
 - Tunnel Ventilation Building Construction
 - Slip Road/ At-grade Road/ Periphery Road Construction

Contract 7 (NE/2014/03)

- 2.4.7 Contract 7 has awarded in December 2015 and construction work was commenced on 15 February 2016. In this Reporting Period, construction activities conducted are listed below:
 - Column construction at Bridges A and E
 - Deck construction at Bridge B and D
 - Installation of Façade at Bridge C
 - Parapet Wall construction at Bridge C

Contract SS C505

- 2.4.8 Contract SS C505 has awarded in July 2015 and construction work was commenced on 1 September 2015. In this Reporting Period, construction activities conducted are listed below:
 - Building no. 1, 2, 3, 4, 5, 6, 7, 9, 10, 11, 13, 18, 41 and 43 construction
 - Tower crane operation
 - Bridge construction works including construction of bridge column, retaining wall, pile cap, pier, abutment, road and finishes works
 - Underground drainage works, Road Works, CLP Cable laying and Landscaping
 - Formwork and falsework for PTB's slab construction and Bridges Decks
 - Construction PTB M/F, 1/F, 2/F and Roof flat slab
 - Construction PTB non-structural wall, Late Cast Strip, Stairs and Lift Shaft
 - Steel beam works for maintenance platform for PTB
 - PTB backfilling works
 - Elevated Walkway E1, E2, E3 and E4 construction
 - Bridge deck construction for Bridges 1 5

2.5 SUMMARY OF ENVIRONMENTAL SUBMISSIONS

- 2.5.1 In according to the EP, the required documents have submitted to EPD which listed in below:
 - Project Layout Plans of Contracts 2, 3, 4, 5, 6, 7 and SS C505
 - Landscape Plan
 - Topsoil Management Plan
 - Environmental Monitoring and Audit Programme
 - Baseline Monitoring Report (TCS00690/13/600/R0030v3) for the Project
 - Waste Management Plan of the Contracts 2, 3, 4, 5, 6, 7 and SS C505
 - Contamination Assessment Plan (CAP) and Contamination Assessment Report (CAR) for Po Kat Tsai, Loi Tung and the workshops in Fanling
 - Vegetation Survey Report
 - Woodland Compensation Plan
 - Habitat Creation Management Plan
 - Wetland Compensation Plan
- 2.5.2 Summary of the relevant permits, licenses, and/or notifications on environmental protection for the Project of each contracts are presented in *Table 2-1*.

Table 2-1 Status of Environmental Licenses and Permits of the Contracts

Item	Description	License/Permit Status
------	-------------	-----------------------



		Ref. no.	Effective Date	Expiry Date
		Contract 2		
1	Air pollution Control (Construction Dust) Regulation	Ref No.: 368864	31 Dec 2013	Till Contract ends
2	Chemical Waste Producer Registration	North Portal Waste Producers Number: No.5213-652-D2523-01	25 Mar 2014	Till Contract ends
		Mid-Vent Portal Waste Producers Number: No.5213-634-D2524-01	25 Mar 2014	Till Contract ends
		South Portal Waste Producers Number: No.5213-634-D2526-01	9 Apr 2014	Till Contract ends
3	Water Pollution	No.WT00018374-2014	8 Oct 2014	30 Sep 2019
	Control Ordinance -	No.: W5/1I389	28 Mar 2014	31 Mar 2019
	Discharge License	No. WT00023063-2015	18 Dec 2015	31 Mar 2019
		No.: W5/1I392	28 Mar 2014	31 Mar 2019
4	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7019105	8 Jan 2014	Till Contract ends
5	Construction Noise	GW-RN0288-17	26-Apr-2017	20-Oct-2017
	Permit	GW-RN0291-17	26-Apr-2017	20-Oct-2017
		GW-RN0318-17	09-May-2017 30-Jul-2017	27-Oct-2017
		GW-RN0484-17 GW-RN0515-17	10-Aug-2017	20-Jan-2018 01-Feb-2018
		GW-RN0519-17	10-Aug-2017	01-Feb-2018
		GW-RN0601-17	27-Sep-2017	21-Mar-2018
		GW-RN0604-17	20-Sep-2017	16-Mar-2018
		GW-RN0605-17	27-Sep-2017	21-Mar-2018
		GW-RN0608-17	01-Oct-2017	31-Mar-2018
		GW-RN0673-17	28-Oct-2017	27-Apr-2018
6	Specified Process License (Mortar Plant Operation)	L-3-251(1)	12 Apr 2016	11 Apr 2021
		Contract 3		
1	Air pollution Control (Construction Dust) Regulation	Ref. No: 362101	17 Jul 2013	Till Contract ends
2	Chemical Waste Producer Registration	Waste Producers Number: No.:5113-634-C3817-01	7 Oct 2013	Till Contract ends
3	Water Pollution Control Ordinance - Discharge License	No.:WT00016832 – 2013	28 Aug 13	31 Aug 2018
4	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7017914	2 Aug 13	Till Contract ends
5	Construction Noise	GW-RN0235-17	11 Apr 2017	7 Oct 2017
3	Construction moise	O W-IXINU233-17	11 Apr 2017	/ OCI 201/



		License/Permit Status				
Item	Description	Ref. no.	Effective Date	Expiry Date		
	Permit	GW-RN0303-17	11 May 2017	10 Nov 2017		
		GW-RN0342-17	28 May 2017	20 Nov 2017		
		GW-RN0376-17	22 Jun 2017	21 Dec 2017		
		GW-RN0417-17	27 Jun 2017	16 Dec 2017		
		GW-RN0458-17	16 Jul 2017	18 Dec 2017		
		GW-RN0477-17	28 Jul 2017	5 Jan 2018		
		GW-RN0500-17	29 Aug 2017	24 Feb 2018		
		GW-RN0501-17	25 Aug 2017	24 Feb 2018		
		GW-RN0508-17	16 Aug 2017	15 Feb 2018		
		GW-RN0510-17	16 Aug 2017	18 Nov 2018		
		GW-RN0549-17	6 Sep 2017	5 Mar 2018		
		GW-RN0564-17	1 Oct 2017	31 Mar 2018		
		GW-RN0567-17	10 Sep 2017	21 Feb 2018		
		GW-RN0571-17	30 Sep 2017	29 Mar 2018		
		GW-RN0669-17	20 Oct 2017	25 Oct 2018		
		Contract 5	10.16 00.10	T 1 0		
1	Air pollution Control (Construction Dust) Regulation	Ref. No: 359338	13 May 2013	Till the end of Contract		
2	Chemical Waste Producer Registration	Waste Producers Number No.: 5213-642-S3735-01	8 Jun 2013	Till the end of Contract		
3	Water Pollution Control Ordinance - Discharge License	No.: W5/1G44/1	8 Jun 13	30 Jun 2018		
4	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7017351	29 Apr 13	Till the end of Contract		
		Contract 6				
1	Air pollution Control (Construction Dust) Regulation	Ref. No: 390614	29 Jun 2015	Till the end of Contract		
2	Chemical Waste Producer Registration	Waste Producers Number No.: 5213-652-C3969-01	31 Aug 2015	Till the end of Contract		
3	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7022707	9 Jul 2015	Till the end of Contract		
4	Water Pollution	No.:WT00024574-2016	31 May 2016	31 May 2021		
	Control Ordinance - Discharge License	No.:WT00024576-2016	31 May 2016	31 May 2021		
		No.:WT00024742-2016	14 June 2016	30 June 2021		
		No.:WT00024746-2016	14 June 2016	30 June 2021		
5	Construction Noise	GW-RW0428-17	28 Aug 2017	27 Feb 2018		
	Permit	GW-RW0542-17	21 Aug 2017	20 Jan 2018		



		License/Permit Status			
Item	Description	Ref. no.	Effective Date	Expiry Date	
		GW-RW0578-17	11 Sep 2017	8 Dec 2017	
		GW-RW0598-17	18 Sep 2017	17 Mar 2018	
		GW-RW0684-17	30 Oct 2017	29 Apr 2018	
		Contract SS C505			
1	Air pollution Control (Construction Dust) Regulation	Ref. No: 390974	13 Jul 2015	Till the end of Contract	
2	Chemical Waste Producer Registration	Waste Producer No.: 5213-642-L1048-07	16 Sep 2015	Till the end of Contract	
3	Water Pollution Control Ordinance - Discharge License	No.: WT00024865-2016	8 Jul 2016	30 Nov 2020	
4	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7022831	23 Jul 2015	Till the end of Contract	
5	Construction Noise	GW-RN0355-17	30 May 2017	25 Nov 2017	
	Permit	GW-RN0499-17	7 Aug 2017	6 Oct 2017	
		GW-RN0624-17	6 Oct 2017	5 Apr 2018	
		Contract 7			
1	Air pollution Control (Construction Dust) Regulation	Ref. No: 397015	21 Dec 2015	Till the end of Contract	
2	Chemical Waste Producer Registration	Waste Producer No.: 5214-641-K3202-01	24 Mar 2016	Till the end of Contract	
3	Water Pollution Control Ordinance - Discharge License	No.: WT00024422-2016	10 May 2016	31 May 2021	
4	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7024129	21 Jan 2016	Till the end of Contract	
5	Construction Noise Permit	GW-RN0321-17	10 May 2017	4 Nov 2017	
		Contract 4			
1	Air pollution Control (Construction Dust) Regulation	Ref. No. 405353	22 July 2016	Till the end of Contract	
2	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7024973	13 May 2016	Till the end of Contract	



3 SUMMARY OF IMPACT MONITORING REQUIREMENTS

3.1 GENERAL

- 3.1.1 The Environmental Monitoring and Audit requirements are set out in the Approved EM&A manual. Environmental issues such as air quality, construction noise and water quality were identified as the key issues during the construction phase of the Project.
- 3.1.2 A summary of construction phase EM&A requirements are presented in the sub-sections below.

3.2 MONITORING PARAMETERS

- 3.2.1 The EM&A program of construction phase monitoring shall cover the following environmental issues:
 - Air quality;
 - Construction noise; and
 - Water quality
- 3.2.2 A summary of the monitoring parameters is presented in *Table 3-1*.

Table 3-1 Summary of EM&A Requirements

Environmental Issue	Parameters
Air Quality	1-hour TSP by Real-Time Portable Dust Meter; and
All Quality	24-hour TSP by High Volume Air Sampler.
	• L _{eq(30min)} in normal working days (Monday to Saturday) 07:00-19:00 except public holiday; and
Noise	• 3 sets of consecutive L _{eq(5min)} on restricted hours i.e. 19:00 to 07:00
TVOISC	next day, and whole day of public holiday or Sunday
	Supplementary information for data auditing, statistical results such
	as L_{10} and L_{90} shall also be obtained for reference.
	In-situ Measurements
	 Dissolved Oxygen Concentration (mg/L);
	• Dissolved Oxygen Saturation (%);
	• Turbidity (NTU);
Water Quality	• pH unit;
	Water depth (m); and
	• Temperature (°C).
	Laboratory Analysis
	Suspended Solids (mg/L)

3.3 MONITORING LOCATIONS

3.3.1 The designated monitoring locations as recommended in the *EM&A Manual* are shown in *Appendix D*. As the access to some of the designated monitoring locations was questionable due to safety reason or denied by the landlords, alternative locations therefore have had proposed. The latest alternative monitoring locations has been updated in the revised EM&A Programme (Rev.7) which approved by EPD on 7 April 2017. *Table 3-2*, *Table 3-3* and *Table 3-4* are respectively listed the air quality, construction noise and water quality monitoring locations for the Project and a map showing these monitoring stations is presented in *Appendix E*.

Table 3-2 Impact Monitoring Stations - Air Quality

Station ID	Description	Works Area	Related to the Work Contract
AM1b^	Open area at Tsung Yuen Ha Village	BCP	SS C505
			Contract 7
AM2	Village House near Lin Ma Hang Road	LMH to Frontier	Contract 6
		Closed Area	
AM3	Ta Kwu Ling Fire Service Station of Ta	LMH to Frontier	Contract 6
	Kwu Ling Village.	Closed Area	



Station ID	Description	Works Area	Related to the Work Contract
AM4b^	House no. 10B1 Nga Yiu Ha Village	LMH to Frontier Closed Area	Contract 6
AM5a^	Ping Yeung Village House	Ping Yeung to Wo Keng Shan	Contract 6
AM6	Wo Keng Shan Village House	Ping Yeung to Wo Keng Shan	Contract 6
AM7b [@]	Loi Tung Village House	Sha Tau Kok Road	Contract 2 Contract 6
AM8	Po Kat Tsai Village No. 4	Po Kat Tsai	Contract 2
AM9b#	Nam Wa Po Village House No. 80	Fanling	Contract 3

[#] Proposal for the change of air quality monitoring location from AM9a to AM9b was submitted to EPD on 4 Nov 2013 after verified by the IEC and it was approved by EPD (EPD's ref.: (15) in EP 2/N7/A/52 Pt.10 dated 8 Nov 2013).

Table 3-3 Impact Monitoring Stations - Construction Noise

Station ID	Description	Works Area	Related to the Work Contract
NM1	Tsung Yuen Ha Village House No. 63	ВСР	SS C505 Contract 7
NM2a#	Village House near Lin Ma Hang Road	Lin Ma Hang to Frontier Closed Area	Contract 6
NM3	Ping Yeung Village House (facade facing northeast)	Ping Yeung to Wo Keng Shan	Contract 6
NM4	Wo Keng Shan Village House	Ping Yeung to Wo Keng Shan	Contract 6
NM5	Village House, Loi Tung	Sha Tau Kok Road	Contract 2, Contract 6
NM6	Tai Tong Wu Village House 2	Sha Tau Kok Road	Contract 2, Contract 6
NM7	Po Kat Tsai Village	Po Kat Tsai	Contract 2
NM8	Village House, Tong Hang	Fanling	Contract 2 Contract 3
NM9	Village House, Kiu Tau Village	Fanling	Contract 3
NM10	Nam Wa Po Village House No. 80	Fanling	Contract 3

[#] Proposal for the change of construction noise monitoring location from NM2 to NM2a was verified by the IEC on 6 May 2016 and was effective on 9 May 2016.

^{*} Proposal for the change of air quality monitoring location from AM1to AM1a was submitted to EPD on 24 March 2014 after verified by the IEC. It was approved by EPD (EPD's ref.: (6) in EP 2/N7/A/52 Pt.12 dated 9 Jun 2014).

[@] Proposal for the change of air quality monitoring location from AM7a to AM7b was submitted to EPD on 4 June 2014 after verified by the IEC. It was approved by EPD (EPD's ref.: (7) in EP 2/N7/A/52 Pt.12 dated 9 Jun 2014).

[^] Proposal for change of air quality monitoring locations was enclosed in the updated EM&A Programme which approval by EPD on 29 Mar 2016.



Table 3-4 Impact Monitoring Stations - Water Quality

Station ID	Description	Designated A	nates of / Alternative ation	Nature of the location	Related to the Work
		Easting	Northing		Contract
WM1	Downstream of Kong Yiu Channel	833 679	845 421	Alternative location located at upstream 51m of the designated location	SS C505 Contract 6
WM1- Control	Upstream of Kong Yiu Channel	834 185	845 917	NA	SS C505 Contract 6
WM2A	Downstream of River Ganges	834 204	844 471	Alternative location located at upstream 81m of the designated location	Contract 6
WM2A(a)*	Downstream of River Ganges	834 191	844 474	Alternative location located at upstream 70m of the designated location	Contract 6
WM2A- Controlx#	Upstream of River Ganges	835 377	844 188	Alternative location located at upstream 160m of the designated location	Contract 6
WM2B	Downstream of River Ganges	835 433	843 397	NA	Contract 6
WM2B- Control	Upstream of River Ganges	835 835	843 351	Alternative location located at downstream 31m of the designated location	Contract 6
WM3x#	Downstream of River Indus	836 206	842 270	Alternative location located at downstream 180m of the designated location	Contract 2 Contract 6
WM3- Control	Upstream of River Indus	836 763	842 400	Alternative location located at downstream 26m of the designated location	Contract 2 Contract 6
WM4	Downstream of Ma Wat Channel	833 850	838 338	Alternative location located at upstream 11m of the designated location	Contract 2 Contract 3
WM4– Control A	Kau Lung Hang Stream	834 028	837 695	Alternative location located at downstream 28m of the designated location	Contract 2 Contract 3
WM4– Control B	Upstream of Ma Wat Channel	833760	837395	Alternative location located at upstream 15m of the designated location	Contract 2 Contract 3

Note: EPD has approved the revised EM&A Programme (Rev.7) which proposed that (1) if the measured water depth of the monitoring station is lower than 150 mm, alternative location based on the criteria were selected to perform water monitoring; and (2) If no suitable alternative location could be found within 15m far from the original location, the sampling at that location will be cancelled since sampling at too far from the designated location could not make a representative sample in accordance with the updated EM&A Programme (Rev. 07) (Section 4.1.4) (EPD ref.: () in EP2/N7/A/52 Ax(1) Pt.20 dated 7 April 2017)

3.4 MONITORING FREQUENCY AND PERIOD

The requirements of impact monitoring are stipulated in Sections 2.1.6, 3.1.5 and 4.1.6 of the

^(*) Proposal for the change of water monitoring location from WM2A to WM2A(a) was verified by the IEC and it was approved by EPD. (EPD's ref. (10) in EP 2/N7/A/52 Pt.19)

^(#) Proposal for the change of water quality monitoring location (WM3x and WM2A-Cx was included in the EM&A Programme Rev .05 which approved by EPD on 29 March 2016 (EPD ref.: (3) in EP2/N7/A/52 Ax(1) Pt.19)



approved EM&A Manual and presented as follows.

Air Quality Monitoring

3.4.1 Frequency of impact air quality monitoring is as follows:

1-hour TSP
 24-hour TSP
 3 times every six days during course of works
 Once every 6 days during course of works.

Noise Monitoring

3.4.2 One set of $L_{eq(30min)}$ as 6 consecutive $L_{eq(5min)}$ between 0700-1900 hours on normal weekdays and once every week during course of works. If construction work necessary to carry out at other time periods, i.e. restricted time period (19:00 to 07:00 the next morning and whole day on public holidays) (hereinafter referred as "the restricted hours"), additional weekly impact monitoring for $L_{eq(5min)}$ measurement shall be employed during respective restricted hours periods.. Supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.

Water Quality Monitoring

3.4.3 The water quality monitoring frequency shall be 3 days per week during course of works. The interval between two sets of monitoring shall not be less than 36 hours.

3.5 MONITORING EQUIPMENT

Air Quality Monitoring

- 3.5.1 The 24-hour and 1-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the *Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B*. If the ET proposes to use a direct reading dust meter to measure 1-hour TSP levels, it shall submit sufficient information to the IEC to approve.
- 3.5.2 The filter paper of 24-hour TSP measurement shall be determined by HOKLAS accredited laboratory.
- 3.5.3 All equipment to be used for air quality monitoring is listed in *Table 3-5*.

Table 3-5 Air Quality Monitoring Equipment

Equipment Model					
	24-Hr TSP				
High Volume Air Sampler TISCH High Volume Air Sampler, HVS Model TE-5170*					
Calibration Kit	TISCH Model TE-5025A*				
	1-Hour TSP				
Portable Dust Meter	Sibata LD-3B Laser Dust monitor Particle Mass Profiler &				
Fortable Dust Weter	Counter*				

^{*} Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

Wind Data Monitoring Equipment

- 3.5.4 According to the approved EM&A Manual, wind data monitoring equipment shall also be provided and set up for logging wind speed and wind direction near the dust monitoring locations. The equipment installation location shall be proposed by the ET and agreed with the IEC. For installation and operation of wind data monitoring equipment, the following points shall be observed:
 - 1) The wind sensors should be installed 10 m above ground so that they are clear of obstructions or turbulence caused by buildings.
 - 2) The wind data should be captured by a data logger. The data shall be downloaded for analysis at least once a month.
 - 3) The wind data monitoring equipment should be re-calibrated at least once every six months.



- 4) Wind direction should be divided into 16 sectors of 22.5 degrees each.
- 3.5.5 ET has liaised with the landlords of the successful granted HVS installation premises. However, the owners rejected to provide premises for wind data monitoring equipment installation.
- 3.5.6 Under this situation, the ET proposed alternative methods to obtain representative wind data. Meteorological information as extracted from "the Hong Kong Observatory Ta Kwu Ling Station" is alternative method to obtain representative wind data. For Ta Kwu Ling Station, it is located nearby the Project site. Moreover, this station is located at 15m above mean sea level while its anemometer is located at 13m above the existing ground which in compliance with the general setting up requirement. Furthermore, this station also can be to provide the humidity, rainfall, and air pressure and temperature etc. meteorological information. In Hong Kong of a lot development projects, weather information extracted from Hong Kong Observatory is common alternative method if weather station installation not allowed.

Noise Monitoring

- 3.5.7 Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. The sound level meter shall be checked using an acoustic calibrator. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.
- 3.5.8 Noise monitoring equipment to be used for monitoring is listed in *Table 3-6*.

Table 3-6 Construction Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	B&K Type 2238* or Rion NL-31* or Rion NL-52*
Calibrator	B&K Type 4231* or Quest QC-20* or Rion NC-74*
Portable Wind Speed Indicator	Testo Anemometer

^{*} Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

3.5.9 Sound level meters listed above comply with the *International Electrotechnical Commission Publications 651: 1979 (Type 1)* and *804: 1985 (Type 1)* specifications, as recommended in TM issued under the NCO. The acoustic calibrator and sound level meter to be used in the impact monitoring will be calibrated yearly.

Water Quality Monitoring

- 3.5.10 DO and water temperature should be measured in-situ by a DO/temperature meter. The instrument should be portable and weatherproof using a DC power source. It should have a membrane electrode with automatic temperature compensation complete with a cable. The equipment should be capable of measuring:
 - a DO level in the range of 0-20 mg/l and 0-200% saturation; and
 - a temperature of between 0 and 45 degree Celsius.
- 3.5.11 A portable pH meter capable of measuring a range between 0.0 and 14.0 should be provided to measure pH under the specified conditions accordingly to the APHA Standard Methods.
- 3.5.12 The instrument should be portable and weatherproof using a DC power source. It should have a photoelectric sensor capable of measuring turbidity between 0-1000 NTU.
- 3.5.13 A portable, battery-operated echo sounder or tape measure will be used for the determination of water depth at each designated monitoring station as appropriate.
- 3.5.14 A water sampler e.g. Kahlsico Water Sampler, which is a transparent PVC cylinder with capacity not less than 2 litres, will be used for water sampling if water depth over than 0.5m. For



sampling from very shallow water depths e.g. <0.5 m, water sample collection will be directly from water surface below 100mm use sampling plastic bottle to avoid inclusion of bottom sediment or humus. Moreover, Teflon/stainless steel bailer or self-made sampling buckets maybe used for water sampling. The equipment used for sampling will be depended the sampling location and depth situations.

- 3.5.15 Water samples for laboratory measurement of SS will be collected in high density polythene bottles, packed in ice (cooled to 4 °C without being frozen), and delivered to the laboratory in the same day as the samples were collected.
- 3.5.16 Analysis of suspended solids should be carried out in a HOKLAS or other accredited laboratory. Water samples of about 1L should be collected at the monitoring stations for carrying out the laboratory suspended solids determination. The SS determination work should start within 24 hours after collection of the water samples. The SS analyses should follow the *APHA Standard Methods 2540D* with Limit of Reporting of 2 mg/L.
- 3.5.17 Water quality monitoring equipment used in the impact monitoring is listed in *Table 3-7*. Suspended solids (SS) analysis is carried out by a local HOKLAS-accredited laboratory, namely *ALS Technichem (HK) Pty Ltd*.

Table 3-7 Water Quality Monitoring Equipment

Equipment	Model
Water Depth Detector	Eagle Sonar or tape measures
Water Sampler	A 2-litre transparent PVC cylinder with latex cups at both ends or teflon/stainless steel bailer or self-made sampling bucket
Thermometer & DO meter	YSI Professional Plus /YSI PRO20 Handheld Dissolved Oxygen Instrument/ YSI 550A Multifunctional Meter*/ YSI Professional DSS
pH meter	YSI Professional Plus / AZ8685 pH pen-style meter*/ YSI 6820/650MDS/ YSI Professional DSS
Turbidimeter	Hach 2100Q*/ YSI 6820/ 650MDS/ YSI Professional DSS
Sample Container	High density polythene bottles (provided by laboratory)
Storage Container	'Willow' 33-liter plastic cool box with Ice pad

^{*} Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

3.6 MONITORING METHODOLOGY

1-hour TSP Monitoring

- 3.6.1 The 1-hour TSP monitor was a brand named "Sibata LD-3B Laser Dust monitor Particle Mass Profiler & Counter" which is a portable, battery-operated laser photometer. The 1-hour TSP meter provides a real time 1-hour TSP measurement based on 90° light scattering. The 1-hour TSP monitor consists of the following:
 - (a.) A pump to draw sample aerosol through the optic chamber where TSP is measured;
 - (b.) A sheath air system to isolate the aerosol in the chamber to keep the optics clean for maximum reliability; and
 - (c.) A built-in data logger compatible with Windows based program to facilitate data collection, analysis and reporting.
- 3.6.2 The 1-hour TSP meter is used within the valid period as follow manufacturer's Operation and Service Manual.

24-hour TSP Monitoring

3.6.3 The equipment used for 24-hour TSP measurement is Tisch Environmental, Inc. Model TE-5170 TSP high volume air sampling system, which complied with *EPA Code of Federal Regulation*, *Appendix B to Part 50*. The High Volume Air Sampler (HVS) consists of the following:



- (a.) An anodized aluminum shelter;
- (b.) A 8"x10" stainless steel filter holder;
- (c.) A blower motor assembly;
- (d.) A continuous flow/pressure recorder;
- (e.) A motor speed-voltage control/elapsed time indicator;
- (f.) A 7-day mechanical timer, and
- (g.) A power supply of 220v/50 Hz
- 3.6.4 The HVS is operated and calibrated on a regular basis in accordance with the manufacturer's instruction using Tisch Calibration Kit Model TE-5025A. Calibration would carry out in two month interval.
- 3.6.5 24-hour TSP is collected by the ET on filters of HVS and quantified by a local HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd (ALS), upon receipt of the samples. The ET keep all the sampled 24-hour TSP filters in normal air conditioned room conditions, i.e. 70% RH (Relative Humidity) and 25°C, for six months prior to disposal.

Noise Monitoring

- Noise measurements were taken in terms of the A-weighted equivalent sound pressure level (L_{eq}) measured in decibels dB(A). Supplementary statistical results (L_{10} and L_{90}) were also obtained for reference.
- 3.6.7 During the monitoring, all noise measurements would be performed with the meter set to FAST response and on the A-weighted equivalent continuous sound pressure level (L_{eq}). $Leq_{(30min)}$ in six consecutive $Leq_{(5min)}$ measurements will use as the monitoring parameter for the time period between 0700-1900 hours on weekdays; $Leq_{(5min)}$ measurements would be used as monitoring parameter for other time periods (e.g. during restricted hours), if necessary.
- 3.6.8 Prior of noise measurement, the accuracy of the sound level meter is checked using an acoustic calibrator generating a known sound pressure level at a known frequency. The checking is performed before and after the noise measurement.

Water Quality

3.6.9 Water quality monitoring is conducted at the designated or alternative locations. The sampling procedures with the in-situ monitoring are presented as below:

Sampling Procedure

- A Digital Global Positioning System (GPS) is used to identify the designated monitoring stations prior to water sampling. A portable, battery-operated echo sounder or tape measurement is used for the determination of water depth at each station. At each station, water sample would be collected from 0.1m below water surface or the water surface to prevent the river bed sediment for stirring.
- 3.6.11 If the water level of a monitoring station is too shallow when sampling, sediment would be disturbed which affecting the accuracy of water quality monitoring. In order to avoid disturbing sediment, depth limits should be set up for the water sampling for the ease of reference. When the measured water depth of the monitoring station (both control and impact stations) is lower than 150mm, water monitoring would not be to perform at that monitoring location. Instead, the monitoring location will be moved to a temporary alternative location monitoring location based on the criteria below:-
 - (a) the alternative location should be either upstream or downstream of the original location and at the same the river/drain channel
 - (b) the alternative location should be within 15m far from the original location
 - (c) if no suitable alternative location could be found within 15m far from the original location, the sampling at that location will be cancelled since sampling at too far from the designated



location could not make a representative sample.

- 3.6.12 The sample container will be rinsed with a portion of the water sample. The water sample then will be transferred to the high-density polythene bottles as provided by the laboratory, labeled with a unique sample number and sealed with a screw cap.
- 3.6.13 Before sampling, general information such as the date and time of sampling, weather condition as well as the personnel responsible for the monitoring would be recorded on the field data sheet.
- 3.6.14 A 'Willow' 33-liter plastic cool box packed with ice will be used to preserve the water samples prior to arrival at the laboratory for chemical determination. The water temperature of the cool box is maintained at a temperature as close to 4°C as possible without being frozen. Samples collected are delivered to the laboratory upon collection.

In-situ Measurement

- 3.6.15 YSI 550A Multifunctional Meter is used for water in-situ measures, which automates the measurements and data logging of temperature, dissolved oxygen and dissolved oxygen saturation.
- 3.6.16 A portable AZ Model 8685 is used for in-situ pH measurement. The pH meter is capable of measuring pH in the range of 0 14 and readable to 0.1.
- 3.6.17 A portable Hach 2100Q Turbidimeter is used for in-situ turbidity measurement. The turbidity meter is capable of measuring turbidity in the range of 0 1000 NTU.
- 3.6.18 All in-situ measurement equipment are calibrated by HOKLAS accredited laboratory of three month interval.

Laboratory Analysis

3.6.19 All water samples analyzed Suspended Solids (SS) will be carried out by a local HOKLAS-accredited testing laboratory (ALS Technichem (HK) Pty Ltd HOKLAS registration no. 66). SS determination using *APHA Standard Methods 2540D* as specified in the *EM&A Manual* will start within 48 hours of water sample receipt.

3.7 EQUIPMENT CALIBRATION

- 3.7.1 Calibration of the HVS is performed upon installation and thereafter at bimonthly intervals in accordance with the manufacturer's instruction using the certified standard calibrator (TISCH Model TE-5025A). Moreover, the Calibration Kit would be calibrated annually. The calibration data are properly documented and the records are maintained by ET for future reference.
- 3.7.2 The 1-hour TSP meter was calibrated by the supplier prior to purchase. Zero response of the equipment would be checked before and after each monitoring event. Annually calibration with the High Volume Sampler (HVS) in same condition would be undertaken by the Laboratory.
- 3.7.3 The sound level meter and calibrator are calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme at yearly basis.
- 3.7.4 All water quality monitoring equipment would be calibrated by HOKLAS accredited laboratory of three month intervals.
- 3.7.5 The calibration certificates of all monitoring equipment used for the impact monitoring program in the Reporting Period and the HOKLAS accredited certificate of laboratory are attached in *Appendix F*.



3.8 DERIVATION OF ACTION/LIMIT (A/L) LEVELS

3.8.1 The baseline results form the basis for determining the environmental acceptance criteria for the impact monitoring. According to the approved Environmental Monitoring and Audit Manual, the air quality, construction noise and water quality criteria were set up, namely Action and Limit levels are listed in *Tables 3-8*, *3-9* and *3-10*.

Table 3-8 Action and Limit Levels for Air Quality Monitoring

Manitaring Station	Action 1	Level (μg /m³)	Limit I	Level (µg/m³)
Monitoring Station	1-hour TSP	24-hour TSP	1-hour TSP	24-hour TSP
AM1b	265	143		
AM2	268	149		
AM3	269	145	500 260	260
AM4b	267	148		
AM5a	268	143		
AM6	269	148		
AM7b	275	156		
AM8	269	144		
AM9b	271	151		

Table 3-9 Action and Limit Levels for Construction Noise

Monitoring Location	Action Level	Limit Level in dB(A) ours on normal weekdays	
Withintoning Location	Time Period: 0700-1900 hours on normal weekdays		
NM1, NM2a, NM3, NM4, NM5, NM6, NM7, NM8, NM9, NM10	When one or more documented complaints are received	75 dB(A) ^{Note 1 & Note 2}	

Note 1: Acceptable Noise Levels for school should be reduced to 70 dB(A) and 65 dB(A) during examination period.

Table 3-10 Action and Limit Levels for Water Quality

Danamatan	Performance	Monitoring Location				
Parameter	criteria	WM1	WM2A(a)	WM2B	WM3x	WM4
DO	Action Level	(*)4.23	(**)4.00	^(*) 4.74	(**)4.00	(*)4.14
(mg/L)	Limit Level	^(#) 4.19	(**)4.00	^(#) 4.60	(**)4.00	^(#) 4.08
	Action Level	51.3	51.3 24.9 11.4 13.4			
Turbidity	Action Level	AND	120% of upstream control station of the same day			
(NTU)	Limit Level	67.6	33.8	12.3	14.0	38.4
		AND	130% of upstream control station of the same day			
	Action Level	54.5	14.6	11.8	12.6	39.4
CC (/I)	Action Level	AND	120% of upstream control station of the same day			ame day
SS (mg/L)	Limit Level	64.9	17.3	12.4	12.9	45.5
		AND	130% of ups	tream control s	tation of the s	ame day

Remarks:

3.8.2 Should non-compliance of the environmental quality criteria occurs, remedial actions will be triggered according to the Event and Action Plan which presented in *Appendix G*.

3.9 DATA MANAGEMENT AND DATA QA/QC CONTROL

3.9.1 All monitoring data will be handled by the ET's in-house data recording and management system.

Note 2: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.

^(*) The Proposed Action Level of Dissolved Oxygen is adopted to be used 5%-ile of baseline data

^(**) The Proposed Action & Limit Level of Dissolved Oxygen is used 4mg/L

^(#) The Proposed **Limit Level** of Dissolved Oxygen is adopted to be used 1%-ile of baseline data



The monitoring data recorded in the equipment will be downloaded directly from the equipment at the end of each monitoring day. The downloaded monitoring data will input into a computerized database maintained by the ET. The laboratory results will be input directly into the computerized database and checked by personnel other than those who input the data.

3.9.2 For monitoring parameters that require laboratory analysis, the local laboratory shall follow the QA/QC requirements as set out under the HOKLAS scheme for the relevant laboratory tests.



4 AIR QUALITY MONITORING

4.1 GENERAL

- 4.1.1 In the Reporting Period, construction works under the project have been commenced in Contracts 2, 3, 4, 6, 7 and Contract SS C505. Hence, air quality monitoring was performed at all designated locations.
- 4.1.2 The air quality monitoring schedule is presented in *Appendix H* and the monitoring results are summarized in the following sub-sections.

4.2 AIR QUALITY MONITORING RESULTS

4.2.1 In the Reporting Period, a total of 135 events of 1-hour TSP and 45 events 24-hours TSP monitoring were carried out and the monitoring results are summarized in Tables 4-1 to 4-9. The detailed 24-hour TSP monitoring data are presented in Appendix I and the relevant graphical plots are shown in Appendix J.

Table 4-1 Summary of 24-hour and 1-hour TSP Monitoring Results – AM1b

	24-hour		1-hour TSP (μg/m³)						
Date	TSP $(\mu g/m^3)$	Date	Start Time	1 st reading	2 nd reading	3 rd reading			
6-Oct-17	79	6-Oct-17	9:34	69	69	65			
12-Oct-17	132	12-Oct-17	9:33	40	39	45			
18-Oct-17	74	18-Oct-17	9:37	39	40	32			
24-Oct-17	136	24-Oct-17	13:36	72	71	65			
30-Oct-17	98	30-Oct-17	9:27	78	81	77			
Average	104	Average		59					
(Range)	(74 - 136)	(Range) (32 – 81)							

Table 4-2 Summary of 24-hour and 1-hour TSP Monitoring Results – AM2

	<u> </u>	0						
	24-hour		1	-hour TSP (µg	(m^3)			
Date	TSP (µg/m³)	Date	Start Time	1 st reading	2 nd reading	3 rd reading		
6-Oct-17	93	6-Oct-17	9:32	73	74	73		
12-Oct-17	136	12-Oct-17	9:29	39	41	46		
18-Oct-17	64	18-Oct-17	9:23	41	41	35		
24-Oct-17	145	24-Oct-17	13:26	71	69	74		
30-Oct-17	135	30-Oct-17	9:01	80	84	81		
Average	115	Average		61				
(Range)	(64 - 145)	(Range)		(35 - 84)				

Table 4-3 Summary of 24-hour and 1-hour TSP Monitoring Results – AM3

	24-hour	1-hour TSP (μg/m³)						
Date	TSP $(\mu g/m^3)$	Date	Start Time	1 st reading	2 nd reading	3 rd reading		
6-Oct-17	104	6-Oct-17	9:30	66	69	66		
12-Oct-17	103	12-Oct-17	9:26	40	42	46		
18-Oct-17	109	18-Oct-17	9:21	41	42	36		
24-Oct-17	93	24-Oct-17	9:37	64	66	70		
30-Oct-17	142	30-Oct-17	13:34	75	78	79		
Average (Range)	110 (93 – 142)	Avera (Rang	~		59 (36 – 79)			



Table 4-4 Summary of 24-hour and 1-hour TSP Monitoring Results – AM4b

	24-hour	1-hour TSP (μg/m³)						
Date	TSP $(\mu g/m^3)$	Date	Start Time	1 st reading	2 nd reading	3 rd reading		
6-Oct-17	63	4-Oct-17	9:00	56	58	60		
12-Oct-17	58	10-Oct-17	9:48	40	40	41		
18-Oct-17	64	16-Oct-17	9:33	45	44	46		
24-Oct-17	39	21-Oct-17	9:30	80	82	84		
30-Oct-17	89	27-Oct-17	9:29	62	65	80		
Average (Range)	63 (39 – 89)	Average (Range)		59 (40 – 84)				

Table 4-5 Summary of 24-hour and 1-hour TSP Monitoring Results – AM5a

	24-hour		1-hour TSP (μg/m³)						
Date	TSP $(\mu g/m^3)$	Date	Start Time	1 st reading	2 nd reading	3 rd reading			
6-Oct-17	56	4-Oct-17	9:03	56	53	56			
12-Oct-17	133	10-Oct-17	9:52	40	40	39			
18-Oct-17	95	16-Oct-17	9:31	42	45	44			
24-Oct-17	101	21-Oct-17	9:33	74	88	92			
30-Oct-17	113	27-Oct-17	9:27	59	61	72			
Average	100	Average		57					
(Range)	(56 - 133)	(Rang	ge)	(39 - 92)					

Table 4-6 Summary of 24-hour and 1-hour TSP Monitoring Results – AM6

	24-hour	1-hour TSP (μg/m³)						
Date	TSP (µg/m³)	Date	Start Time	1 st reading	2 nd reading	3 rd reading		
6-Oct-17	63	4-Oct-17	9:07	55	57	58		
12-Oct-17	139	10-Oct-17	10:04	41	41	41		
18-Oct-17	129	16-Oct-17	9:27	45	46	45		
24-Oct-17	116	21-Oct-17	9:37	73	76	75		
30-Oct-17	104	27-Oct-17	9:21	54	64	73		
Average (Range)	110 (63 – 139)		Average 56 (Range) (41 – 76)					

Table 4-7 Summary of 24-hour and 1-hour TSP Monitoring Results – AM7b

	24-hour	1-hour TSP (μg/m³)						
Date	TSP (μg/m³)	Date	Start Time	1 st reading	2 nd reading	3 rd reading		
6-Oct-17	75	4-Oct-17	9:12	63	59	61		
12-Oct-17	140	10-Oct-17	13:21	39	40	36		
18-Oct-17	73	16-Oct-17	9:23	42	43	45		
24-Oct-17	152	21-Oct-17	9:45	81	97	99		
30-Oct-17	147	27-Oct-17	13:29	74	86	71		
Average	117	Average		62				
(Range)	(73 - 152)	(Rang	ge)		(36 - 99)			



Table 4-8 Summary of 24-hour and 1-hour TSP Monitoring Results – AM8

	24-hour	1-hour TSP (μg/m³)						
Date	TSP $(\mu g/m^3)$	Date	Start Time	1 st reading	2 nd reading	3 rd reading		
6-Oct-17	17	4-Oct-17	13:00	54	51	58		
12-Oct-17	32	10-Oct-17	13:14	40	40	38		
18-Oct-17	24	16-Oct-17	9:18	46	47	43		
24-Oct-17	32	21-Oct-17	13:00	84	73	82		
30-Oct-17	85	27-Oct-17	9:12	70	79	74		
Average	38	Average		59				
(Range)	(17 - 85)	(Rang	ge)	(Range) (38 – 84)				

Table 4-9 Summary of 24-hour and 1-hour TSP Monitoring Results – AM9b

	24-hour		1	-hour TSP (µg	g/m ³)	
Date	TSP $(\mu g/m^3)$	Date	Start Time	1 st reading	2 nd reading	3 rd reading
6-Oct-17	25	6-Oct-17	9:21	43	40	41
12-Oct-17	78	12-Oct-17	9:27	73	74	73
18-Oct-17	49	18-Oct-17	9:34	94	84	84
24-Oct-17	61	24-Oct-17	9:48	56	66	78
30-Oct-17	58	30-Oct-17	9:50	72	70	73
Average	54	Average		68		
(Range)	(25-78)	(Rang	ge)		(40 - 94)	

- 4.2.1 As shown in *Tables 4-1 to 4-9*, all the 1-hour and 24-hour TSP monitoring results were below the Action/Limit Levels. No Notification of Exceedance (NOE) was issued in this Reporting Period.
- 4.2.2 The meteorological data during the impact monitoring days are summarized in *Appendix K*.



5 CONSTRUCTION NOISE MONITORING

5.1 GENERAL

- 5.1.1 In the Reporting Period, construction works under the project have been commenced in Contracts 2, 3, 4, 6, 7 and Contract SS C505 and noise monitoring was performed at all designated locations.
- 5.1.2 The noise monitoring schedule is presented in *Appendix H* and the monitoring results are summarized in the following sub-sections.

5.2 NOISE MONITORING RESULTS (NORMAL DAYTIME)

5.2.1 In the Reporting Period, a total of **45** events noise measurements were carried out at the designated locations. The sound level meter was set in 1m from the exterior of the building façade including noise monitoring locations NM1, NM3, NM4, NM5, NM6, NM7, NM8 and NM9. Therefore, no façade correction (+3 dB(A)) is added according to acoustical principles and EPD guidelines. However, free-field status were performed at NM2a and NM10 and façade correction (+3 dB(A)) has added according to the requirement in this month. The noise monitoring results at the designated locations are summarized in *Tables 5-1 and 5-2*. The detailed noise monitoring data are presented in *Appendix I* and the relevant graphical plots are shown in *Appendix J*.

Table 5-1 Summary of Construction Noise Monitoring Results

	Construction Noise Level (L _{eq30min}), dB(A)								
Date	NM1	NM2a ^(*)	NM8	NM9	NM10 ^(*)				
6-Oct-17	58	74	60	61	64				
12-Oct-17	59	68	60	67	69				
18-Oct-17	57	69	59	66	67				
24-Oct-17	57	71	60	62	64				
30-Oct-17	59	74	63	65	68				
Limit Level		75 dB(A)							

Remarks

Table 5-2 Summary of Construction Noise Monitoring Results

	Construction Noise Level (Leq30min), dB(A)								
Date	NM3	NM4	NM5	NM6	NM7				
4-Oct-17	65	62	51	58	65				
10-Oct-17	60	65	52	59	61				
16-Oct-17	62	65	53	59	61				
27-Oct-17	59	64	51	58	60				
Limit Level			75 dB(A)						

5.2.2 As shown in *Tables 5-1 and 5-2*, the noise level measured at all designated monitoring locations were below 75dB(A). Moreover, no valid noise complaint (which triggered Action Level exceedance) was recorded in the Reporting Period.

f façade correction (+3 dB(A) is added according to acoustical principles and EPD guidelines



6 WATER QUALITY MONITORING

6.1 GENERAL

6.1.1 In the Reporting Period, construction works under the project has been commenced in Contracts 2, 3, 4, 6, 7 and Contract SS C505 and water quality monitoring was performed at all designated locations. The water quality monitoring schedule is presented in *Appendix H*. The monitoring results are summarized in the following sub-sections.

6.2 RESULTS OF WATER QUALITY MONITORING

- 6.2.1 In the Reporting Period, a total of thirteen (13) sampling days was scheduled to carry out for all designated locations with their control stations. Since exceedances were recorded at WM2A(a), and WM4, according to "Event and Action Plan" stipulation, 1, 3 and 2 additional water quality monitoring day was conducted for WM1, WM2A(a) and WM4 respectively and theirs control stations in the reporting period.
- 6.2.2 The key monitoring parameters including Dissolved Oxygen, Turbidity and Suspended Solids are summarized in *Tables 6-1 to 6-5*. Breaches of water quality monitoring criteria are shown in *Table 6-6*. Detailed monitoring database including in-situ measurements and laboratory analysis data are shown in *Appendix I* and the relevant graphical plot are shown in *Appendix J*.

Table 6-1 Water Quality Monitoring Results Associated of Contracts 2 and 3

Date	Dissolved Oxygen (mg/L)				Turbidity (NTU)	r	Suspended Solids (mg/L)		
	WM4	WM4-CA	WM4-CB	WM4	WM4-CA	WM4-CB	WM4	WM4-CA	WM4-CB
3-Oct-17	5.7	6.4	5.6	33.0	8.6	11.1	28.0	<2	6.5
5-Oct-17	5.2	5.4	4.5	15.8	6.8	15.3	19.0	<2	16.0
7-Oct-17	4.8	5.8	4.4	12.8	3.5	11.1	14.0	4.5	12.5
10-Oct-17	5.2	5.5	4.6	32.8	2.6	6.5	39.0	2.5	7.5
12-Oct-17	4.5	5.5	4.0	10.3	3.3	5.4	10.5	3.5	5.0
14-Oct-17	5.0	6.4	3.7	34.9	7.1	10.6	31.5	9.0	11.5
16-Oct-17	4.9	5.1	3.7	130.5	8.2	18.1	77.0	5.5	11.0
17-Oct-17#	#	#	#	92.4	8.9	9.9	<u>58.0</u>	5.0	6.0
18-Oct-17	5.2	5.5	4.1	14.3	2.9	7.0	16.5	3.0	8.0
19-Oct-17#	#	#	#	9.8	2.4	5.1	15.0	2.0	6.0
20-Oct-17	5.6	6.3	5.2	27.0	4.9	5.9	26.5	2.0	5.5
23-Oct-17	5.8	6.7	5.2	13.8	3.4	6.6	17.5	<2	7.0
25-Oct-17	7.5	8.8	7.1	10.1	1.2	5.7	13.5	<2	6.0
27-Oct-17	7.4	8.7	6.9	7.3	1.3	7.8	9.5	<2	11.5
30-Oct-17	8.7	8.5	7.9	11.9	4.7	8.0	15.5	<2	8.0

Remarks: bold with underline indicated Limit Level exceedance

Table 6-2 Water Quality Monitoring Results Associated of Contracts 6 and SS C505

Date		d Oxygen g/L)		bidity TU)	Suspended Solids (mg/L)		
	WM1	WM1-C	WM1	WM1-C	WM1	WM1-C	
3-Oct-17	4.7	4.9	22.8	18.9	14.0	8.0	
4-Oct-17#	#	#	38.4	25.2	26.0	10.0	
5-Oct-17	4.6	4.6	38.0	23.8	29.5	11.5	
7-Oct-17	4.6	4.4	33.6	24.2	31.5	17.0	
10-Oct-17	4.3	4.0	21.7	31.4	16.0	28.0	
12-Oct-17	4.4	3.9	19.1	25.7	14.5	22.5	
14-Oct-17	4.7	4.9	21.4	29.4	16.5	25.0	
16-Oct-17	5.5	5.3	1007.0	overrange	813.0	1970.0	
18-Oct-17	4.3	4.6	28.8	20.8	28.5	18.0	
20-Oct-17	5.7	5.3	29.0	23.3	25.0	22.0	
23-Oct-17	4.7	4.1	23.5	15.7	20.0	12.0	

^{*} Additional water quality monitoring at the exceeded location(s) due to two consecutive monitoring days indicated Limit Level exceedance.



Date		d Oxygen g/L)		oidity ΓU)	Suspended Solids (mg/L)		
	WM1	WM1-C	WM1	WM1-C	WM1	WM1-C	
25-Oct-17	7.9	8.4	34.7	25.3	26.5	22.0	
27-Oct-17	7.7	6.8	24.2	23.6	20.5	20.5	
30-Oct-17	8.1	8.4	17.6	16.1	13.0	13.0	

Remarks: "Additional water quality monitoring at the exceeded location(s) due to two consecutive monitoring days indicated Limit Level exceedance.

Table 6-3 Water Quality Monitoring Results Associated only Contract 6

Date	Dissolved Oxygen (mg/L)				Turbidity (NTU)				Suspended Solids (mg/L)			
	WM2A(a)	WM2A- Cx	WM2B	WM2B- C	WM2A(a)	WM2A - Cx	WM2B	WM2B- C	WM2A(a)	WM2A- Cx	WM2B	WM2 B- C
3-Oct-17	4.8	4.7	*	*	14.8	6.9	*	*	5.5	<2	*	*
4-Oct-17#	#	#	*	*	15.6	42.8	*	*	6.0	36.0	*	*
5-Oct-17	4.5	4.3	*	*	15.6	52.7	*	*	7.0	35.0	*	*
7-Oct-17	4.8	5.2	*	*	21.1	7.0	*	*	12.0	3.0	*	*
10-Oct-17	4.4	4.7	*	*	11.2	4.8	*	*	4.0	3.0	*	*
12-Oct-17	4.7	4.7	*	*	14.3	4.8	*	*	8.0	2.0	*	*
14-Oct-17	4.9	5.6	*	*	8.5	6.3	*	*	4.0	<2	*	*
16-Oct-17	5.3	5.4	*	*	465.5	84.0	*	*	329.0	61.0	*	*
17-Oct-17#	#	#	*	*	69.6	5.7	*	*	37.0	2.0	*	*
18-Oct-17	5.2	4.7	*	*	32.1	3.5	*	*	32.0	3.0	*	*
19-Oct-17#	#	#	*	*	22.0	3.2	*	*	20.0	4.0	*	*
20-Oct-17	5.5	5.9	*	*	12.4	3.7	*	*	12.5	<2	*	*
23-Oct-17	4.8	5.4	*	*	8.2	3.4	*	*	5.5	<2	*	*
25-Oct-17	7.6	8.6	*	*	19.6	4.4	*	*	12.0	<2	*	*
27-Oct-17	7.2	7.4	*	*	8.7	3.8	*	*	4.0	<2	*	*
30-Oct-17	7.5	8.4	*	*	6.1	7.8	*	*	3.5	<2	*	*

Remarks:

bold with underline indicated Limit Level exceedance

bold with italic indicated Action Level exceedance

* water sampling was unable to carry out at WM2B and WM2B-C due to shallow water (water depth under 150mm)

Table 6-4 Water Quality Monitoring Results Associated Contracts 2 and 6

Date	Dissolved Oxygen (mg/L)			oidity ΓU)	Suspended Solids (mg/L)		
	WM3x	WM3-C	WM3x	WM3-C	WM3x	WM3-C	
3-Oct-17	4.9	5.3	9.8	10.8	5.0	17.0	
5-Oct-17	4.8	4.6	7.8	8.4	8.0	6.0	
7-Oct-17	5.4	5.3	12.6	7.4	6.0	11.0	
10-Oct-17	4.7	4.7	3.7	17.4	9.0	25.5	
12-Oct-17	4.8	4.7	3.4	10.8	3.0	31.5	
14-Oct-17	5.3	5.9	5.7	4.2	4.0	8.0	
16-Oct-17	4.6	5.2	22.8	19.8	25.0	28.5	
18-Oct-17	4.8	5.1	3.6	3.7	3.5	10.0	
20-Oct-17	4.1	5.4	2.9	6.1	6.0	23.0	
23-Oct-17	5.2	5.4	5.8	24.9	7.0	25.0	
25-Oct-17	8.2	8.4	4.6	2.4	4.5	5.5	
27-Oct-17	7.2	7.1	2.2	2.9	3.5	4.0	
30-Oct-17	8.8	8.9	11.1	10.7	9.5	13.0	

^{**} Additional water quality monitoring at the exceeded location(s) due to two consecutive monitoring days indicated Limit Level exceedance.



Table 6-5 Action and Limit (A/L) Levels Exceedance Recorded

Location		olved ygen	Turk	oidity	-	ended lids		otal edance		t Related edance
	\mathbf{AL}	LL	\mathbf{AL}	LL	AL	LL	AL	LL	AL	LL
WM1	0	0	0	0	0	0	0	0	0	0
WM2A(a)	0	0	1	2	0	4	0	7	0	0
WM2B	0	0	0	0	0	0	0	0	0	0
WM3x	0	0	0	0	0	0	0	0	0	0
WM4	0	0	0	2	0	2	0	4	0	0
No of Exceedance	0	0	0	5	0	6	0	11	0	0

- 6.2.3 In this Reporting Period, a total of eleven (11) Action Level (AL)/ Limit Level (LL) exceedances, namely five (5) AL/LL exceedance of turbidity and six (6) LL exceedances of Suspended Solids were recorded for the Project and they are summarized in Table 6-5. Investigation for the cause of all the exceedances was completed and the investigation result revealed that all exceedances were non-project related.
- 6.2.4 NOE was issued to relevant parties upon confirmation of the monitoring result. The investigation results and summary of exceedances are summarized in *Table 6-6*. The details of the completed investigation reports for the exceedances are attached in *Appendix N*.

Table 6-6 Summary of Water Quality Exceedance in the Reporting Period

Date of Exceedance	Location	Exceeded Parameter	Cause of Water Quality Exceedance In Brief			
30 Sep 2017 (last reporting month)	WM1	NTU & SS	site. In our investigation, the water quality mitigation implemented for Bridge Y and site condition we generally in order, it was considered that exceedance on 30 September 2017 were related to the rainstorm a not due to the works under the project.			
16 and 17 Oct 2017	WM4	NTU & SS	During site inspection, it was observed that unknown source of muddy water attributed to their site area of Contract 3 via an underground pipe which connected from Kiu Tau Road (outside C3) to box culvert BC02 (under Contract 3). The muddy water was finally entered Ma Wat River and got detected at WM4. In our investigation, the general condition of the site area under Contracts 2 and 3 were in order and the deficiency found during inspection as rectified immediately. It was considered that the exceedances were likely caused by the unknown source of muddy water attributed outside the site boundary and not related to the works under the Project.			
16,17, 18 and 19 Oct 2007 WM2A(a) NTU & SS Accord Observon 15 throug stirred		NTU & SS	According to the weather information from the Observatory, successive heavy rainstorm was recorded on 15 to 17 October 2017. The water quality throughout the river course was highly affected by the stirred up sediment and muddy runoff from the surrounding environment even outside the construction			



site. On 16 October 2017, muddy water was also observed at the upstream area and deflated of Nylon Dam was observed in which muddy water trapped in the dam was flowing to downstream.
In our investigation, CCKJC had implemented water mitigation measures such as providing temporary bund and tarpaulin sheet align the river course, there were no adverse water quality impact observed during the site inspection. Since the existing river water was found turbid even without adverse water impact of the site ad muddy water was also observed at upstream before water sampling on 16 October 2017, it is considered that the exceedances on 16 October 2017 was related to the rainstorm. For the exceedances on 17 to 19 October 2017, it is considered that the exceedances were due the residual impact after rain.



7 ECOLOGY MONITORING

7.1 GENERAL

- 7.1.1 Ecology monitoring for woodland compensation was shall be conducted at bi-monthly interval for the first year and the monitoring frequency would be reduced to quarterly from the second year.
- 7.1.2 The last bi-monthly ecological monitoring report (July August 2017) was submitted to EPD in September 2017. The next quarterly ecological monitoring report will cover the reporting period from September to November 2017 which present in next report month.



8 WASTE MANAGEMENT

8.1 GENERAL WASTE MANAGEMENT

8.1.1 Waste management was carried out in accordance with the Waste Management Plan (WMP) for each contract.

8.2 RECORDS OF WASTE QUANTITIES

- 8.2.1 All types of waste arising from the construction work are classified into the following:
 - Construction & Demolition (C&D) Material;
 - Chemical Waste;
 - General Refuse; and
 - Excavated Soil.
- 8.2.2 The quantities of waste for disposal in this Reporting Period are summarized in *Tables 8-1* and 8-2 and the Monthly Summary Waste Flow Table is shown in *Appendix L*. Whenever possible, materials were reused on-site as far as practicable.

Table 8-1 Summary of Quantities of Inert C&D Materials for the Project

Type of	Contr	act 2	Cont	ract 3	Co	ntract 4	Cont	ract 6	Co	ntract 7	Contrac	et SS C505	
Waste	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Total Qty.
C&D Materials (Inert) (in '000m³)	77.6273	1	2.156		0	1	0.970		0.381		2.610	1	83.7443
Reused in this Contract (Inert) (in '000 m ³)	0	1	0.240		0		0.520		0		0.250		1.01
Reused in other Contracts/ Projects (Inert) (in '000 m³)	0	1	0		0	1	0		0		0	-	0
Disposal as Public Fill (Inert) (in '000 m ³)	77.6273	Tuen Mun 38	1.372	Tuen Mun 38	0	1	0.450	Tuen Mun 38	0.381	Tuen Mun 38	2.360	TKO 137	82.1903

Remark #: The C&D materials were delivered to NENT for reuse by laying cover of the landfilling area.

Table 8-2 Summary of Quantities of C&D Wastes for the Project

	Con	tract 2	Cont	tract 3	Cont	ract 4	Con	tract 6	Cont	ract 7	Contract	SS C505	Total
Type of Waste	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Qty.	Disposal location	Quantity
Recycled Metal ('000kg)#	0.0280	Licensed collector	0	-	0	1	0		11.7	Licensed collector	51.130	Licensed collector	62.858
Recycled Paper / Cardboard Packing ('000kg) #	0.300	Licensed collector	0	-	0	-	0	-	0.04	Licensed collector	0	Licensed collector	0.34
Recycled Plastic ('000kg)#	2.2253	Licensed collector	0	-	0		0		0.001	Licensed collector	3.00	Licensed collector	5.2263
Chemical Wastes ('000kg)#	8.9592	Licensed collector	0	-	0	1	0		0		0		8.9592
General Refuses ('000m³)	0.6288	NENT	0.090	NENT	0		0.515	NENT	0.008	NENT	1.651	NENT	2.8928

Remark #: Unit of recycled metal, recycled paper/ cardboard packing, recycled plastic and chemical waste for Contract 3 was in ('000m³).



9 SITE INSPECTION

9.1 REQUIREMENTS

9.1.1 According to the approved EM&A Manual, the environmental site inspection shall be formulation by ET Leader. Weekly environmental site inspections should carry out to confirm the environmental performance.

9.2 FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH

Contract 2

- 9.2.1 In the Reporting Period, joint site inspection for Contract 2 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 6, 13, 20 and 27 October 2017. No non-compliance was noted.
- 9.2.2 The findings / deficiencies of *Contract 2* that observed during the weekly site inspection are listed in *Table 9-1*.

Table 9-1 Site Observations for Contract 2

Date	Findings / Deficiencies	Follow-Up Status				
6 Oct 2017	As a reminder, all water discharge from site should be diverted to de-silting facilities prior discharge and comply with discharge license requirement. (General)	Not required for reminder.				
13 Oct 2017	No adverse envionmental issue was observed.	• Nil.				
20 Oct 2017	No adverse envionmental issue was observed.	• Nil.				
27 Oct 2017	Mud was observed on the pedestrian road near the river side of site entrance. The Contractor was advised to clear the mud to prevent water pollution.	The mud has been removed.				
	The Contractor was reminded to clear the mud near site hoarding at the works area of South Portal.	Not required for reminder.				

- 9.2.3 In the Reporting Period, joint site inspection for Contract 3 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 3, 12, 18 and 26 October 2017. No non-compliance was noted.
- 9.2.4 The findings / deficiencies of *Contract 3* that observed during the weekly site inspection are listed in *Table 9-2*.

Table 9-2 Site Observations for Contract 3

Date	Findings / Deficiencies	Follow-Up Status
3 Oct 2017	No adverse environmental issue was observed.	• NA
12 Oct 2017	• The Contractor was reminded to provide regular maintenance for the AquaSed (WWST01) and to comply with the discharge license.	Not required for reminder.
18 Oct 2017	• Turbid water discharged from an AquaSed (WWTS-01) was observed, immediate rectification action was being taken. The Contractor should provide regular maintenance for the AquaSed in order to comply with the discharge licence.	• The discharge water from AquaSed (WWTS-01) was visually clear and effluent quality checking for the



Date	Findings / Deficiencies	Follow-Up Status
		AquaSed was carried out regularly.
26 Oct 2017	 No adverse environmental issue was observed. 	• NA

Contract 4

- 9.2.5 In the Reporting Period, joint site inspection for Contract 4 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 6, 13, 16 and 27 October 2017. No non-compliance was noted.
- 9.2.6 The findings / deficiencies of *Contract 4* that observed during the weekly site inspection are listed in *Table 9-3*.

Table 9-3 Site Observations for Contract 4

Date	Findings / Deficiencies	Follow-Up Status
6 Oct 2017	No adverse environmental issue was observed.	• NA
13 Oct 2017	No adverse environmental issue was observed.	• NA
16 Oct 2017	No adverse environmental issue was observed.	• NA
27 Oct 2017	No adverse environmental issue was observed.	• NA

- 9.2.7 In the Reporting Period, joint site inspection for Contract 6 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 3, 12, 19 and 26 October 2017. No non-compliance was noted.
- 9.2.8 The findings / deficiencies of *Contract 6* that observed during the weekly site inspection are listed in *Table 9-4*.

Table 9-4 Site Observations for Contract 6

Date	Findings / Deficiencies	Follow-Up Status
3 Oct 2017	• The Contractor was reminded to ensure the wheel-washing procedure at all site exit is properly implemented and the cleanliness of public road should be maintained.	Not required for reminder.
12 Oct 2017	• Muddy runoff from a bursted pipe crossing bare ground and get into the river course was observed at Bridge Y. The Contractor was required to stop the pollution source immediately and provide mitigation measures.	• The bursted pipe was removed and no muddy runoff observed.
19 Oct 2017	Oil stain was observed on the ground near a generator at Bridge Y. The Contractor should ensure the fuel filling procedure performed properly and to avoid oil spilling on ground.	• The tray undernath the generator has been fixed.
	• It was reminded that site cleanliness and tidiness should be maintained.	• Not required for reminder.
	• It was reminded that drip tray should be provided for all chemical containers.	• Not required for reminder.
	• The Contractor was reminded to maintain cleanliness at public roads and site exits near Bridge Y and Chuk Yuen Road.	• Not required for reminder.



Date	Findings / Deficiencies	Follow-Up Status				
	• It was reminded that proper tree protection zone should be provided for retained trees.	Not required for reminder.				
26 Oct 2017	The Contractor was reminded to cover the exposed slope to minimize dust impact especially during dry season. (Dong Dong Shan)	Not required for reminder.				

Contract SS C505

- 9.2.9 In the Reporting Period, joint site inspection for Contract SS C505 to evaluate the site environmental performance has been carried out by the RE, ET and the Contractor on 4, 11, 18 and 25 October 2017 in which IEC joined the site inspection on 25 October 2017. No non-compliance was noted.
- 9.2.10 The findings / deficiencies of *Contract SS C505* that observed during the weekly site inspection are listed in *Table 9-5*.

Table 9-5 Site Observations for Contract SS C505

Date	Findings / Deficiencies	Follow-Up Status				
4 Oct 2017	• The Contractor was reminded to clear the stagnant water within site area after raining.	Not required for reminder.				
11 Oct 2017	No adverse environmental issue was observed.	• NA				
18 Oct 2017	The Contractor was reminded to clear the stagnant water within site area after raining.	Not required for reminder.				
25 Oct 2017	• The Contractor was reminded to cover the stockpiles of cement bags with tarpaulin sheets to minimize dust impact.	Not required for reminder.				

- 9.2.11 In the Reporting Period, joint site inspection for Contract 7 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 6, 13, 17 and 27 October 2017. No non-compliance was noted.
- 9.2.12 The findings / deficiencies of *Contract* 7 that observed during the weekly site inspection are listed in *Table 9-6*.

Table 9-6 Site Observations for Contract 7

Date	Findings / Deficiencies	Follow-Up Status
6 Oct 2017	Drip tray should be provided for all chemical containers which storage on-site.	Chemical container was placed with drip tray underneath.
13 Oct 2017	Wastewater generated from wheel washing facilities at site entrance withou proper treatment was observed. The Contractor was advised to provide proper mitigation measure to treat the wastewater before discharge.	Sedimentation tank was provided for wastewater gnerated from the wheel washing facilities.
	Chemical container was observed without drip tray. The Contractor was advised to place chemical containers Chemical container removed from sit	



Date	Findings / Deficiencies	Follow-Up Status
	inside drip tray.	
17 Oct 2017	The Contractor was reminded to ensure no water direct discharge out of site.	Not required for reminder.
27 Oct 2017	Dry unpaved haul road was observed. The Contractor was advised to spray water on haul road regularly to minimize dust generation.	Water spraying was provided for the haul road.

9.2.13 General housekeeping such as daily site tidiness and cleanliness should be maintained for all Contracts. Furthermore, the Contractors were reminded to implement Waste Management Plan of the Project.



10 ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE

10.1 Environmental Complaint, Summons and Prosecutions

In the Reporting Period, no summons and prosecution under the EM&A Programme was lodged for all Contracts. However, one (1) documented environmental complaint was received by under the EM&A Programme and the details are summarized below. Moreover, there were two outstanding complaint investigations for last reporting month. The status of the investigation report and finding and listed below.

Date of	Complaint Detail	Investigation status
complaint		
30 August 2017 (last reporting month)	A public complaint was received from Contract 6's Project Hotline regarding the condition and cleanliness of Lin Ma Hang Road. Investigation was triggered for all related Contracts including Contract 6, Contract 7 and Contract SS C505.	The Investigation Report for Contract 6, Contract 7 and Contract SS C505 have been conducted by ET and no further comment from IEC. The detailed Investigation Reports were shown in <i>Appendix O</i> .
27 September 2017 (last reporting month)	An anonymous complainant was received by the police regarding construction noise heard at night. The police came to North Portal Site of Contract 2 for investigation around 8:00pm and 1:00am and they checked the validity of the CNPs and no further comment and action were undertaken.	The site information such as site diary is still pending from Contractor (DHK) for investigation purpose. As advised by the DHK, the works undertaken at the construction site was strictly followed the conditions of CNP and preliminary investigation revealed that the complaint was not valid to the Contract.
23 September 2017 (referred to AECOM on 25 October 2017)	The complaint was received by 1823 on 23 September 2017 and referred to AECOM on 25 October 2017 regarding the condition and cleanliness of Lin Ma Hang Road for the 1km section from Tai Kwu Ling Police Station towards Lin Ma Hang.	The Investigation Report has been conducted by ET and no further comment from IEC. The detailed Investigation Reports were shown in <i>Appendix O</i> .

The statistical summary of environmental complaint is presented in *Tables 10-1*, *10-2* and *10-3*.

Table 10-1 Statistical Summary of Environmental Complaints

Reporting	Contract	Envi	Environmental Complaint Statistics			Environmental Complaint Statistics Projec		Project related
Period	No	Frequency	Cumulative	Complaint Nature	complaint			
19 May 2014 – 30 Sep 2017	Contract 2	0	31	(18)Water Quality(7) Dust(5) Noise(1) dust & noise	(6) water quality (2) dust (1) noise			
06 Nov 2013 – 30 Sep 2017	Contract 3	0	5	(1) Dust(3) Water quality(1) Noise	0			
16 Aug 2013 – 30 Sep 2017	Contract 5	0	4	• (3) Dust • (1) Noise	0			
16 Aug 2013 – 30 Sep 2017	Contract 6	0	33	 (23) Water Quality (6) Dust (2) Noise (1) Nuisance (1) Water quality and dust 	(7) water quality (3) dust (1) Nuisance (1) Water quality and dust			



Reporting	Contract	Envi	ronmental Cor	nplaint Statistics	Project related	
Period	No	Frequency	Cumulative	Complaint Nature	complaint	
15 Feb 2016 – 30 Sep 2017	Contract 7	0	2	• (1) Noise • (1) Water quality and dust	(1) Water quality and dust	
16 Aug 2013 – 30 Sep 2017	SS C505	0	3	(1) Noise(1) dust(1) Water quality and dust	(1) Water quality and dust	
	Contract 2	0	31	(18)Water Quality(7) Dust(5) Noise(1) dust & noise	NA	
	Contract 3	0	5	(1) Dust(3) Water quality(1) Noise	NA	
	Contract 4	0	0	NA	NA	
1 – 31 October 2017	Contract 6	1	34	 (23) Water Quality (7) Dust (2) Noise (1) Nuisance (1) Noise and dust 	NA	
	Contract 7	0	2	• (1) Noise • (1) Water quality and dust	NA	
	SS C505	0	3	(1) Noise(1) dust(1) Water quality and dust	NA	

 Table 10-2
 Statistical Summary of Environmental Summons

Donoutino Dovind	Contract No	Environmental Summons Statistics			
Reporting Period	Contract No	Frequency	Cumulative	Complaint Nature	
19 May 2014 – 30 Sep 2017	Contract 2	0	1	contravening the Water Pollution Control (General) Regulations	
06 Nov 2013 – 30 Sep 2017	Contract 3	0	0	NA	
16 Aug 2013 – 30 Sep 2017	Contract 5	0	0	NA	
16 Aug 2013 – 30 Sep 2017	Contract 6	0	0	NA	
15 Feb 2016 – 30 Sep 2017	Contract 7	0	0	NA	
16 Aug 2013 – 30 Sep 2017	SS C505	0	0	NA	
	Contract 2	0	1	NA	
	Contract 3	0	0	NA	
1 21 Oataban 2017	Contract 4	0	0	NA	
1 – 31 October 2017	Contract 6	0	0	NA	
	Contract 7	0	0	NA	
	SS C505	0	0	NA	



Table 10-3 Statistical Summary of Environmental Prosecutions

Domontino Dominal	Contract No	Environmental Prosecutions Statistics			
Reporting Period	Contract No	Frequency	Cumulative	Complaint Nature	
19 May 2014 – 30 Sep 2017	Contract 2	0	1	contravening the Water Pollution Control (General) Regulations	
06 Nov 2013 – 30 Sep 2017	Contract 3 0 0 NA		NA		
16 Aug 2013 – 30 Sep 2017	Contract 5	0	0	NA	
16 Aug 2013 – 30 Sep 2017	Contract 6	0	0	NA	
15 Feb 2016 – 30 Sep 2017	Contract 7	0	0	NA	
16 Aug 2013 – 30 Sep 2017	SS C505	0	0	NA	
	Contract 2	0	1	NA	
	Contract 3	0	0	NA	
1 21 0 4 1 - 2017	Contract 4	0	0	NA	
1 – 31 October 2017	Contract 6	0	0	NA	
	Contract 7	0	0	NA	
	SS C505	0	0	NA	



11 IMPLEMENTATION STATUS OF MITIGATION MEASURES

11.1 GENERAL REQUIREMENTS

- The environmental mitigation measures that recommended in the Implementation Schedule for Environmental Mitigation Measures (ISEMM) in the approved EM&A Manual covered the issues of dust, noise, water and waste and they are summarized presented in *Appendix M*.
- All contracts under the Project shall be implementing the required environmental mitigation measures according to the approved EM&A Manual as subject to the site condition. Environmental mitigation measures generally implemented by Contracts 2, 3, 4, 5, 6, 7 and Contract SS C505 in this Reporting Period are summarized in *Table 11-1*.

Table 11-1 Environmental Mitigation Measures

Issues	Environmental Mitigation Measures					
Water	• Wastewater to be treated by the wastewater treatment facilities i.e.					
Quality	sedimentation tank or similar facility before discharge.					
Air Quality	Maintain damp / wet surface on access road					
	Low vehicular speed within the works areas.					
	 All vehicles must use wheel washing facility before off site 					
	Sprayed water during breaking works					
	• A cleaning truck was regularly performed on the public road to prevent					
	fugitive dust emission					
Noise	• Restrain operation time of plants from 07:00 to 19:00 on any working day					
	except for Public Holiday and Sunday.					
	Keep good maintenance of plants					
	Place noisy plants away from residence or school					
	Provide noise barriers or hoarding to enclose the noisy plants or works					
	Shut down the plants when not in used.					
Waste and	On-site sorting prior to disposal					
Chemical	Follow requirements and procedures of the "Trip-ticket System"					
Management						
	• Collect the unused fresh concrete at designated locations in the sites for					
	subsequent disposal					
General	The site was generally kept tidy and clean.					

11.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH

11.2.1 As advised by the ER, the construction works under Contract 5 was substantially completed on 31 August 2016. Construction activities for other Contracts in the coming month are listed below:

Mid-Vent Portal	Construction of Cut and Cover structure and backfilling
	Construction of adit enlargement internal structure
	Adit and stud tunnel internal structure
	Ventilation building superstructure and internal structure works
	Structure connecting the adit tunnel, and ventilation building
	Temporary drainage system
North Portal	Construction of retaining wall, permanent drainage, footways and
	stairs
	Southbound tunnel enlargement, waterproofing and lining
	Southbound tunnel internal structure, backfilling and construction of cross passage
	 Northbound tunnel top-heading and bench excavation, waterproofing and lining
	Connection structure construction
	TBM/ Mechanical excavation of tunnels
	North ventilation building superstructure, internal structure and backfilling



	 Pedestrian and Vehicular Access to C2 North Portal
South Portal	Post-excavation activities and earthwork
	• Tunnel internal structure, construction of CP and tunnel backfilling
	• South ventilation building superstructure, internal structure, UU and
	E&M installation
	• Southbound and Northbound tunnel invert, waterproofing and lining
	Construction of Permanent Retaining Walls and backfilling
	 Installation of aluminum cladding at South ventilation building
Admin Building	Construction of permanent drainage and fencing wall
	Building internal structure, fitting out work, curtain wall, drainage, UU
	and E&M installation

Contract 3

- Boundary wall for pumping station
- Cable detection and trail trenches
- Installation of Noise Barrier steel column & panel
- Remaining works on New Kiu Tau Footbridge
- Mini-pile installation
- Noise barrier construction
- Roadworks
- Viaduct segment erection
- Water main laying works
- Parapet Installation on bridge deck
- Construction of Profile barrier & Planter wall on Bridge deck
- Drainage Work
- Stressing of External Tendon
- Construction of retaining wall behind abutment
- Installation of Sign Gantry

Contract 4

- System design
- E&M installation at Admin Building
- E&A installation in tunnel

Contract 6

- Segment section
- Bridge installation
- Tunnel Works
- Sewage Treatment Plant Construction
- Tunnel Ventilation Building Construction
- Slip Road/At-grade Road/Periphery Road Construction

Contract 7

- U-trough and abutment construction at Bridge A and Bridge E
- Column construction at Bridge A and E
- Deck construction at Bridge B and D
- Construction of parapet wall and Façade Bridge C

Contract SS C505

- Building no. 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 13, 18, 41 and 43 construction
- Tower crane operation
- Bridge construction works including construction of bridge column, retaining wall, pile cap, pier, abutment, road and finishes works
- Underground drainage works, Road Works, CLP Cable laying and Landscaping
- Formwork and falsework for PTB's slab construction and Bridges Decks



- Construction PTB M/F, 1/F, 2/F and Roof flat slab
- Construction PTB non-structural wall, Late Cast Strip, Stairs and Lift Shaft
- Steel beam works for maintenance platform for PTB
- PTB backfilling works
- Elevated Walkway E1, E2, E3 and E4 construction
- Bridge deck construction for Bridges 1 5

11.3 KEY ISSUES FOR THE COMING MONTH

- 11.3.1 Key issues to be considered in the coming month for Contracts 2, 3, 4, 6, 7 and SS C505 include:
 - Implementation of control measures for rainstorm;
 - Regular clearance of stagnant water during wet season;
 - Implementation of dust suppression measures at all times;
 - Potential wastewater quality impact due to surface runoff;
 - Potential fugitive dust quality impact due from the dry/loose/exposure soil surface/dusty material;
 - Disposal of empty engine oil containers within site area;
 - Ensure dust suppression measures are implemented properly;
 - Sediment catch-pits and silt removal facilities should be regularly maintained;
 - Management of chemical wastes;
 - Discharge of site effluent to the nearby wetland, stockpiling or disposal of materials, and any dredging or construction area at this area are prohibited;
 - Follow-up of improvement on general waste management issues; and
 - Implementation of construction noise preventative control measures



12 CONCLUSIONS AND RECOMMENDATIONS

12.1 CONCLUSIONS


- 12.1.1 This is the **51**st monthly EM&A report presenting the monitoring results and inspection findings for the Reporting Period from **1** to **31 October 2017**.
- For air quality monitoring, no 1-hour and 24-hour TSP monitoring results triggered the Action or Limit Levels were recorded. No NOEs or the associated corrective actions were therefore issued.
- 12.1.3 In the Reporting Period, no construction noise measurement results that exceeded the Limit Level were recorded. Moreover, no valid noise complaint which triggered an Action Level exceedance was recorded.
- 12.1.4 For water quality monitoring, a total of eleven (11) Action Level (AL)/ Limit Level (LL) exceedances, namely five (5) AL/LL exceedance of turbidity and six (6) LL exceedances of Suspended Solids were recorded for the Project. Investigation for the cause of all the exceedances was completed and the investigation result revealed that all exceedances were non-project related.
- 12.1.5 In this Reporting Period, one (1) documented environmental complaints was received under the EM&A Programme. Subsequent joint site inspection was carried out for investigation of the complaint and the investigation report revealed that the complaint was not valid to the project.
- 12.1.6 No environmental summons or successful prosecutions were recorded in the Reporting Period.
- During the Reporting Period, weekly joint site inspection by the RE, IEC, ET with the relevant Main-contractor were carried out for Contracts 2, 3, 4, 6 and 7 in accordance with the EM&A Manual stipulation. For Contract SS C505, weekly joint site inspection was carried out by the RE, IEC, ET and main-contractor whereas IEC performed monthly site inspection. No non-compliance observed during the site inspection.

12.2 RECOMMENDATIONS

- During dry season, special attention should be paid on the potential construction dust impact since most of the construction sites are adjacent to villages. The Contractor should fully implement the construction dust mitigation measures as appropriately.
- 12.2.2 Preventive measures for muddy water or other water pollutants from site surface flow to local stream such as Kong Yiu Channel, Ma Wat Channel, Ping Yuen River, Kwan Tei River or public area should be properly maintained. The Contractors should paid special attention on water quality mitigation measures and fully implement according ISEMM of the EM&A Manual, in particular for working areas near Ma Wat Channel and Ping Yuen River.
- 12.2.3 In addition, all effluent discharge shall be ensure to fulfill Technical Memorandum of Effluent Discharged into Drainage and Sewerage Systems, inland and Coastal Waters criteria or discharge permits stipulation.
- 12.2.4 Construction noise would be a key environmental issue during construction work of the Project. Noise mitigation measures such as using quiet plants should be implemented in accordance with the EM&A requirement.
- Furthermore, daily cleaning and weekly tidiness shall be properly performed and maintained. In addition, mosquito control should be kept to prevent mosquito breeding on site.



Appendix A Layout plan of the Project

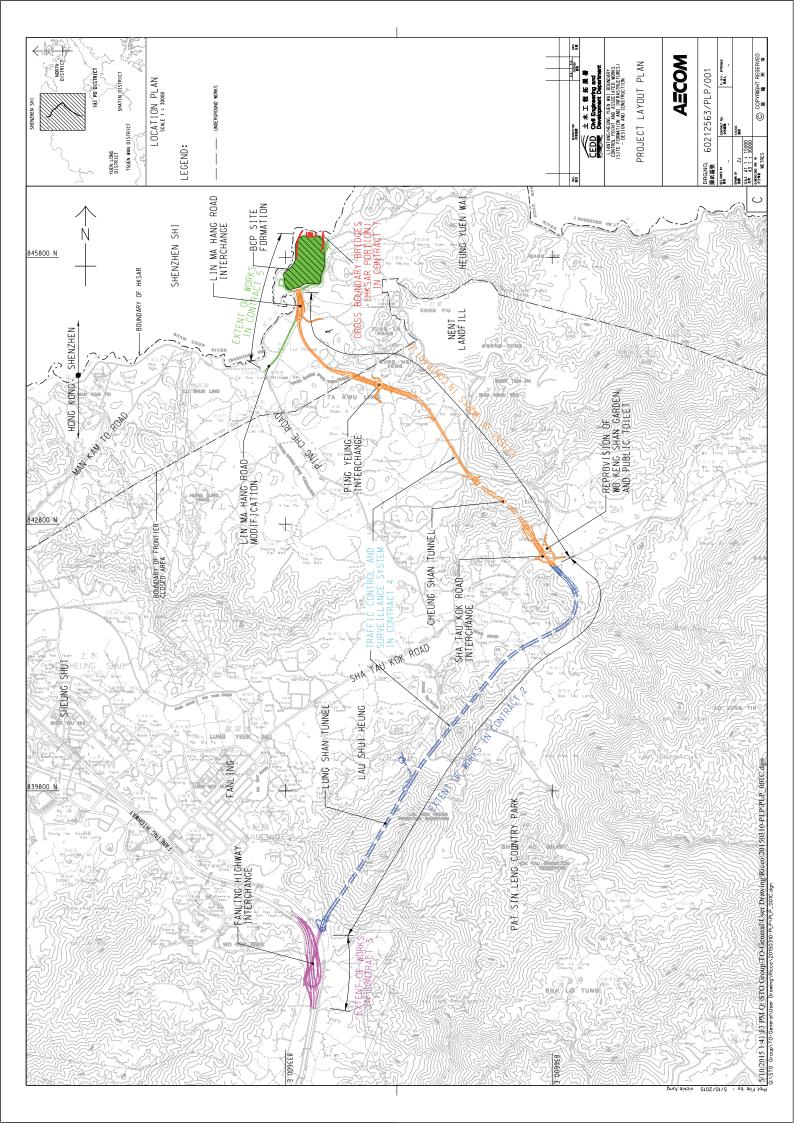




Appendix B

Organization Chart



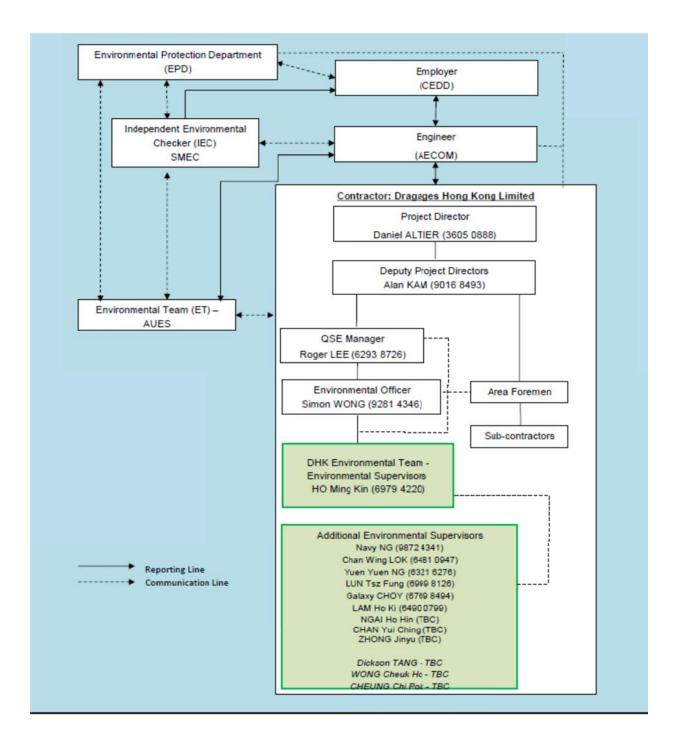

Environmental Management Organization for Contract 2 - (CV/2012/08)



Contact Details of Key Personnel for Contract 2 - CV/2012/08

Organization	Project Role	Name of Key Staff	Tel No	Fax No.
AECOM	Engineer's Representative	Edwin Ching	2171 3300	2171 3498
SMEC	Independent Environmental Checker	Antony Wong	3995 8120	3995 8101
DHK	Project Director	Daniel Altier	3605 0888	2171 3299
DHK	Deputy Project Manager	Alan Kam	9016 8493	2171 3299
DHK	QSE Manager	Roger Lee	6293 8726	2171 3299
DHK	Environmental Officer	Simon Wong	2171 3017	2171 3299
DHK	Environmental Supervisor	Ho Ming Kin	6979 4220	2171 3299
AUES	Environmental Team Leader	T. W. Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Nicola Hon	2959 6059	2959 6079
AUES	Environmental Consultant	Ben Tam	2959 6059	2959 6079

Legend:


CEDD (Employer) – Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

DHK(Main Contractor) – Dragages Hong Kong Ltd.

SMEC (IEC) – SMEC Asia Limited



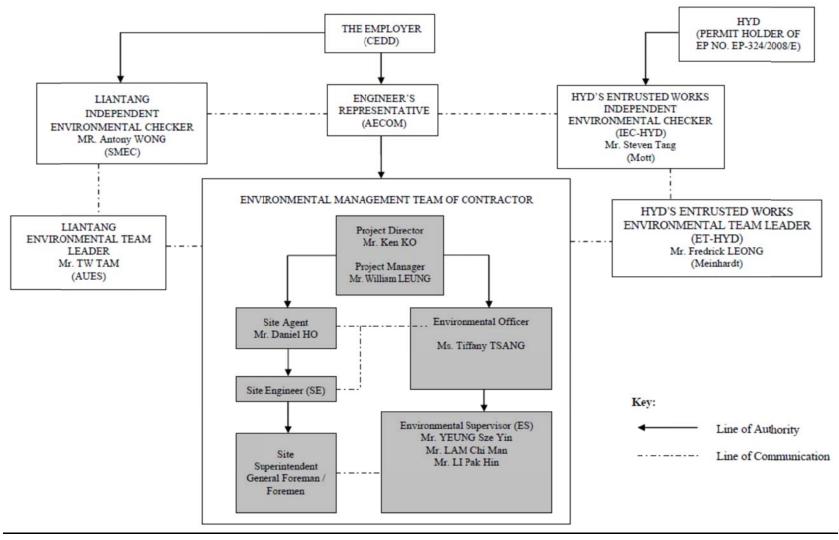

Environmental Management Organization for Contract 3 - CV/2012/09



Contact Details of Key Personnel for Contract 3 - CV/2012/09

Organization	Project Role	Name of Key Staff	Tel No	Fax No.
AECOM	Engineer's Representative	Alan Lee	2171 3300	2171 3498
SMEC	Independent Environmental Checker	Antony Wong	3995 8120	3995 8101
Chun Wo	Project Director	Ken Ko	3758 8735	2638 7077
Chun Wo	Project Manager	William Leung	2638 6136	2638 7077
Chun Wo	Site Agent	Daniel Ho	2638 6144	2638 7077
Chun Wo	Environmental Officer	Tiffany Tsang	2638 6151	2638 7077
Chun Wo	Environmental supervisor	Yeung Sze Yin	2638 6125	2638 7077
AUES	Environmental Team Leader	T. W. Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Nicola Hon	2959 6059	2959 6079
AUES	Environmental Consultant	Ben Tam	2959 6059	2959 6079

Legend:


CEDD (Employer) – Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

Chun Wo (Main Contractor) - Chun Wo Construction Ltd.

SMEC (IEC) – SMEC Asia Limited



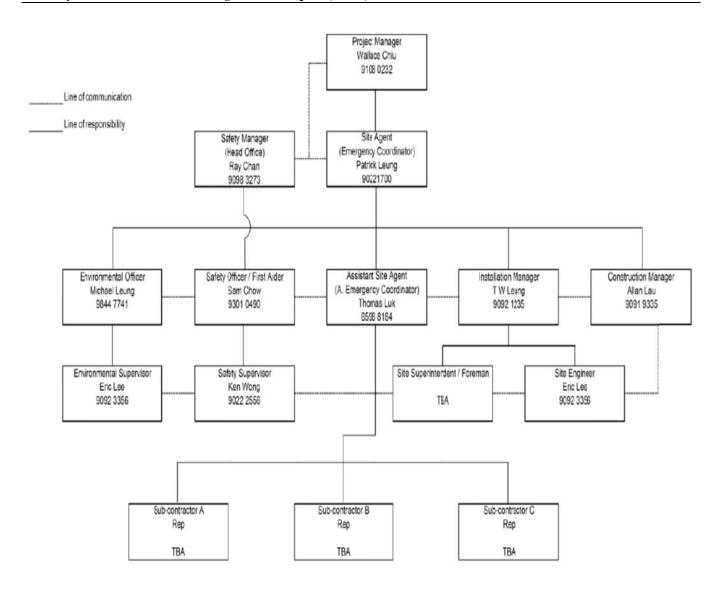

Environmental Management Organization for Contract 4 - NE/2014/02



Contact Details of Key Personnel for Contract 4 - NE/2014/02

Organization	Project Role	Name of Key Staff	Tel No	Fax No.
AECOM	Engineer's Representative	Alan Lee	2171 3300	2171 3498
SMEC	Independent Environmental Checker	Antony Wong	3995 8120	3995 8101
Siemens	Project Manager	Wallace Chiu	9108 0232	
Siemens	Site Agent	Patrick Leung	9022 1700	
Siemens	Environmental Officer	Michael Leung	9844 7741	
Siemens	Environmental Supervisors	Eric Lee	9092 3356	
AUES	Environmental Team Leader	T. W. Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Nicola Hon	2959 6059	2959 6079
AUES	Environmental Consultant	Ben Tam	2959 6059	2959 6079

Legend:


CEDD (Employer) – Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

Siemens (Main Contractor) - Siemens Ltd.

SMEC (IEC) – SMEC Asia Limited



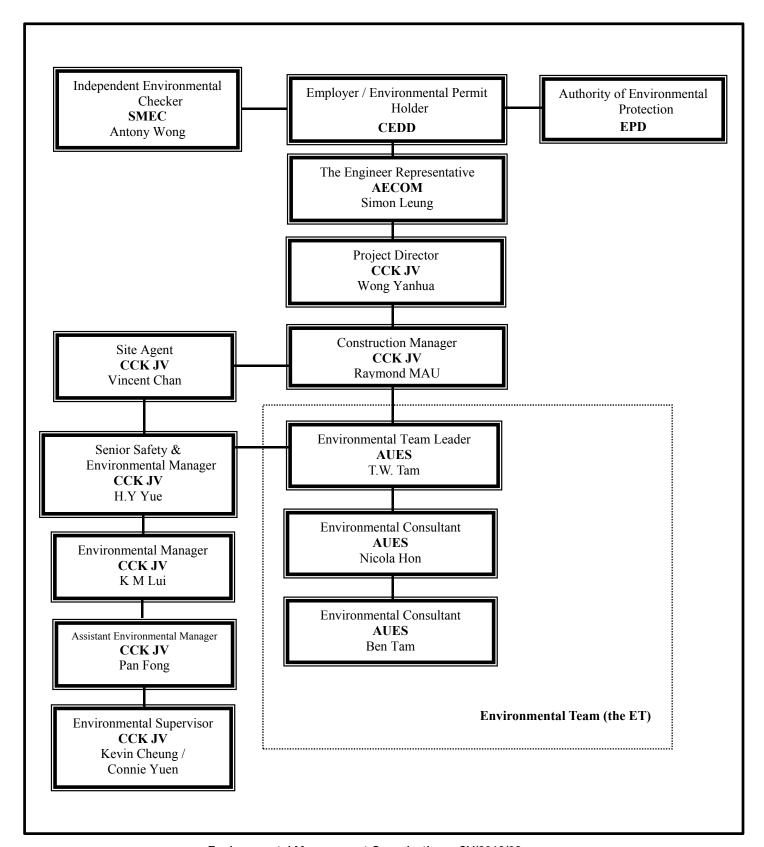

Environmental Management Organization – CV/2013/08



Contact Details of Key Personnel for Contract 6 - CV/2013/08

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
AECOM	Engineer's Representative	Simon Leung	2674 2273	2674 7732
SMEC	Independent Environmental Checker	Antony Wong	3995 8120	3995 8101
CCK JV	Project Director	Wang Yanhua	6190 4212	
CCK JV	Construction Manager	Raymond Mau Sai-Wai	9011 5340	
CCK JV	Site Agent	Vincent Chan	9655 9404	
CCK JV	Senior Safety & Environmental Manager	H.Y. Yue	9185 8186	
CCK JV	Environmental Manager	K M Lui	51138223	
CCK JV	Assistant Environmental Manager	Pan Fong	9436 9432	
CCK JV	Environmental Supervisor	Kevin Cheung/ Connie Yuen	6316 6931 6117 1344	
AUES	Environmental Team Leader	TW Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Ben Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Nicola Hon	2959 6059	2959 6079

Legend:


CEDD (Employer) – Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

CCK JV (Main Contractor) – CRBE-CEC-Kaden Joint Venture

SMEC (IEC) – SMEC Asia Limited



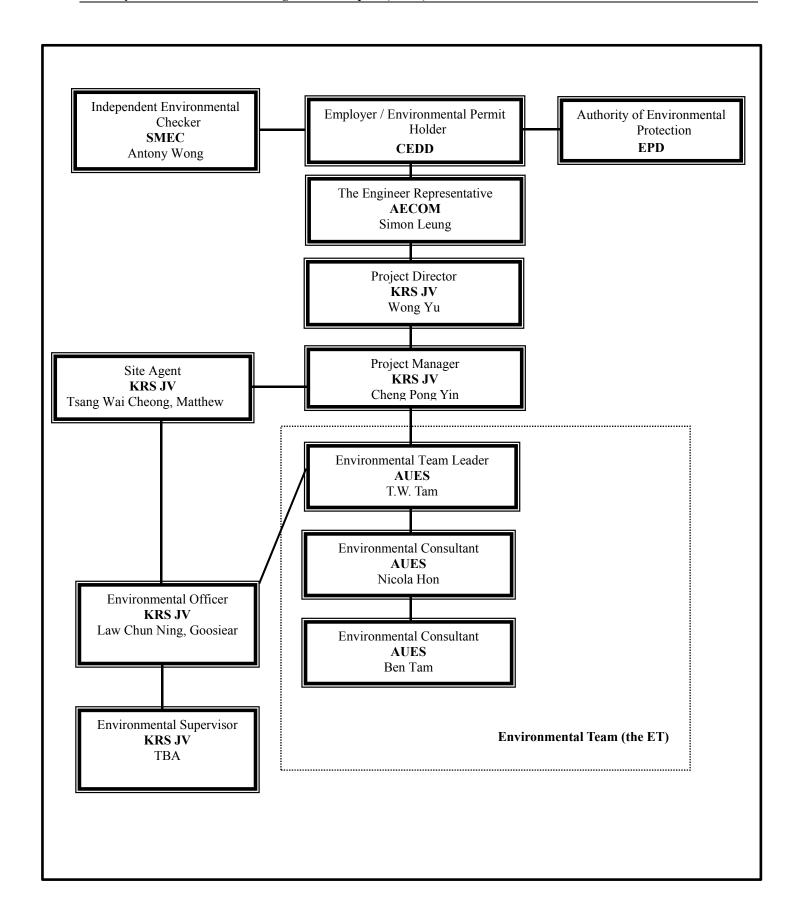

Environmental Management Organization -NE/2014/03



Contact Details of Key Personnel for Contract 7 – NE/2014/03

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
AECOM	Engineer's Representative	Simon Leung	2674 2273	2674 7732
SMEC	Independent Environmental Checker	Antony Wong	3995 8120	3995 8101
KRSJV	Project Director	Wong Yu	2682 6691	2682 2783
KRSJV	Project Manager	Cheng Pong Yin	9023 4821	2682 2783
KRSJV	Site Agent	Tsang Wai Cheong, Matthew	9705 7536	2682 2783
KRSJV	Environmental Officer	Law Chun Ning, Goosiear	9625 2381	2682 2783
KRSJV	Environmental Supervisor	TBA	6592 3084	2682 2783
AUES	Environmental Team Leader	TW Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Ben Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Nicola Hon	2959 6059	2959 6079

Legend:


CEDD (Employer) – Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

KRS JV (Main Contractor) -Kwan On-Richwell-SCG Joint Venture

SMEC (IEC) – SMEC Asia Limited



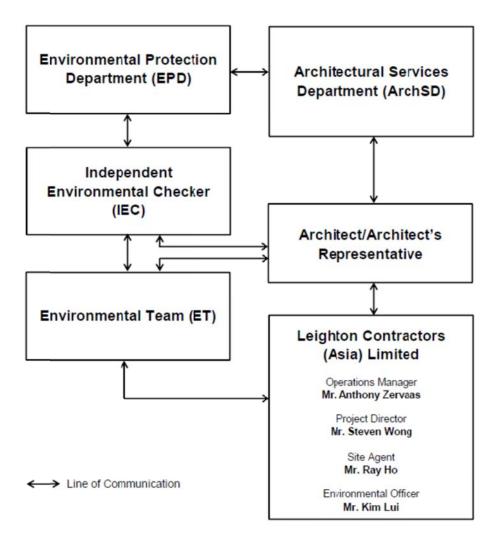

Environmental Management Organigram

Environmental Management Organization for Contract SS C505



Contact Details of Key Personnel for Contract SS C505

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
ArchSD	Works agent for the Development Bureau (DEVB)	Mr. William Cheng	2867 3904	2804 6805
Ronald Lu & Partners	Architect/ Architect's Representative	Mr. Justin Cheung	3189 9272	2834 5442
SMEC	Independent Environmental Checker	Mr. Antony Wong	3995 8120	3995 8101
Leighton	Operation Manager	Mr. Antony Zervaas	2823 1433	2529 8784
Leighton	Project Director	Mr. Steven Wong	2858 1519	2858 1899
Leighton	Site Agent	Mr. Ray Ho	2858 1519	2858 1899
Leighton	Environmental Officer	Mr. Kim Lui	3973 1003	-
Leighton	Assistant Environmental Officer	Ms. Penny Yiu	3973 0818	-
AUES	Environmental Team Leader	Mr. T. W. Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Ms. Nicola Hon	2959 6059	2959 6079
AUES	Environmental Consultant	Mr. Ben Tam	2959 6059	2959 6079

Legend:

ArchSD (Project Proponent) – Architectural Services Department

Ronald Lu & Partners (Architect/Architect's Representative) – Ronald Lu & Partners (Hong Kong) Ltd

Leighton (Main Contractor) – Leighton Contractors (Asia) Limited

SMEC (IEC) – SMEC Asia Limited



Appendix C

3-month rolling construction program



Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: CV/2012/08

Main Contractor: Dragages Hong Kong Ltd



Tentative Three Months (November 2017, December 2017 and January 2018) Construction Rolling Progam

Item	Construction Activites
1	Admin Bldg - Construction of permanent drainage and fence wall
2	Admin Bldg - Building internal structure, fitting out work, curtain wall, drainage, UU and E&M installation
3	Mid Vent Portal - Construction of Cut and Cover structure and backfilling activities
4	Mid Vent Portal - Construction of adit enlargement internal structure
5	Mid Vent Portal - Adit and stud tunnel internal structure
6	Mid-Vent Portal - Ventilation building superstructure and internal structure works
7	Mid Vent Portal - Structure connecting adit tunnel and ventilation building
8	Mid-Vent Portal - Temporary drainage system
9	North Portal - Construction of retaining wall, permanent drainage, footways and stairs
10	North Portal - Southbound tunnel bench enlargement, waterproofing and lining
11	North Portal - Southbound tunnel lining, internal sturcture, backfilling and construction of cross passage
12	North Portal - Northbound tunnel top-heading and bench excavation, waterproofing and lining
13	North Portal - Connection Structures Construction
14	North Portal - TBM/Mechanical excavation of tunnels
15	North Portal - North ventilation building superstructure, internal structure and backfilling
16	North Portal - Pedestrian and vehicular access to C2 North Portal site after STK Road diversion
17	South Portal - Post-excavation activitie and earthwork
18	Sorth Portal - Tunnel internal structure, construction of CP and tunnel backfilling
19	South Portal - South ventilation building superstructure, internal structure, UU and E&M installation
20	South Portal - Southbound and Northbound tunnel invert, waterproofing and lining
21	South Portal - Construction of retaining walls and backfilling activities
22	South Portal - Installation of aluminum cladding at South ventilation building



Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: CV/2012/09

Main Contractor: Chun Wo Construction Ltd



Tentative Three Months (October, November ande December 2017) Construction Rolling Progam

Item	Construction Activites
1	Boundary wall for pumping station
2	Cable detection and trial trenches
3	Installation of noise barrier steel post & panel
4	Remaining works on new Footbridge
5	Mini-pile installation works
6	Noise barrier construction
7	Roadworks
8	Viaduct Segment erection
9	Water main laying works
10	Parapet Installation on bridge deck
11	Construction of profile barrier & Planter wall on Bridge deck
12	Drainage Work
13	Stressing of external tendon
14	Construction of retaining wall behind abutment
15	Installation of Sign Gantry



Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: NE/2014/02 Main Contractor: Siemens Ltd.



Tentative Three Months (October, November and Decemebr 2017) Construction Rolling Progam

Item	Construction Activites
1	System design
2	E&M installation at admin building
3	E&M installation in tunnel



Contract 6

Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: CV/2013/08

Main Contractor: CRBE-CEC-Kaden Joint Venture



Tentative Three Months (October, November ande December 2017) Construction Rolling Progam

Item	Construction Activites
1	Segment Erection
2	Bridge Installation
3	Tunneling Works
4	Sewage Treatment Plant Construction
5	Tunnel Ventilation Building Construction
6	Slip Road/At-grade Road/Periphery Road Construction



Contract 7

Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: NE/2014/03

Main Contractor: Kwan On-Richwell-SCG Joint Venture



Tentative Three Months (October, November and December 2017) Construction Rolling Progam

Item	Construction Activites
	U-tough and abutment construction at Bridges A and E
2	Column construction at Bridges A and E
3	Deck construction at Bridges B and D
4	Construction of parapet wall and Façade Bridge C



Contract SS C505

Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

ArchSD Contract No: SSC505 Main Contractor: Leighton




Tentative Three Months (October, November and December 2017) Construction Rolling Progam


Item	Construction Activites
1	Passenger Terminal Building - RC Superstructure Works, Non-structural Wall, Late Cast Strips, Stairs and Lift Shaft Construction
	PTB - Private Car Examination Buildings and MXRVSS (Inbound & Outbound) - RC Structures Works
	PTB - Coach & Private Car Kiosks (Inbound & Outbound) - RC Structures Works
	Passenger Terminal Building - ABWF Works & MEP Installation Internal & External Works
	Passenger Terminal Building - Southern Enterance Construction
	Passenger Terminal Building - CLP Installation Works and Lift Installation by NSC
	Bridge C Integrated ABWF and MEP Installation Works
	C&ED Detector Dog Base - Superstructures, External Works and Integrated ABWF & MEP Works
	HKPF Building and Observation Tower - Superstructures, External Works, Integrated ABWF & MEP Works
	Fire Station and Drill Tower - Superstructures, External Works, Integradted ABWF & MEP Works
	Cargo Examination Building (Inbound) - Superstructure and Integrated ABWF & MEP Works
	Cargo Examination Building (Outbound) - Superstructure, External Works and Integrated ABWF & MEP Works
	Fixed X-ray Vehicle Inspection System (FXRVIS) Buildings (Inbound) - Substructures, Superstructures, External and ABWF & MEP Works
	Fixed X-ray Vehicle Inspection System (FXRVIS) Buildings (Outbound) - Superstructures and Integrated ABWF & MEP Works
	MXRVSS (Outbound) - Superstructures works
	GV Kiosk (Inbound) - Substructures and Superstructures Works
	GV Kiosk (Outbound) - Substructures and Superstructures Works
	Public Toilets (Outbound) - Substructure and Superstructures Works
	Disinsection Facilities (Outbound) - Site Formation Works
	EUVSS & Monitoring Room - Site Formation and Substructure Works
	Refuse Collection Point - Superstructures, ABWF and MEP Works
	Irrigation Pump Room - Superstructures works
	Master Water Meter Room 2 - Structures Works
	Elevated Walkway (E1, E2, E3 & E4) - Structures, ABWF and BS Works
	Vehicular bridges 1-5 - Pilecaps / Piers / abutment / retaining walls / portal, Bridge Decks, Road and Finishes Works
	External Works - CLP Cable & Power ON Transfer room
27	External Works - Underground Utilities & Structures (Inbound & Outbound Areas)
	External Works - Road Works (PTB Podium Area)




Appendix D

Designated Monitoring Locations as Recommended in the Approved EM&A Manual

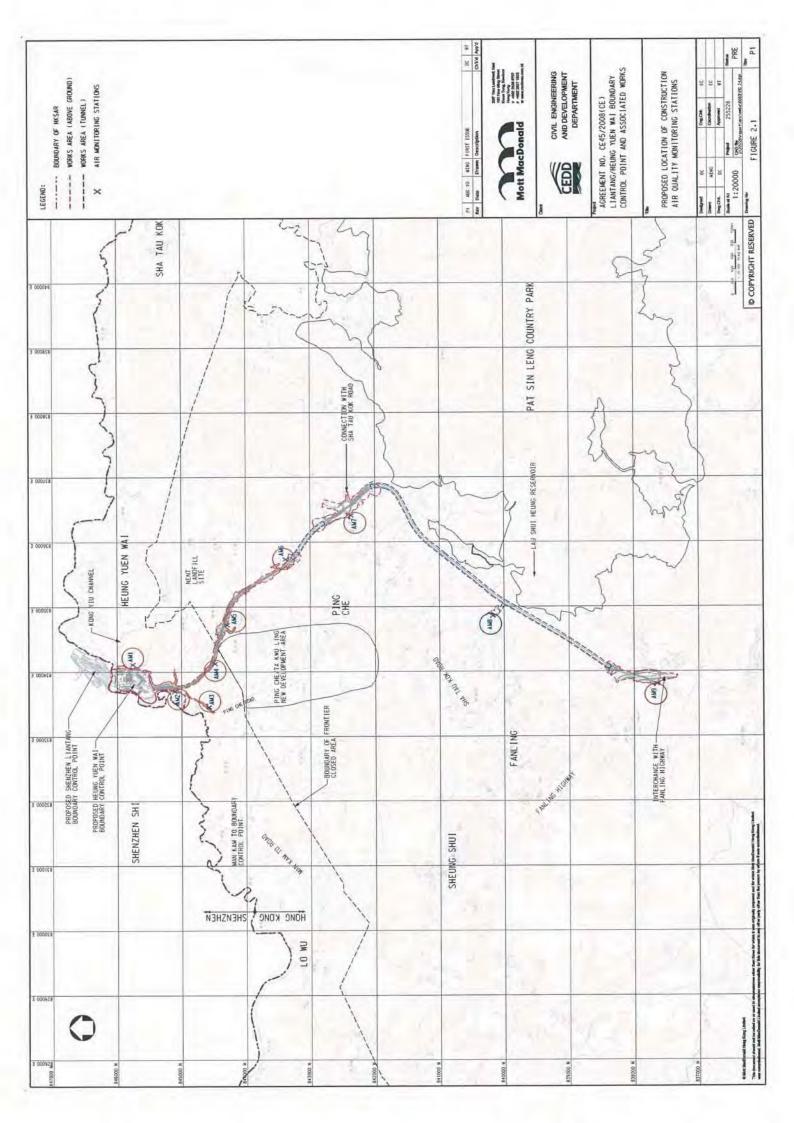

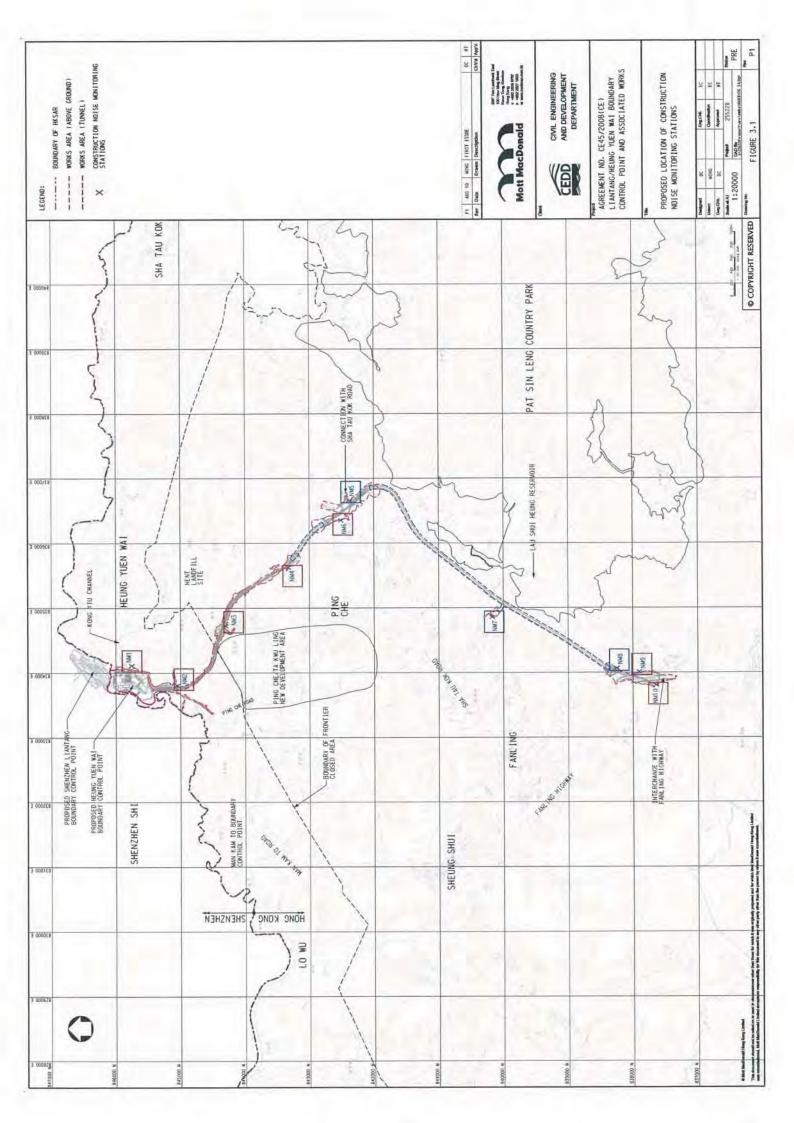


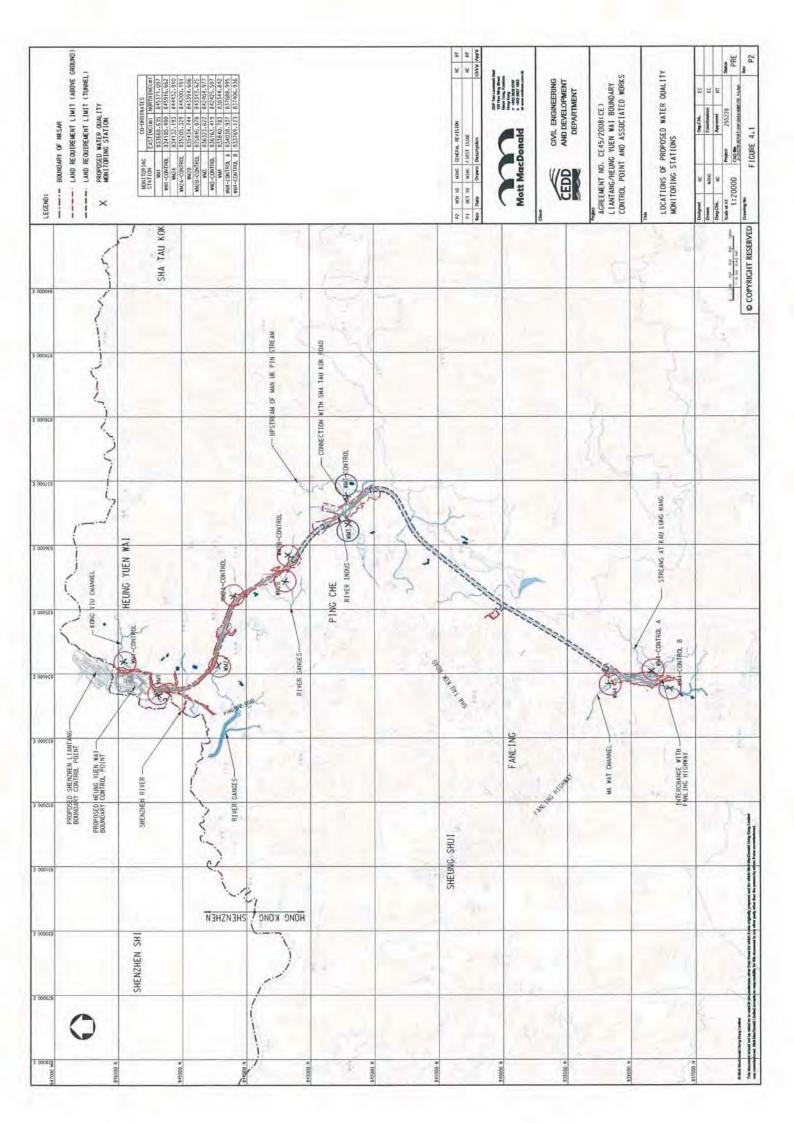





Appendix E

Monitoring Locations for Impact Monitoring

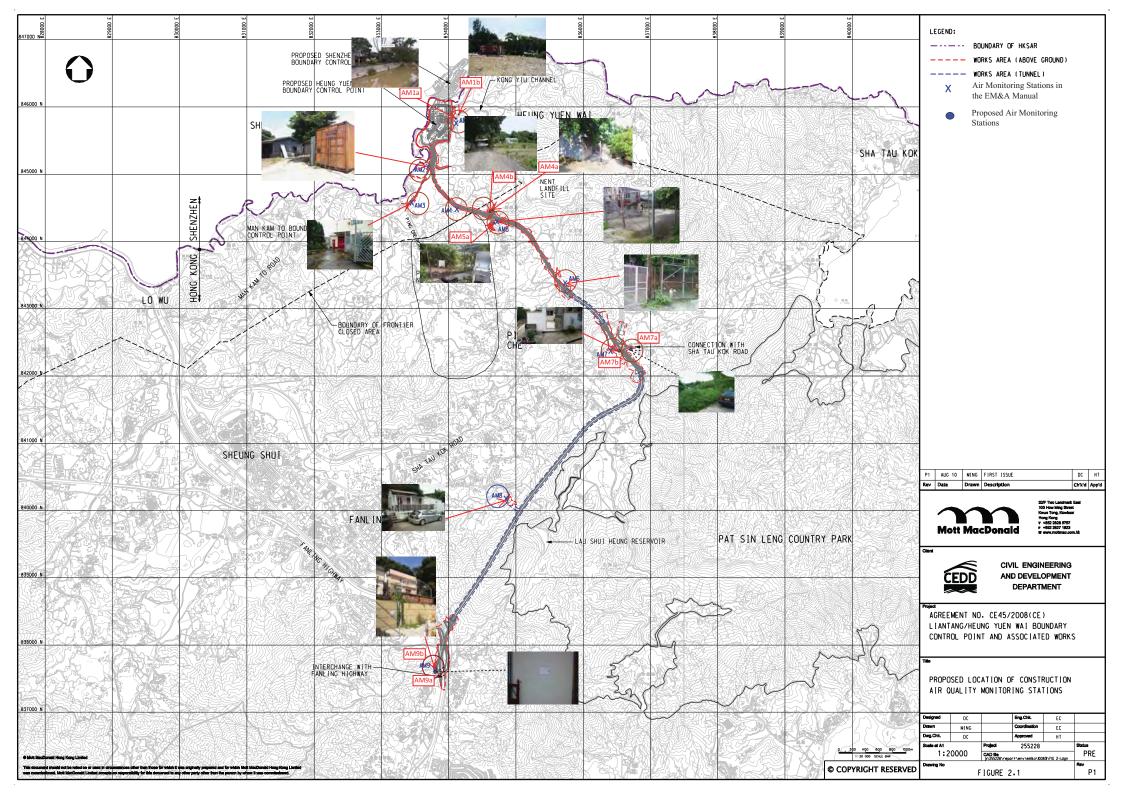

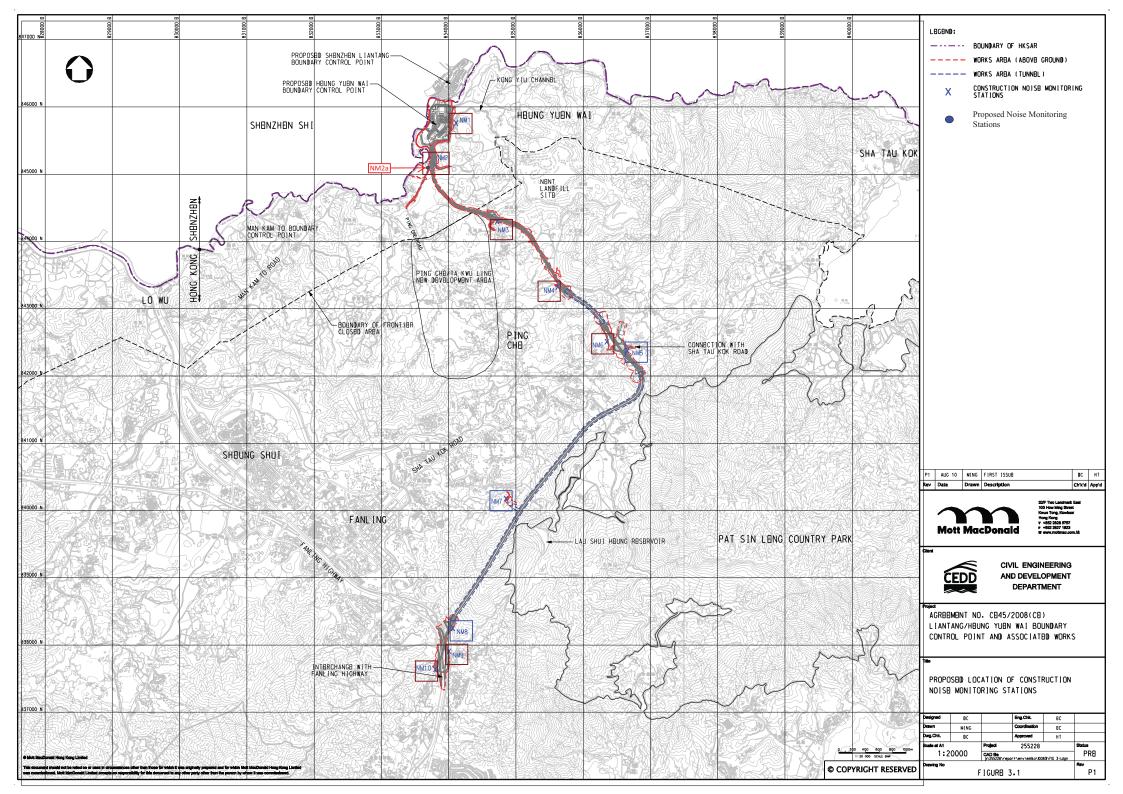

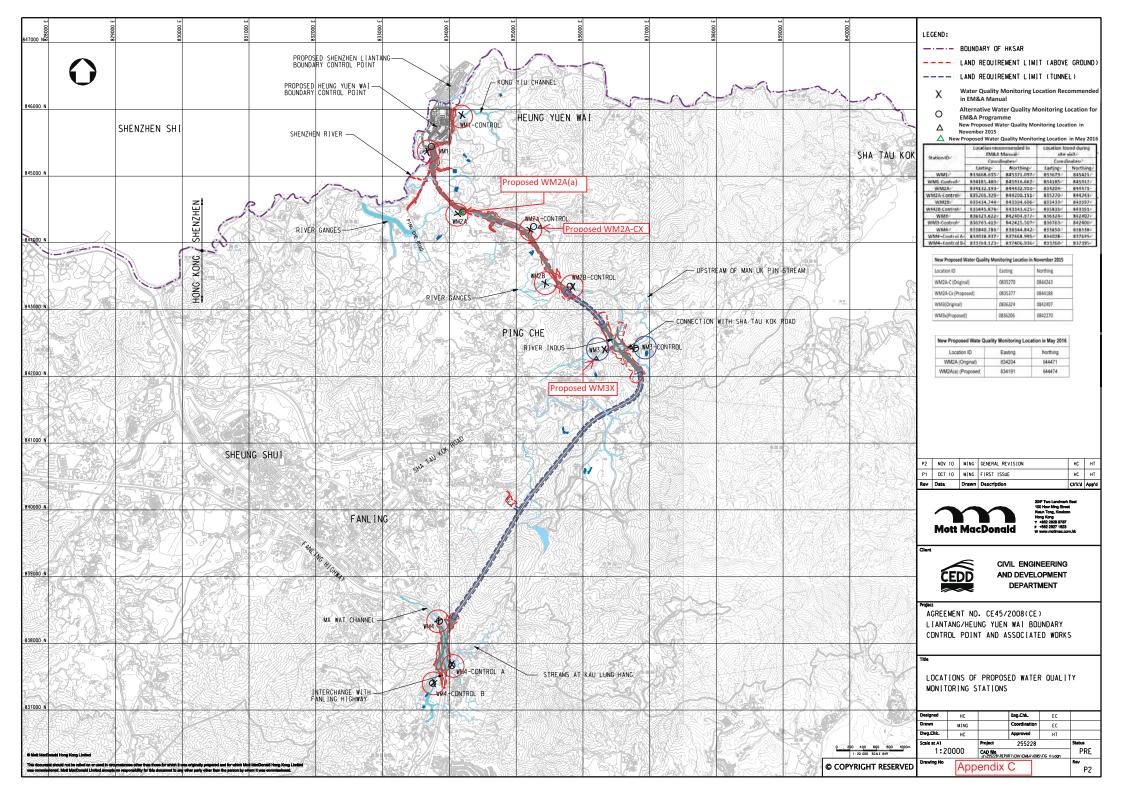



Appendix F

Calibration Certificate of Monitoring Equipment and HOKLAS-accreditation Certificate of the Testing Laboratory

Location: Open area at Tsung Yuen Ha Village
Date of Calibration: 12/8/2017
Location ID: AM1b
Next Calibration Date: 12/10/2017
Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa)
Temperature (°C)

1008.7 30.0

Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	Ι	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.8	5.8	11.6	1.603	49	48.48	Slope = 31.9141
13	4.8	4.8	9.6	1.459	43	42.55	Intercept = -3.8291
10	3.8	3.8	7.6	1.300	36	35.62	Corr. coeff. = 0.9928
7	2.5	2.5	5.0	1.057	31	30.67	
5	1.4	1.4	2.8	0.794	22	21.77	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

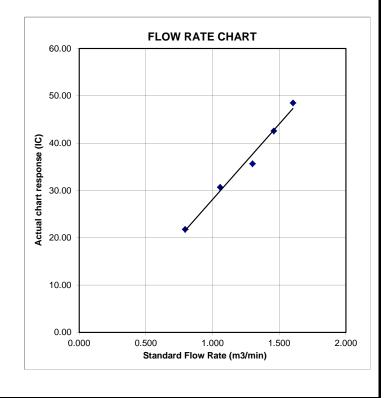

Location: Village House near Lin Ma Hang Road Date of Calibration: 12/8/2017
Location ID: AM2 Next Calibration Date: 12/10/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1008.7 30.0

Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.1	6.1	12.2	1.643	51	50.46	Slope = 32.4327
13	4.7	4.7	9.4	1.444	46	45.51	Intercept = -2.0546
10	3.7	3.7	7.4	1.283	40	39.58	Corr. coeff. = 0.9972
7	2.3	2.3	4.6	1.014	32	31.66	
5	1.5	1.5	3.0	0.821	24	23.75	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

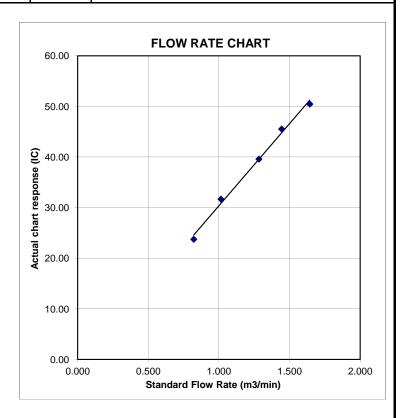

Location: Ta Kwu Ling Fire Service Station

Date of Calibration: 12/8/2017

Location ID: AM3

Next Calibration Date: 12/10/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1008.7

Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.2	6.2	12.4	1.656	55	54.42	Slope = 33.1720
13	4.9	4.9	9.8	1.474	48	47.49	Intercept = -0.7726
10	3.7	3.7	7.4	1.283	43	42.55	Corr. coeff. = 0.9984
7	2.5	2.5	5.0	1.057	34	33.64	
5	1.5	1.5	3.0	0.821	27	26.72	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

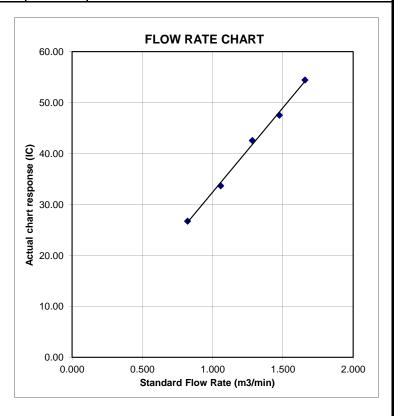

Location: Nga Yiu Ha VillageDate of Calibration:12/8/2017Location ID: AM4bNext Calibration Date:12/10/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1008.7

Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6	6	12.0	1.630	52	51.45	Slope = 32.4750
13	4.8	4.8	9.6	1.459	46	45.51	Intercept = -1.5246
10	3.7	3.7	7.4	1.283	40	39.58	Corr. coeff. = 0.9919
7	2.3	2.3	4.6	1.014	34	33.64	
5	1.5	1.5	3.0	0.821	24	23.75	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

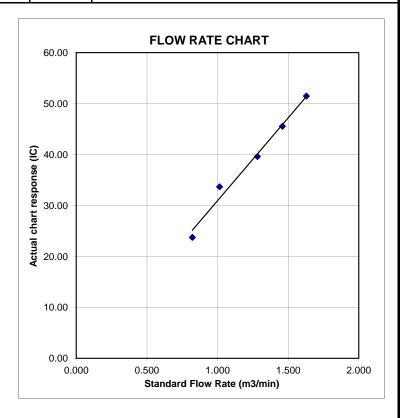

Location : Ping Yeung Village HouseDate of Calibration:12/8/2017Location ID : AM5aNext Calibration Date:12/10/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1008.7

Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.8	5.8	11.6	1.603	53	52.44	Slope = 33.7445
13	4.7	4.7	9.4	1.444	45	44.53	Intercept = -2.1685
10	3.7	3.7	7.4	1.283	43	42.55	Corr. coeff. = 0.9913
7	2.4	2.4	4.8	1.035	34	33.64	
5	1.5	1.5	3.0	0.821	25	24.74	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

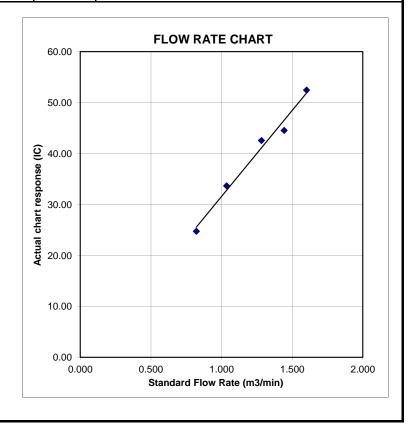

Location: Wo Keng Shan Village HouseDate of Calibration:12/8/2017Location ID: AM6Next Calibration Date:12/10/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1008.7 30.0

Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.7	5.7	11.4	1.589	55	54.42	Slope = 34.5199
13	4.6	4.6	9.2	1.429	50	49.47	Intercept = -0.0866
10	3.6	3.6	7.2	1.265	44	43.54	Corr. coeff. = 0.9989
7	2.3	2.3	4.6	1.014	36	35.62	
5	1.5	1.5	3.0	0.821	28	27.70	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

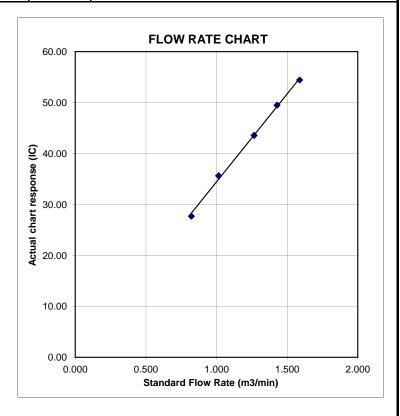

Location: Village House of Loi Tung Village

Date of Calibration: 12/8/2017

Location ID: AM7b Next Calibration Date: 12/10/2017
Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa)
Temperature (°C)

1008.7 30.0 Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

	T	1	i		1		
Plate	H20(L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	3.8	3.9	7.7	1.308	46	45.51	Slope = 34.2568
13	3.1	3.5	6.6	1.212	43	42.55	Intercept = 1.2079
10	2.6	2.8	5.4	1.097	40	39.58	Corr. coeff. = 0.9973
7	1.7	1.7	3.4	0.873	32	31.66	
5	1.1	1.1	2.2	0.705	25	24.74	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

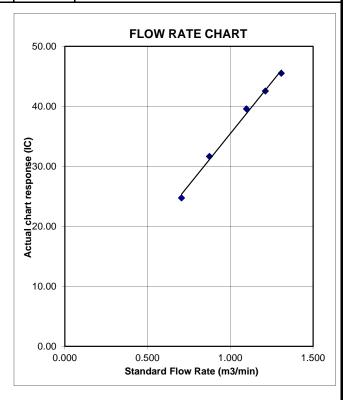

Location: Po Kat Tsai Village No. 4 Date of Calibration: 12/8/2017

Location ID: AM8 Next Calibration Date: 12/10/2017 Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa)

1008.7 Temperature (°C)

Corrected Pressure (mm Hg) Temperature (K)

756.525 303

CALIBRATION ORIFICE

30.0

Make-> TISCH Model-> 5025A Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

.11965 0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	Ι	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6	6	12.0	1.630	58	57.39	Slope = 47.4410
13	4.8	4.8	9.6	1.459	50	49.47	Intercept = -19.0107
10	3.6	3.6	7.2	1.265	44	43.54	Corr. coeff. = 0.9943
7	2.5	2.5	5.0	1.057	32	31.66	
5	1.6	1.6	3.2	0.848	20	19.79	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Ostd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

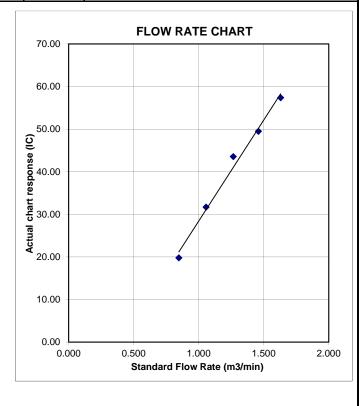

Location: Nam Wa Po Village House No. 80

Date of Calibration: 12/8/2017

Location ID: AM9b

Next Calibration Date: 12/10/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1008.7 30.0

Corrected Pressure (mm Hg)
Temperature (K)

756.525 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept -> 2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.7	5.7	11.4	1.589	53	52.44	Slope = 29.6708
13	4.7	4.7	9.4	1.444	49	48.48	Intercept = 5.2659
10	3.5	3.5	7.0	1.248	42	41.56	Corr. coeff. = 0.9989
7	2.3	2.3	4.6	1.014	36	35.62	
5	1.5	1.5	3.0	0.821	30	29.68	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

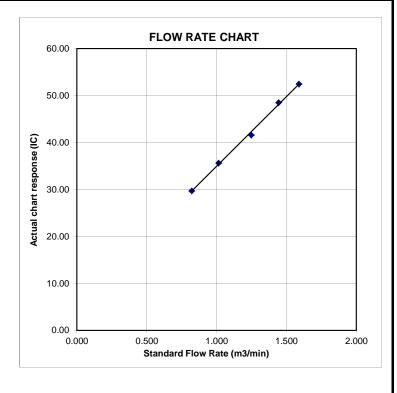

Location: Open area at Tsung Yuen Ha Village
Date of Calibration: 11/10/2017
Location ID: AM1b
Next Calibration Date: 12/12/2017
Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1011.2 29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

ı								
	Plate	H20 (L)	H2O (R)	H20	Qstd	Ι	IC	LINEAR
	No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
	18	5.7	5.7	11.4	1.591	48	47.57	Slope = 29.7125
	13	4.9	4.9	9.8	1.476	43	42.61	Intercept = -1.0120
	10	3.8	3.8	7.6	1.302	36	35.68	Corr. coeff. = 0.9916
	7	2.3	2.3	4.6	1.015	30	29.73	
	5	1.5	1.5	3.0	0.823	24	23.78	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b] IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

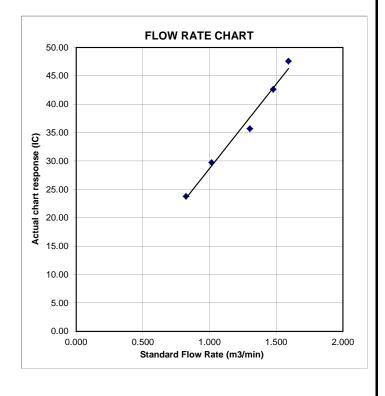

Location : Village House near Lin Ma Hang RoadDate of Calibration:11/10/2017Location ID :AM2Next Calibration Date:12/12/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1011.2 29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.8	5.8	11.6	1.605	50	49.55	Slope = 32.2176
13	4.4	4.4	8.8	1.400	45	44.59	Intercept = -1.2231
10	3.5	3.5	7.0	1.250	40	39.64	Corr. coeff. = 0.9974
7	2.3	2.3	4.6	1.015	32	31.71	
5	1.4	1.4	2.8	0.795	24	23.78	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

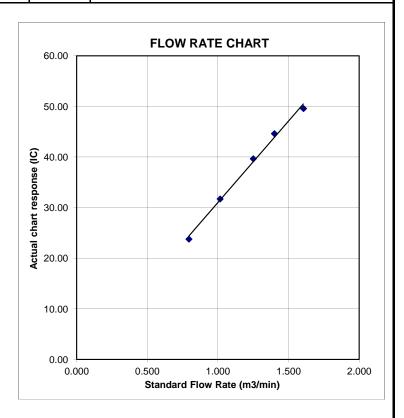

Location: Ta Kwu Ling Fire Service Station

Date of Calibration: 11/10/2017

Location ID: AM3

Next Calibration Date: 12/12/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1011.2 29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.1	6.1	12.2	1.646	54	53.51	Slope = 32.6692
13	4.8	4.8	9.6	1.461	50	49.55	Intercept = 0.8913
10	3.6	3.6	7.2	1.267	44	43.60	Corr. coeff. = 0.9946
7	2.4	2.4	4.8	1.037	34	33.69	
5	1.5	1.5	3.0	0.823	28	27.75	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

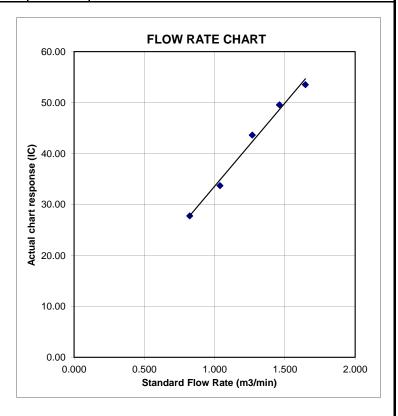

Location: Nga Yiu Ha VillageDate of Calibration:11/10/2017Location ID: AM4bNext Calibration Date:12/12/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1011.2 29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.8	5.8	11.6	1.605	52	51.53	Slope = 29.4043
13	4.7	4.7	9.4	1.446	48	47.57	Intercept = 4.8497
10	3.6	3.6	7.2	1.267	43	42.61	Corr. coeff. = 0.9989
7	2.1	2.1	4.2	0.971	34	33.69	
5	1.4	1.4	2.8	0.795	28	27.75	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

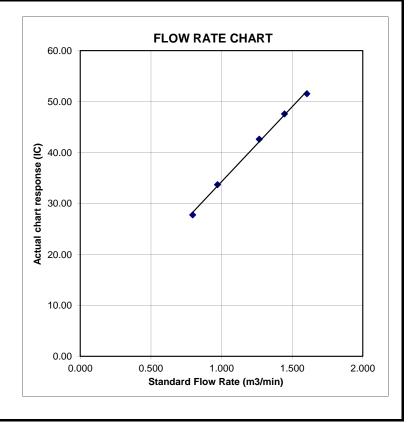

Location : Ping Yeung Village HouseDate of Calibration:11/10/2017Location ID : AM5aNext Calibration Date:12/12/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1011.2 29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.9	5.9	11.8	1.619	53	52.52	Slope = 32.4801
13	4.7	4.7	9.4	1.446	48	47.57	Intercept = 0.3320
10	3.6	3.6	7.2	1.267	42	41.62	Corr. coeff. = 0.9994
7	2.3	2.3	4.6	1.015	34	33.69	
5	1.4	1.4	2.8	0.795	26	25.77	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

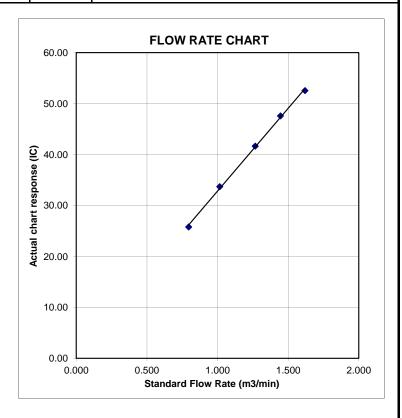

Location: Wo Keng Shan Village House Date of Calibration: 11/10/2017
Location ID: AM6 Next Calibration Date: 12/12/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1011.2 29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.5	5.5	11.0	1.563	52	51.53	Slope = 35.0470
13	4.3	4.3	8.6	1.384	46	45.59	Intercept = -3.5886
10	3.7	3.7	7.4	1.285	40	39.64	Corr. coeff. = 0.9942
7	2.1	2.1	4.2	0.971	32	31.71	
5	1.4	1.4	2.8	0.795	24	23.78	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

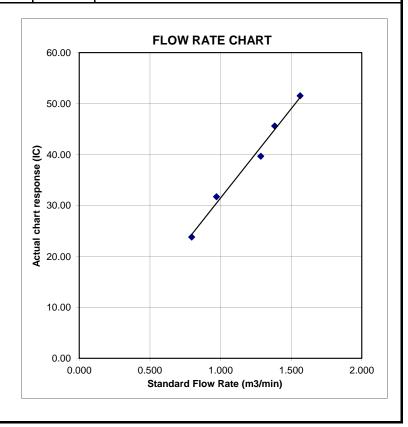

Location: Village House of Loi Tung Village

Date of Calibration: 11/10/2017

Location ID: AM7b Next Calibration Date: 12/12/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1011.2 29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	4.3	4.3	8.6	1.384	48	47.57	Slope = 35.3520
13	3.6	3.6	7.2	1.267	45	44.59	Intercept = -0.5513
10	2.8	2.8	5.6	1.119	40	39.64	Corr. coeff. = 0.9977
7	1.8	1.8	3.6	0.900	32	31.71	
5	1.1	1.1	2.2	0.706	24	23.78	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

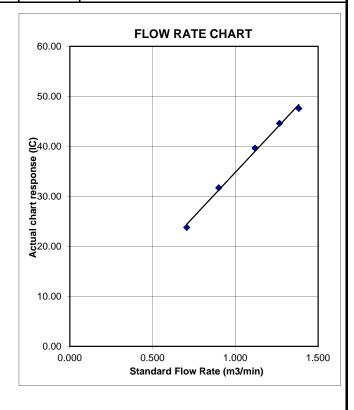

Location: Nam Wa Po Village House No. 80

Date of Calibration: 11/10/2017

Location ID: AM9b

Next Calibration Date: 12/12/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C)

1011.2
29.8

Corrected Pressure (mm Hg)
Temperature (K)

758.4
303

CALIBRATION ORIFICE

Make->	TISCH
Model->	5025A
Serial # ->	1941

Qstd Slope -> Qstd Intercept -> 2.11965 -0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.7	5.7	11.4	1.591	50	49.55	Slope = 35.2853
13	4.5	4.5	9.0	1.415	46	45.59	Intercept = -5.4886
10	3.6	3.6	7.2	1.267	40	39.64	Corr. coeff. = 0.9965
7	2.2	2.2	4.4	0.993	30	29.73	
5	1.7	1.7	3.4	0.875	25	24.77	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

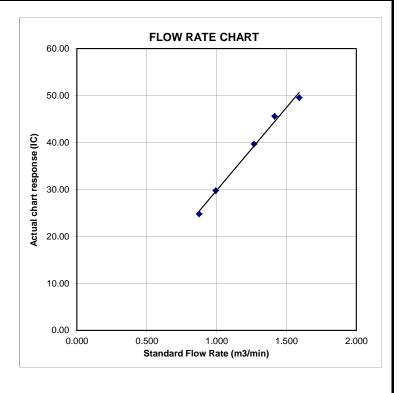

Location: Po Kat Tsai Village No. 4 Date of Calibration: 11/10/2017 Location ID: AM8

Next Calibration Date: 12/12/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C)

1011.2 29.8 Corrected Pressure (mm Hg) Temperature (K)

758.4 303

CALIBRATION ORIFICE

Make-> TISCH Model-> 5025A Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

.11965 0.02696

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.8	5.8	11.6	1.605	58	57.48	Slope = 43.5498
13	4.8	4.8	9.6	1.461	48	47.57	Intercept = -13.7829
10	3.6	3.6	7.2	1.267	43	42.61	Corr. coeff. = 0.9947
7	2.6	2.6	5.2	1.079	33	32.70	
5	1.3	1.3	2.6	0.767	20	19.82	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Ostd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

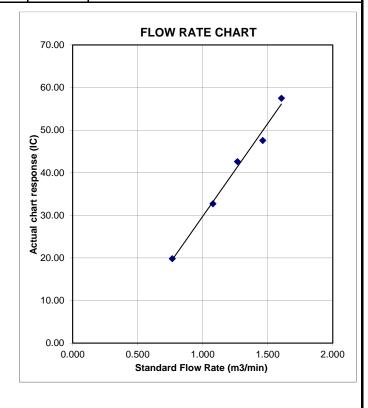



TISCH ENVIRONMENTAL, INC. 145 SOUTH MIAMI AVE VILLAGE OF CLEVES, OH 45002 513.467.9000 877.263.7610 TOLL FREE 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

				=======	METER	ODETCE
PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.4600	3.2	2.0
2	NA	NA	1.00	1.0410	6.4	4.0
3	NA	NA	1.00	0.9280	7.9	5.0
4	NA	NA	1.00	0.8840	8.7	5.5
5	NA	NA	1.00	0.7290	12.7	8.0

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)		Va	(x axis) Qa	(y axis)
0.9967 0.9925 0.9904 0.9894 0.9840	0.6827 0.9534 1.0672 1.1192 1.3499	1.4149 2.0010 2.2372 2.3464 2.8299	-	0.9957 0.9915 0.9894 0.9884 0.9830	0.6820 0.9524 1.0661 1.1181 1.3485	0.8851 1.2517 1.3995 1.4678 1.7702
Qstd slo	ent (b) =	2.11965 -0.02696 0.99991 		Qa slop intercep coeffici	ot (b) =	1.32729 -0.01686 0.99991

CALCULATIONS

Vstd = Diff. Vol[(Pa-Diff. Hg)/760](298/Ta)
Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa] Qa = Va/Time

For subsequent flow rate calculations:

Qstd = $1/m\{[SQRT(H2O(Pa/760)(298/Ta))] - b\}$ Qa = $1/m\{[SQRT H2O(Ta/Pa)] - b\}$

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 2X6145

Equipment Ref: EQ105

Job Order HK1703462

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m ³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/60min)
3hr14min	09:10 ~ 12:24	20.6	1016.3	0.145	13025	67.2
1hr57min	12:30 ~ 14:27	20.6	1016.3	0.069	3586	30.6
1hr58min	14:35 ~ 16:33	20.6	1016.3	0.091	4709	39.6

Sensitivity Adjustment Scale Setting (Before Calibration) 581 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 580 (CPM)

Linear Regression of Y or X

 Slope (K-factor):
 0.0022

 Correlation Coefficient
 0.9992

 Date of Issue
 11 January 2017

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

0.16			-	
0.14				
0.12				
0.1				
80.0		/		
0.06	-/	y = 0	$0.0022x + 0.00$ $R^2 = 0.9985$	016
0.04	-/-		K 0.9985	
0.02	/			
U				-
	20	40	60	80

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer: Ben Tam Signature: Date: 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Date of Calibration: 25-Nov-16 Location: Gold King Industrial Building, Kwai Chung Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa)

1016.4 Temperature (°C) 20.0 Corrected Pressure (mm Hg) Temperature (K)

762.3 293

CALIBRATION ORIFICE

Make-> TISCH Model-> 5025A

Calibration Date-> 14-Mar-16

Ostd Slope -> Qstd Intercept ->

Expiry Date->

2.00411 -0.03059 14-Mar-17

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	Ι	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.1	6.1	12.2	1.776	56	56.56	Slope = 35.6871
13	4.7	4.7	9.4	1.560	49	49.49	Intercept = -6.1123
10	3.6	3.6	7.2	1.368	43	43.43	Corr. coeff. = 0.9967
8	2.3	2.3	4.6	1.096	34	34.34	
5	1.4	1.4	2.8	0.859	23	23.23	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Ostd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

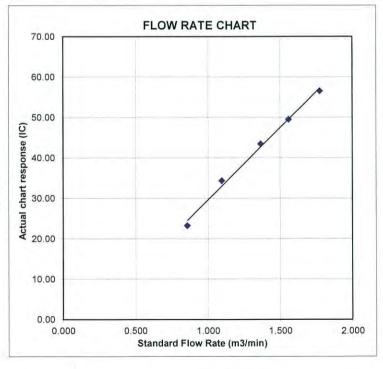

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. <u>366409</u>

Equipment Ref: EQ109

Job Order HK1703455

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/60min)
3hr14min	09:10 ~ 12:24	20.6	1016.3	0.145	12487	64.4
1hr57min	12:30 ~ 14:27	20.6	1016.3	0.069	3433	29.3
1hr58min	14:35 ~ 16:33	20.6	1016.3	0.091	4815	40.5

Sensitivity Adjustment Scale Setting (Before Calibration) 523 (CPM)


Sensitivity Adjustment Scale Setting (After Calibration) 525 (CPM)

Linear Regression of Y or X

Slope (K-factor): 0.0022

Correlation Coefficient 0.9997

Date of Issue 11 January 2017

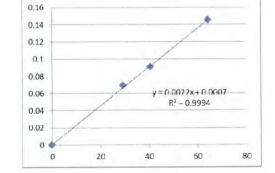

Remarks:

1. Strong Correlation (R>0.8)

2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer: Ben Tam Signature: Date: 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16
Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa) 1016.4 Corrected Pressure (mm Hg) 762.3 Temperature (°C) 20.0 Temperature (K) 293

CALIBRATION ORIFICE

Make-> TISCH Qstd Slope -> 2.00411
Model-> 5025A Qstd Intercept -> -0.03059
Calibration Date-> 14-Mar-16 Expiry Date-> 14-Mar-17

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.1	6.1	12.2	1.776	56	56.56	Slope = 35.6871
13	4.7	4.7	9.4	1.560	49	49.49	Intercept = -6.1123
10	3.6	3.6	7.2	1.368	43	43.43	Corr. coeff. = 0.9967
8	2.3	2.3	4.6	1.096	34	34.34	
5	1.4	1.4	2.8	0.859	23	23.23	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

Pav = daily average pressure

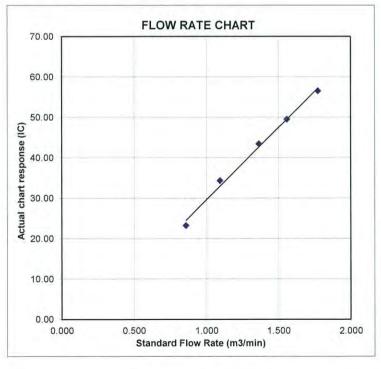

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 366410

Equipment Ref: EQ110

Job Order HK1703460

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/60min)
3hr14min	09:10 ~ 12:24	20.6	1016.3	0.145	12401	64.0
1hr57min	12:30 ~ 14:27	20.6	1016.3	0.069	3266	27.9
1hr58min	14:35 ~ 16:33	20.6	1016.3	0.091	4878	41.1

Sensitivity Adjustment Scale Setting (Before Calibration) 677 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 675 (CPM)

Linear Regression of Y or X

 Slope (K-factor):
 0.0022

 Correlation Coefficient
 0.9984

 Date of Issue
 11 January 2017

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

0.16				
0.14				
0.12			/	
0.1		_/		_
80.0		/		
0.06	7		0022x+0.001	5
	/	R	² - 0.9969	
0.04				
0.04	1		- w	

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer : _____ Ben Tam ___ Signature : _____ Date : ____ 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16

Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa) 1016.4 Corrected Pressure (mm Hg) 762.3
Temperature (°C) 20.0 Temperature (K) 293

CALIBRATION ORIFICE

 Make->
 TISCH
 Qstd Slope ->
 2.00411

 Model->
 5025A
 Qstd Intercept ->
 -0.03059

 Calibration Date->
 14-Mar-16
 Expiry Date->
 14-Mar-17

CALIBRATION

Plate		H2O (R)	H20	Qstd	I	IC .	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.1	6.1	12.2	1.776	56	56.56	Slope = 35.6871
13	4.7	4.7	9.4	1.560	49	49.49	Intercept = -6.1123
10	3.6	3.6	7.2	1.368	43	43.43	Corr. coeff. = 0.9967
8	2.3	2.3	4.6	1.096	34	34.34	
5	1.4	1.4	2.8	0.859	23	23.23	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

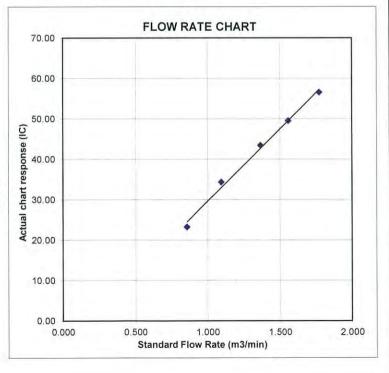

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 3Y6503

Equipment Ref: EQ112

Job Order HK1703461

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/60min)
3hr14min	09:10 ~ 12:24	20.6	1016.3	0.145	12647	65.3
1hr57min	12:30 ~ 14:27	20.6	1016.3	0.069	3476	29.7
1hr58min	14:35 ~ 16:33	20.6	1016.3	0.091	4876	41.0

Sensitivity Adjustment Scale Setting (Before Calibration) 654 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 658 (CPM)

Linear Regression of Y or X

Slope (K-factor): 0.0022

Correlation Coefficient 0.9997

Date of Issue 11 January 2017

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

0.16				
0.14				
0.12			/	-
0.1				
80.0				
0.06			0022x+0.000	1/
0.04	_/_		$R^2 = 0.9994$	
0.02	/			
0				
	20	40	60	80

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer: Ben Tam Signature: Date: 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16

Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa)1016.4Corrected Pressure (mm Hg)762.3Temperature (°C)20.0Temperature (K)293

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Calibration Date-> 14-Mar-16
Qstd Slope -> 2.00411
Qstd Intercept -> -0.03059
Expiry Date-> 14-Mar-17

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.1	6.1	12.2	1.776	56	56.56	Slope = 35.6871
13	4.7	4.7	9.4	1.560	49	49.49	Intercept = -6.1123
10	3.6	3.6	7.2	1.368	43	43.43	Corr. coeff. = 0.9967
8	2.3	2.3	4.6	1.096	34	34.34	
5	1.4	1.4	2.8	0.859	23	23.23	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

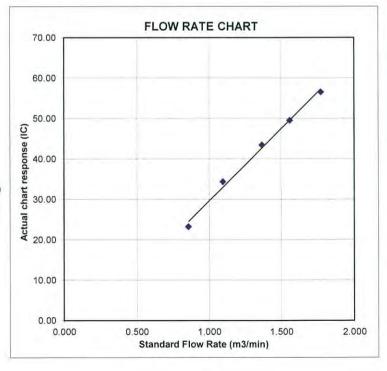

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 3Y6505

Equipment Ref: EQ114

Job Order HK1703464

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/60min)
3hr14min	09:10 ~ 12:24	20.6	1016.3	0.145	12588	65.0
1hr57min	12:30 ~ 14:27	20.6	1016.3	0.069	3339	28.5
1hr58min	14:35 ~ 16:33	20.6	1016.3	0.091	4774	40.2


Sensitivity Adjustment Scale Setting (Before Calibration) 588 (CPM)
Sensitivity Adjustment Scale Setting (After Calibration) 587 (CPM)

Linear Regression of Y or X

 Slope (K-factor):
 0.0022

 Correlation Coefficient
 0.9992

 Date of Issue
 11 January 2017

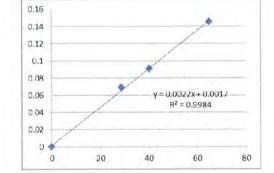

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer : ____ Ben Tam ___ Signature : _____ Date : ___ 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16
Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1016.4 20.0

Corrected Pressure (mm Hg)
Temperature (K)

762.3 293

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Calibration Date-> 14-Mar-16

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.00411 -0.03059 14-Mar-17

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.1	6.1	12.2	1.776	56	56.56	Slope = 35.6871
13	4.7	4.7	9.4	1.560	49	49.49	Intercept = -6.1123
10	3.6	3.6	7.2	1.368	43	43.43	Corr. coeff. = 0.9967
8	2.3	2.3	4.6	1.096	34	34.34	
5	1.4	1.4	2.8	0.859	23	23.23	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

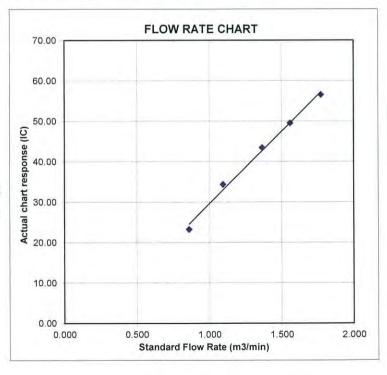



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No.: C172288

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC17-0924)

Date of Receipt / 收件日期: 24 April 2017

Description / 儀器名稱

Integrating Sound Level Meter (EQ006)

Manufacturer / 製造商

Brüel & Kjær

Model No./型號

2238

Serial No. / 編號

2285762

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 :

Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

28 April 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

HT Wong Technical Officer

Certified By 核證

K C/Lee Project Engineer Date of Issue 簽發日期

2 May 2017

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准+



Certificate of Calibration 校正證書

Certificate No.:

C172288

證書編號

 The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.

2. Self-calibration using laboratory acoustic calibrator was performed before the test from 6.1.1.2 to 6.4.

3. The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment:

Equipment ID

Description

Certificate No.

CL280

40 MHz Arbitrary Waveform Generator

C170048

CL281

Multifunction Acoustic Calibrator

PA160023

- Test procedure: MA101N.
- 6. Results:
- 6.1 Sound Pressure Level
- 6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Self-calibration

	UUT	Setting	Applied	UUT		
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)
50 - 130	L _{AFP}	A	F	94.00	1	94.1

6.1.1.2 After Self-calibration

	UUT Setting			Applie	d Value	UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Type 1 Spec. (dB)
50 - 130	L _{AFP}	A	F	94.00	1	94.0	± 0.7

6.1.2 Linearity

	UU	Γ Setting	Applie	UUT			
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	
50 - 130	LAFP	A	F	94.00	1	94.0 (Ref.)	
	(Jacob			104.00		104.0	
				114.00		114.0	

IEC 60651 Type 1 Spec. : \pm 0.4 dB per 10 dB step and \pm 0.7 dB for overall different.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172288

證書編號

6.2 Time Weighting

6.2.1 Continuous Signal

UUT Setting			Applie	d Value	UUT	IEC 60651	
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Type 1 Spec. (dB)
50 - 130	LAFP	A	F	94.00	-1	94.0	Ref.
	L _{ASP}		S			94.1	± 0.1
	LAIP		1			94.1	± 0.1

6.2.2 Tone Burst Signal (2 kHz)

	UUT Setting			Applied Value		UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Burst Duration	Reading (dB)	Type 1 Spec (dB)
30 - 110	L _{AFP}	A	F	106.0	Continuous	106.0	Ref.
	L _{AFMax}				200 ms	105.0	-1.0 ± 1.0
	L _{ASP}		S		Continuous	106.0	Ref.
	L _{ASMax}				500 ms	102.0	-4.1 ± 1.0

6.3 Frequency Weighting

6.3.1 A-Weighting

	UUT	Setting		Appli	ed Value	UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Type 1 Spec. (dB)
50 - 130	LAFP	Α	F	94.00	31.5 Hz	55.1	-39.4 ± 1.5
				63 Hz	68.0	-26.2 ± 1.5	
				125 Hz	77.8	-16.1 ± 1.0	
				250 Hz	85.3	-8.6 ± 1.0	
		1			500 Hz	90.8	-3.2 ± 1.0
					1 kHz	94.0	Ref.
					2 kHz	95.2	$+1.2 \pm 1.0$
					4 kHz	95.0	$+1.0 \pm 1.0$
					8 kHz	92.9	-1.1 (+1.5; -3.0)
					12.5 kHz	89.8	-4.3 (+3.0; -6.0)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

證書編號

Certificate No.: C172288

6.3.2 C-Weighting

		Setting		Appli	ed Value	UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Type 1 Spec. (dB)
50 - 130	L _{CFP}	C	F	94.00	31.5 Hz	91.5	-3.0 ± 1.5
CII				63 Hz	93.4	-0.8 ± 1.5	
					125 Hz	93.9	-0.2 ± 1.0
					250 Hz	94.1	0.0 ± 1.0
					500 Hz	94.1	0.0 ± 1.0
					1 kHz	94.1	Ref.
					2 kHz	93.9	-0.2 ± 1.0
					4 kHz	93.2	-0.8 ± 1.0
					8 kHz	91.0	-3.0 (+1.5; -3.0
					12.5 kHz	87.9	-6.2 (+3.0; -6.0

6.4 Time Averaging

	UUT	Γ Setting			A	oplied Valu	е		UUT Reading (dB)	Type 1 Spec. (dB)
Range (dB)	Parameter	Frequency Weighting	Integrating Time	Frequency (kHz)	Burst Duration (ms)	Burst Duty Factor	Burst Level (dB)	Equivalent Level (dB)		
30 - 110	LAcq	A	10 sec.	4	1	1/10	110.0	100	100.0	± 0.5
	0.2		7000			1/102		90	89.9	± 0.5
			60 sec.			1/103		80	79.2	± 1.0
			5 min.			1/104		70	69.2	± 1.0

Remarks: - UUT Microphone Model No.: 4188 & S/N: 2812705

- Mfr's Spec. : IEC 60651 Type 1 & IEC 60804 Type 1

- Uncertainties of Applied Value : 94 dB : 31.5 Hz - 125 Hz : ± 0.35 dB

250 Hz - 500 Hz : ± 0.30 dB 1 kHz : ± 0.20 dB 2 kHz - 4 kHz : ± 0.35 dB 8 kHz : ± 0.45 dB

12.5 kHz : ± 0.70 dB

104 dB: 1 kHz $\pm 0.10 \text{ dB (Ref. 94 dB)}$: ± 0.10 dB (Ref. 94 dB) 114 dB: 1 kHz Burst equivalent level : ± 0.2 dB (Ref. 110 dB

continuous sound level)

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

⁻ The uncertainties are for a confidence probability of not less than 95 %.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

Certificate No.: C172287

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC17-0924)

Date of Receipt / 收件日期: 24 April 2017

Description / 儀器名稱

Sound Level Meter (EQ015)

Manufacturer / 製造商

Rion

Model No. / 型號 Serial No. / 編號

NL-52 00142581

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 溫度 :

 $(23 \pm 2)^{\circ}C$

Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

28 April 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany

- Fluke Everett Service Center, USA

Tested By 測試

HT Wong Technical Officer

Certified By 核證

K C Lee Project Engineer Date of Issue 簽發日期

2 May 2017

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書而批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. :

C172287

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.

2. Self-calibration was performed before the test.

3. The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment:

Equipment ID

Description

Certificate No.

CL280 CL281 40 MHz Arbitrary Waveform Generator

C170048

Multifunction Acoustic Calibrator

PA160023

5. Test procedure: MA101N.

6. Results:

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

	UUT Setting			Applied Value		UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Class 1 Spec. (dB)
30 - 130	LA	A	Fast	94.00	1	94.3	± 1.1

6.1.2 Linearity

UUT Setting				Applie	UUT		
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	
30 - 130	LA	A	Fast	94.00	1	94.3 (Ref.)	
-	122			104.00		104.3	
				114.00		114.3	

IEC 61672 Class 1 Spec. : \pm 0.6 dB per 10 dB step and \pm 1.1 dB for overall different.

6.2 Time Weighting

UUT Setting			Applie	d Value	UUT	IEC 61672	
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L _A	A	Fast	94.00	-1-	94.3	Ref.
			Slow			94.3	± 0.3

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172287

證書編號

6.3 Frequency Weighting

6.3.1 A-Weighting

	UUT	Setting		Appl	ied Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	LA	A	Fast	94.00	63 Hz	68.1	-26.2 ± 1.5
				125 Hz	78.1	-16.1 ± 1.5	
				250 Hz	85.6	-8.6 ± 1.4	
					500 Hz	91.0	-3.2 ± 1.4
					1 kHz	94.3	Ref.
					2 kHz	95.5	$+1.2 \pm 1.6$
					4 kHz	95.3	$+1.0 \pm 1.6$
					8 kHz	93.3	-1.1 (+2.1; -3.1)
					12.5 kHz	89.9	-4.3 (+3.0; -6.0)

6.3.2 C-Weighting

	UUT	Setting		Appl	ied Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L _C	C	Fast	94.00	63 Hz	93.4	-0.8 ± 1.5
					125 Hz	94.1	-0.2 ± 1.5
					250 Hz	94.3	0.0 ± 1.4
					500 Hz	94.3	0.0 ± 1.4
					1 kHz	94.3	Ref.
					2 kHz	94.1	-0.2 ± 1.6
					4 kHz	93.5	-0.8 ± 1.6
					8 kHz	91.4	-3.0 (+2.1; -3.1)
					12.5 kHz	87.9	-6.2 (+3.0; -6.0)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172287

證書編號

Remarks: - UUT Microphone Model No.: UC-59 & S/N: 06015

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value: 94 dB: 63 Hz - 125 Hz: ± 0.35 dB

250 Hz - 500 Hz : $\pm 0.30 \text{ dB}$ 1 kHz : $\pm 0.20 \text{ dB}$ 2 kHz - 4 kHz : $\pm 0.35 \text{ dB}$ 8 kHz : $\pm 0.45 \text{ dB}$ 12.5 kHz : $\pm 0.70 \text{ dB}$

104 dB: 1 kHz : ± 0.10 dB (Ref. 94 dB) 114 dB: 1 kHz : ± 0.10 dB (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

本證書所載校正用之測試器材均可溯源至國際標準。 局部複印本證書需先獲本實驗所書面批准。

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172286

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC17-0924)

Date of Receipt / 收件日期: 24 April 2017

Description / 儀器名稱 : Soun

Sound Level Meter (EQ067) Rion

Manufacturer / 製造商 Model No. / 型號 Serial No. / 編號

NL-31 00410221

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C

Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 28 April 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

H T Wong

Technical Officer

Certified By 核證

K C Lee

Date of Issue 簽發日期 :

2 May 2017

Project Engineer

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可淵源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

Certificate No.: C172286

證書編號

The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.

Self-calibration was performed before the test. 2.

3. The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment:

> Equipment ID CL280 CL281

Description

40 MHz Arbitrary Waveform Generator Multifunction Acoustic Calibrator

Certificate No. C170048

PA160023

Test procedure: MA101N.

6. Results:

Sound Pressure Level 6.1

6.1.1 Reference Sound Pressure Level

UUT Setting			Applied Value		UUT	IEC 61672 Class 1	
Range (dB)	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Spec. (dB)
30 - 120	LA	A	Fast	94.00	1	93.1	± 1.1

6.1.2 Linearity

UUT Setting			Applied	Value	UUT	
Range (dB)	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)
30 - 120	L_A	A	A Fast	94.00	1	93.1 (Ref.)
				104.00		103.1
				114.00		113.2

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

Time Weighting 6.2

UUT Setting			Applied Value		UUT	IEC 61672 Class 1	
Range (dB)	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Spec. (dB)
30 - 120	L _A	A	Fast	94.00	1	93.1	Ref.
			Slow		professional	93.1	± 0.3

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laborator



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172286

證書編號

6.3 Frequency Weighting

6.3.1 A-Weighting

	UU	T Setting		Appl	Applied Value		IEC 61672 Class 1
Range (dB)	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Spec. (dB)
30 - 120	LA	A	Fast		63 Hz	66.8	-26.2 ± 1.5
					125 Hz	76.9	-16.1 ± 1.5
					250 Hz	84.4	-8.6 ± 1.4
					500 Hz	89.8	-3.2 ± 1.4
					1 kHz	93.1	Ref.
					2 kHz	94.4	$+1.2 \pm 1.6$
				4 kHz	94.2	$+1.0 \pm 1.6$	
			- 1		8 kHz	92.0	-1.1 (+2.1; -3.1)
					12.5 kHz	89.2	-4.3 (+3.0; -6.0)

6.3.2 C-Weighting

	UU	T Setting		App	ied Value UUT		IEC 61672 Class 1	
Range (dB)	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Spec. (dB)	
30 - 120	Lc	C	Fast	94.00	63 Hz	92.2	-0.8 ± 1.5	
		-			125 Hz	92.9	-0.2 ± 1.5	
					250 Hz	93.1	0.0 ± 1.4	
					500 Hz	93.1	0.0 ± 1.4	
						1 kHz	93.1	Ref.
					2 kHz	93.0	-0.2 ± 1.6	
					4 kHz	92.4	-0.8 ± 1.6	
					8 kHz	90.2	-3.0 (+2.1; -3.1)	
					12.5 kHz	87.3	-6.2 (+3.0; -6.0)	

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172286

證書編號

Remarks: - UUT Microphone Model No.: UC-53A & S/N: 319734

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value : 94 dB : 63 Hz - 125 Hz : \pm 0.35 dB

250 Hz - 500 Hz : ± 0.30 dB 1 kHz : ± 0.20 dB 2 kHz - 4 kHz : ± 0.35 dB 8 kHz : ± 0.45 dB 12.5 kHz : ± 0.70 dB

104 dB : 1 kHz : \pm 0.10 dB (Ref. 94 dB) 114 dB : 1 kHz : \pm 0.10 dB (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172284

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC17-0924)

Date of Receipt / 收件日期: 24 April 2017

Description / 儀器名稱 : Acoustical Calibrator (EQ082)

Manufacturer / 製造商 : Brüel & Kjær

Model No. /型號 : 4231 Serial No. /編號 : 2713428

Supplied By / 委託者 : Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 28 April 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

H T Wong Technical Officer

Certified By 核證

K C Lee Project Engineer Date of Issue 簽發日期

2 May 2017

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可測源至國際標準。 局部複印本證書需先獲本實驗所書面批准。

Certificate of Calibration

Certificate No.: C172284

證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- 2. The results presented are the mean of 3 measurements at each calibration point.
- 3. Test equipment:

Equipment ID Description Certificate No. C163709 CL130 Universal Counter CL281 Multifunction Acoustic Calibrator PA160023 TST150A Measuring Amplifier C161175

- Test procedure: MA100N.
- Results:

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	94.0	± 0.2	± 0.2
114 dB, 1 kHz	114.1		

5.2 Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's	Uncertainty of Measured Value
(kHz)	(kHz)	Spec.	(Hz)
1	1.000 0	1 kHz ± 0.1 %	± 0.1

Remark: The uncertainties are for a confidence probability of not less than 95 %.

E-mail/電郵; callab@suncreation.com

Note:

Tel/電話: 2927 2606

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

Website/網址: www.suncreation.com

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Fax/傳真: 2744 8986

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C172285

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC17-0924)

Date of Receipt / 收件日期: 24 April 2017

Description / 儀器名稱 : Sound Level Calibrator (EQ088)

Manufacturer / 製造商 : Quest Model No. /型號 : QC-20 Serial No. /編號 : QO9090006

Supplied By / 委託者 : Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 : (23 ± 2)°C Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 28 April 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

H T Wong

Technical Officer

Certified By 核證

K C Lee Project Engineer Date of Issue 簽發日期

2 May 2017

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Certificate of Calibration

Certificate No. : C172285

證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- 2. The results presented are the mean of 3 measurements at each calibration point.
- Test equipment:

Equipment ID Description Certificate No. CL130 Universal Counter C163709 Multifunction Acoustic Calibrator PA160023 CL281 TST150A Measuring Amplifier C161175

- Test procedure: MA100N. 4.
- 5. Results:

Sound Level Accuracy 5.1

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	94.2	± 0.3	± 0.2
114 dB, 1 kHz	114.2		

5.2 Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.	Uncertainty of Measured Value
(kHz)	(kHz)		(Hz)
1	0.991	±2%	± 1

Remark: - The uncertainties are for a confidence probability of not less than 95 %.

Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

本證書所嚴校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C174095

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC17-0924)

Date of Receipt / 收件日期: 14 July 2017

Description / 儀器名稱

Sound Calibrator

Manufacturer / 製造商

Rion

Model No. / 型號

NC-74

Serial No. / 編號

34657231

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 :

 $(23 \pm 2)^{\circ}$ C

Relative Humidity / 相對濕度 :

Line Voltage / 電壓

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

22 July 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By

測試

H T Wong Technical Officer

Certified By

核證

K C Lee Engineer Date of Issue

25 July 2017

簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laborator

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 輝創工程有限公司 - 校正及檢測實驗所

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C174095

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

Equipment ID CL130 CL281 TST150A

<u>Description</u> Universal Counter Multifunction Acoustic Calibrator Measuring Amplifier

Certificate No. C173864 PA160023 C161175

4. Test procedure: MA100N.

5. Results:

5.1 Sound Level Accuracy

UUT	Measured Value	Mfr's Spec.	Uncertainty of Measured Value
Nominal Value	(dB)	(dB)	(dB)
94 dB, 1 kHz	94.1	± 0.3	± 0.2

5.2 Frequency Accuracy

1 2			
UUT Nominal Value	Measured Value	Mfr's	Uncertainty of Measured Value
(kHz)	(kHz)	Spec.	(Hz)
1	1.001	1 kHz ± 1 %	± 1

Remark: The uncertainties are for a confidence probability of not less than 95 %.

Note:

Tel/電話: 2927 2606 Fax/傳真: 2744 8986

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



ALS Technichem (HK) Pty Ltd 11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung, N.T., Hong Kong T +852 2610 1044 F +852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR BEN TAM WORK ORDER: HK1763030

CLIENT: ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING SUB-BATCH: 0

ADDRESS: RM A 20/F., GOLD KING IND BLDG, LABORATORY: HONG KONG

NO. 35- 41 TAI LIN PAI ROAD, DATE RECEIVED: 18/08/2017 KWAI CHUNG, DATE OF ISSUE: 28/08/2017

N.T., HONG KONG.

COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the ALS Hong Kong laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principals as practised by the ALS Hong Kong laboratory or quoted from relevant international standards.

Scope of Test:

Dissolved Oxygen and Temperature

Equipment Type:

Dissolved Oxygen Meter

Brand Name:

YSI

Model No.:

550A

Serial No.:

16A104433

Equipment No.:

Date of Calibration: 24 August, 2017

NOTES

This is the Final Report and supersedes any preliminary report with this batch number.

Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Mr Chan Siu Ming, Vice Manager - Inorganics

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

Work Order:

HK1763030

Sub-Batch:

0

Date of Issue:

28/08/2017

Client:

ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING

Equipment Type:

Dissolved Oxygen Meter YSI

Brand Name: Model No.:

550A

Serial No.:

16A104433

Equipment No.: Date of Calibration:

24 August, 2017

Date of next Calibration:

24 November, 2017

Parameters:

Dissolved Oxygen

Method Ref: APHA (21st edition), 45000: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
3.52	3.35	- 0.17
5.48	5.45	- 0.03
8.04	7.91	- 0.13
	Tolerance Limit (mg/L)	±0.20

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure. Expected Reading (°C) Displayed Reading (°C) Tolerance (°C) 9.0 9.3 +0.321.0 21.4 +0.437.0 36.1 - 0.9 Tolerance Limit (°C) ± 2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

> Mr Chan Siu Ming, Vied Manager - Inorganics



ALS Technichem (HK) Pty Ltd

11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung, N.T., Hong Kong <u>T</u>+852 2610 1044 <u>F</u>+852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:

MR BEN TAM

WORK ORDER:

HK1763018

CLIENT:

ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING

SUB-BATCH:

ADDRESS:

RM A 20/F., GOLDEN KING IND BLDG.

LABORATORY:

HONG KONG

NO. 35-41 TAI LIN PAI ROAD,

DATE RECEIVED:

18/08/2017

KWAI CHUNG, N.T., HONG KONG DATE OF ISSUE:

28/08/2017

COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the ALS Hong Kong laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principals as practised by the ALS Hong Kong laboratory or quoted from relevant international standards.

Scope of Test:

рН

Description:

pH Meter

Brand Name:

AZ

Model No .:

8685

Serial No .:

1141943

Equipment No.:

Date of Calibration: 24 August, 2017

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

> Mr Chan Siu Ming, Vied Manager - Inorganics

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

Work Order:

HK1763018

Sub-batch:

Date of Issue:

28/08/2017

Client:

ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING

Description:

AZ

Brand Name:

8685

Model No.: Serial No.:

1141943

pH Meter

Equipment No.:

Date of Calibration: 24 August, 2017

Date of next Calibration:

24 November, 2017

Parameters:

pH Value

Method Ref: APHA (21st edition), 4500H:B

Expected Reading (pH Unit)	Displayed Reading (pH Unit)	Tolerance (pH unit)
4.0	4.0	0.00
7.0	7.1	+0.10
10.0	9.9	- 0.10
	Tolerance Limit (pH Unit)	±0.20

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008; Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
9.0	9.3	+0.3
24.0	24.5	+0.5
40.5	40.5	+0.0
	Tolerance Limit (°C)	±2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless

of equipment precision or significant figures.

Mr Chan Siu Ming, Vied Manager - Inorganics



ALS Technichem (HK) Ptv Ltd

11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung, N.T., Hong Kong T+852 2610 1044 E+852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR BEN TAM

ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING

ADDRESS:

CLIENT:

RM A 20/F., GOLD KING IND BLDG,

NO. 35-41 TAI LIN PAI ROAD.

KWAI CHUNG, N.T., HONG KONG WORK ORDER: HK1763026

SUB-BATCH:

HONG KONG

LABORATORY: DATE RECEIVED:

18/08/2017

DATE OF ISSUE:

28/08/2017

COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the ALS Hong Kong laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principals as practised by the ALS Hong Kong laboratory or quoted from relevant international standards.

Scope of Test:

Turbidity

Equipment Type:

Turbidimeter

Brand Name:

HACH

Model No.:

2100Q

Serial No.:

11030C008499

Equipment No.:

Date of Calibration: 24 August, 2017

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Manager - Inorganics

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

Work Order:

HK1763026

Sub-batch:

0

Date of Issue:

28/08/2017

Client:

ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING

Equipment Type:

Turbidimeter

Brand Name:

HACH

Model No.: Serial No.:

2100Q

Equipment No.:

11030C008499

Date of Calibration:

24 August, 2017

Date of next Calibration:

24 November, 2017

Parameters:

Turbidity

Method Ref: APHA 21st Fd. 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)	
0	0.76	₹ B	
4	4.09	+2.3	
40	42.0	+5.0	
80	82.7	+3.4	
400	391	- 2.3	
800	780	- 2.5	
	Tolerance Limit (%)	±10.0	

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Manager - Inorganics



Appendix G

Event and Action Plan



Event and Action Plan for Air Quality

Event	ET	IEC	ER	Action Contracto
Action Level				
Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily.	Check monitoring data submitted by ET; Check Contractor's working method.	Notify Contractor.	Rectify any unacceptable practice; Amend working methods if appropriate.
Exceedance for two or more consecutive samples	 Identify source; 	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Monitor the implementation of remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal appropriate.
Limit Level	1 Identify account	1 Charle manifesion date	1 Contra secript of	1 Teles immediate
Exceedance for one sample	investigate the causes of exceedance and propose remedial measures; 2. Inform ER, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.	Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Monitor theimplementation of remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal appropriate.
Exceedance for two or more consecutive samples		1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss amongst ER, ET, and Contractor on the polential remedial actions; 4. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented;	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not
	and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring.	the ER accordingly; 5. Monitor the implementation of remedial measures.	5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.



Event and Action Plan for Construction Noise

Event	ET	IEC	ER	Action Contractor
Action Level	1. Notify ER, IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, ER and Contractor; 4. Discuss with the IEC and Contractor on remedial measures required; 5. Increase monitoring frequency to check mitigation effectiveness.	1. Review the investigation results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly; 3. Advise the ER on the effectiveness of the proposed remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; Supervise the implementation of remedial measures.	Submit noise mitigation proposals to IEC and ER; Implement noise mitigation proposals.
Limit Level	1. Inform IEC, ER, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and ER on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring.	Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly.	1. Confirm receipt of notification of failure in writina: 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated.	1. Take immediate action to avoid further exceedance: 2. Submit proposals for remedial actions to IEC and ER within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the ER until the exceedance is abated.



Event and Action Plan for Water Quality

Action level	1. Repeat in-situ	1. Discuss with ET and	1. Discuss with IEC on	ACTION CONTRACTOR 1. Inform the ER and confirm
exceeded by one sampling day	measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC and Contractor; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC and Contractor; 6. Repeat measurement on next day of exceedance.	Contractor on the mitigation measures; 2. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; 3. Assess the effectiveness of the implemented mitigation measures	the proposed mitigation measures; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures	notification of the non- compliance in writing; 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Discuss with ET and IEC and propose mitigation measures to IEC and ER; 6. Implement the agreed mitigation measures.
Action Level being exceeded by more than two consecutive sampling days	1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC and Contractor; 4. Check monitoring data, all plant, equipment and Contractor's working methods mitigation measures with IEC and Contractor; 6. Ensure mitigation measures are implemented; 7. Prepare to increase the monitoring frequency to daily; 8. Repeat measurement on next day of	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures	Discuss with IEC on the proposed mitigation measures; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and ER within 2 working riese.
Limit Level being exceeded by one sampling day	exceedance. 1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC, Contractor and EPD; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, ER and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Chock all plant and equipment; Consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures.
Limit level being exceeded by more than one consecutive sampling days	Level. 1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC, Contractor and EPD; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, ER and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days.	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures.	1. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 2. Request Contractor to critically review the working methods; 3. Make agreement on the mitigation measures to be implemented; 4. Assess the effectiveness of the implemented mitigation measures; 5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit Level.	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures; As directed by the ER, to slow down or to stop all or part of the construction activities.



Appendix H

Impact Monitoring Schedule



Impact Monitoring Schedule for Reporting Period – October 2017

Sun		Date	Dust Mo	nitoring	Noise Manitoning	Water Quality
Mon		Date	1-hour TSP	24-hour TSP	Noise Monitoring	Water Quality
Tue 3-Oct-17						
The 3-0ct-17	Mon	2-Oct-17				
Thu S-Oct-17 AM7b & AM8 AM9b AM8 AM9b AM8 AM9b AM4b AM5 AM9b AM1b AM2 AM18 AM9b AM1b AM2 AM18 AM9b AM16 AM19 AM10 AM1	Tue	3-Oct-17				
Fri G-Oct-17	Wed	4-Oct-17				
Fri 6-Oct-17	Thu	5-Oct-17				
Sun 8-Oct-17 Sun 8-Oct-17 AM4b, AM5, AM6 NM3, NM4, NM5, AM7b & AM8 AM5, AM6, AM7b & AM8 AM7b, AM6, AM7b & AM8 AM6, AM7b	Fri	6-Oct-17		AM9b AM4b, AM5,		
Mon 9-Oct-17 Tue 10-Oct-17 AM4b, AM5, AM6 AM7b & AM8 AM7b, AM7b, AM7b & AM8 AM7b,		7-Oct-17				
Tue						
Number N	Mon	9-Oct-17				
Thu						
Thu 12-Oct-17	Wed	11-Oct-17				
Sat	Thu	12-Oct-17		AM9b AM4b, AM5,		All Water Quality Monitoring Locations
Sun 15-Oct-17 AM4b, AM5, AM6, AM7b & AM8 NM3, NM4, NM5, NM6 & NM7 Locations	Fri	13-Oct-17				
Mon	Sat	14-Oct-17				
Tue 17-Oct-17	Sun	15-Oct-17				
Wed 18-Oct-17	_	16-Oct-17				
Number N	Tue	17-Oct-17				
Sat 21-Oct-17 AM4b, AM5, AM6, AM7b & AM8 Sun 22-Oct-17 Mon 23-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 AM9b AM4b, AM8 AM6, AM7b & AM8 AM9b AM4b, AM8 AM6, AM7b & AM8	Wed	18-Oct-17		AM9b AM4b, AM5,		All Water Quality Monitoring Locations
Sat 21-Oct-17 AM4b, AM5, AM6, AM7b & AM8 Sun 22-Oct-17 Mon 23-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Tue 24-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 Wed 25-Oct-17 AM4b, AM5, AM6, AM7b & AM8 NM3, NM4, NM5, NM9 & NM10 Thu 26-Oct-17 AM4b, AM5, AM6, AM7b & AM8 NM3, NM4, NM5, NM6 & NM7 Locations Sat 28-Oct-17 Sun 29-Oct-17 Mon 30-Oct-17 AM1b, AM2, AM3 & AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 AM1b, AM2, AM3 & AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 Sat 28-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 Sat 28-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM1b, AM2, AM3 & AM9b AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM9b AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM9b AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM9b AM6, AM7b & AM8 Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM8b AM8b AM8b Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM8b AM8b AM8b Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM8b AM8b AM8b Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM8b AM8b AM8b AM8b Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM8b Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM8b AM8b AM8b Sat 28-Oct-17 AM1b, AM2, AM3 & AM8b AM8b AM8b AM8b AM8b AM8b AM8b AM8b AM8b Sat 28-Oct-17 AM2b, A	Thu	19-Oct-17				
Sat 21-Oct-17 AM7b & AM8 Sun 22-Oct-17 Mon 23-Oct-17 Tue 24-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Wed 25-Oct-17 Thu 26-Oct-17 Fri 27-Oct-17 AM4b, AM5, AM6, AM7b & AM8 NM3, NM4, NM5, AM7b & AM8 Sat 28-Oct-17 Sun 29-Oct-17 Mon 30-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Mon 30-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Mon 30-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 Mon	Fri	20-Oct-17				
Mon 23-Oct-17 AM1b, AM2, AM3 & AM9b AM6, AM7b & AM8 AM9b AM6, AM7b & AM8 AM9b AM1b, AM5, AM6, AM7b & AM8 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 AM8b AM8b	Sat					
Tue 24-Oct-17 AM1b, AM2, AM3 & AM9b AM6, AM7b & AM8 AM9b AM6, AM7b & AM8 AM9b AM6, AM7b & AM8 AM9b AM1b, AM5, AM6, AM7b & AM8 AM9b AM1b, AM5, AM6, AM7b & AM8 AM9b AM1b, AM5, AM6, AM7b & AM8 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 AM6, AM7b &	Sun	22-Oct-17				
Tue 24-Oct-17 AM1b, AM2, AM3 & AM9b AM9b AM9b AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 Wed 25-Oct-17 Bush 26-Oct-17 AM4b, AM5, AM6, AM7b & AM8 NM3, NM4, NM5, NM4, NM5, NM6 & NM7 All Water Quality Monitoring Locations Sat 28-Oct-17 NM6 & NM7 Locations Sun 29-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 All Water Quality Monitoring Locations	Mon	23-Oct-17				
Thu 26-Oct-17 Locations	Tue	24-Oct-17		AM9b AM4b, AM5,		
Fri 27-Oct-17 AM4b, AM5, AM6, AM7b & AM8 NM3, NM4, NM5, NM6 & NM7 All Water Quality Monitoring Locations Sat 28-Oct-17 Sun 29-Oct-17 Mon 30-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 All Water Quality Monitoring Locations	Wed	25-Oct-17				
Sat 28-Oct-17 AM7b & AM8 NM6 & NM7 Locations	Thu	26-Oct-17				
Sun 29-Oct-17 Mon 30-Oct-17 AM1b, AM2, AM3 & AM1b, AM2, AM3 & AM9b AM4b, AM5, AM6, AM7b & AM8 AM9b AM7b & AM8 NM1, NM2a, NM8, NM9 & NM10 Locations	Fri	27-Oct-17				
Mon 30-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, AM9 & AM9b AM4b, AM5, AM6, AM7b & AM8 NM10 Locations						
Mon 30-Oct-17 AM1b, AM2, AM3 & AM9b AM4b, AM5, NM9 & NM10 Locations	Sun	29-Oct-17				
	Mon	30-Oct-17		AM9b AM4b, AM5,		All Water Quality Monitoring Locations
	Tue	31-Oct-17				

Monitoring Day
Sunday or Public Holiday



Impact Monitoring Schedule for next Reporting Period – November 2017

	Date	Dust Mo	onitoring	Noise Monitoring	Water Quality
	Date	1-hour TSP	24-hour TSP	Noise Wontering	water Quanty
Wed	1-Nov-17				All Water Quality Monitoring Locations
Thu	2-Nov-17	AM4b, AM5, AM6, AM7b & AM8		NM3, NM4, NM5, NM6 & NM7	
Fri	3-Nov-17		AM1b, AM2, AM3 & AM9b		All Water Quality Monitoring Locations
Sat	4-Nov-17	AM1b, AM2, AM3 & AM9b	AM4b, AM5, AM6, AM7b & AM8		
Sun	5-Nov-17				
Mon	6-Nov-17				All Water Quality Monitoring Locations
Tue	7-Nov-17				
Wed	8-Nov-17	AM4b, AM5, AM6, AM7b & AM8		NM3, NM4, NM5, NM6 & NM7	All Water Quality Monitoring Locations
Thu	9-Nov-17		AM1b, AM2, AM3 & AM9b		
Fri	10-Nov-17	AM1b, AM2, AM3 & AM9b	AM4b, AM5, AM6, AM7b & AM8	NM1, NM2a, NM8, NM9 & NM10	All Water Quality Monitoring Locations
Sat	11-Nov-17				
Sun	12-Nov-17				
Mon	13-Nov-17				
Tue	14-Nov-17	AM4b, AM5, AM6, AM7b & AM8		NM3, NM4, NM5, NM6 & NM7	All Water Quality Monitoring Locations
Wed	15-Nov-17		AM1b, AM2, AM3 & AM9b		
Thu	16-Nov-17	AM1b, AM2, AM3 & AM9b	AM4b, AM5, AM6, AM7b & AM8	NM1, NM2a, NM8, NM9 & NM10	All Water Quality Monitoring Locations
Fri	17-Nov-17				
Sat	18-Nov-17				All Water Quality Monitoring Locations
Sun	19-Nov-17				
Mon	20-Nov-17	AM4b, AM5, AM6, AM7b & AM8		NM3, NM4, NM5, NM6 & NM7	All Water Quality Monitoring Locations
Tue	21-Nov-17		AM1b, AM2, AM3 & AM9b		
Wed	22-Nov-17	AM1b, AM2, AM3 & AM9b	AM4b, AM5, AM6, AM7b & AM8	NM1, NM2a, NM8, NM9 & NM10	All Water Quality Monitoring Locations
Thu	23-Nov-17				
Fri	24-Nov-17				All Water Quality Monitoring Locations
Sat	25-Nov-17	AM4b, AM5, AM6, AM7b & AM8			
Sun	26-Nov-17				
Mon	27-Nov-17		AM1b, AM2, AM3 & AM9b		
Tue	28-Nov-17	AM1b, AM2, AM3 & AM9b	AM4b, AM5, AM6, AM7b & AM8	NM1, NM2a, NM8, NM9 & NM10	All Water Quality Monitoring Locations
Wed	29-Nov-17				
Thu	30-Nov-17				All Water Quality Monitoring Locations

Monitoring Day
Sunday or Public Holiday



Appendix I

Database of Monitoring Result



24-hour TSP Monitoring Data

DATE	SAMPLE	EL	APSED TIM	ИE	CHAR	RT REA	ADING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER (WEIGHT	DUST WEIGHT COLLECTED	24-HR TSP
	NUMBER	INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)	$(\mu g/m^3)$
AM1b – O _l	oen Area, Tsi	ung Yuen H	Ia Village												
6-Oct-17	21674	13690.73	13714.89	1449.60	50	50	50.0	28.9	1013.1	1.68	2430	2.6101	2.8011	0.1910	79
12-Oct-17	21688	13714.89	13739.08	1451.40	50	50	50.0	29.5	1009.9	1.70	2469	2.6369	2.9637	0.3268	132
18-Oct-17	21696	13739.08	13763.20	1447.20	50	50	50.0	26.2	1013	1.71	2479	2.6347	2.8172	0.1825	74
24-Oct-17	21726	13763.20	13787.29	1445.40	50	50	50.0	24.4	1018.5	1.72	2490	2.6561	2.9960	0.3399	136
30-Oct-17	21756	13787.29	13811.18	1433.40	50	50	50.0	22.7	1020.9	1.73	2479	2.6554	2.8973	0.2419	98
AM2 - Villa	age House ne	ar Lin Ma	Hang Road												
6-Oct-17	21673	9187.91	9211.70	1427.40	32	32	32.0	28.9	1013.1	1.04	1489	2.6161	2.7542	0.1381	93
12-Oct-17	21689	9211.70	9235.46	1425.60	32	32	32.0	29.5	1009.9	1.02	1457	2.6446	2.8426	0.1980	136
18-Oct-17	21695	9235.46	9259.18	1423.20	46	46	46.0	26.2	1013	1.46	2082	2.6553	2.7889	0.1336	64
24-Oct-17	21727	9259.18	9282.96	1426.80	48	48	48.0	24.4	1018.5	1.53	2187	2.6376	2.9549	0.3173	145
30-Oct-17	21755	9282.96	9306.77	1428.60	48	48	48.0	22.7	1020.9	1.54	2199	2.6782	2.9761	0.2979	135
AM3 - Ta I	Kwu Ling Fir	e Service S	tation of Ta	Kwu Lin	g Villaş	ge									
6-Oct-17	21672	10316.26	10340.00	1424.40	36	36	36.0	28.9	1013.1	1.10	1569	2.6175	2.7802	0.1627	104
12-Oct-17	21690	10340.26	10364.30	1442.40	44	44	44.0	29.5	1009.9	1.31	1886	2.6355	2.8296	0.1941	103
18-Oct-17	21720	10364.30	10388.30	1440.00	48	50	49.0	26.2	1013	1.47	2116	2.6356	2.8652	0.2296	109
24-Oct-17	21728	10388.30	10412.31	1440.60	50	50	50.0	24.4	1018.5	1.51	2173	2.6252	2.8268	0.2016	93
30-Oct-17	21754	10412.31	10436.31	1440.00	50	50	50.0	22.7	1020.9	1.51	2181	2.6243	2.9338	0.3095	142
AM4b - Ho	use no. 10B1	Nga Yiu H	la Village				,					•			
6-Oct-17	21663	12320.67	12344.24	1414.20	40	40	40.0	28.9	1013.1	1.27	1797	2.6354	2.7489	0.1135	63
12-Oct-17	21670	12344.24	12368.29	1443.00	58	58	58.0	29.5	1009.9	1.79	2582	2.6288	2.7782	0.1494	58
18-Oct-17	21697	12368.29	12392.29	1440.00	56	56	56.0	26.2	1013	1.74	2499	2.6266	2.7855	0.1589	64
24-Oct-17	21725	12392.29	12416.29	1440.00	41	41	41.0	24.4	1018.5	1.23	1778	2.6303	2.6995	0.0692	39
30-Oct-17	21761	12416.29	12440.29	1440.00	41	41	41.0	22.7	1020.9	1.24	1786	2.6484	2.8074	0.1590	89
AM5a - Pin	g Yeung Vil	lage House					•								
6-Oct-17	21664	10167.51	10191.50	1439.40	48	48	48.0	28.9	1013.1	1.48	2126	2.6046	2.7245	0.1199	56
12-Oct-17	21669	10191.50	10215.56	1443.60	52	52	52.0	29.5	1009.9	1.58	2275	2.7072	3.0100	0.3028	133
18-Oct-17	21694	10215.56	10239.57	1440.60	50	50	50.0	26.2	1013	1.53	2198	2.6336	2.8426	0.2090	95
24-Oct-17	21724	10239.57	10263.57	1440.00	50	50	50.0	24.4	1018.5	1.53	2210	2.6223	2.8463	0.2240	101
30-Oct-17	21777	10263.57	10287.57	1440.00	53	53	53.0	22.7	1020.9	1.63	2353	2.6551	2.9203	0.2652	113
AM6 - Wo	Keng Shan V														
6-Oct-17	21678	8749.41	8773.41	1440.00	30	30	30.0	28.9	1013.1	0.87	1247	2.6293	2.7081	0.0788	63



DATE	SAMPLE	EL	APSED TIM	T E	CHAR	T REA	ADING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER (g		DUST WEIGHT COLLECTED	24-HR TSP
	NUMBER	INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)	$(\mu g/m^3)$
12-Oct-17	21668	8773.41	8797.43	1441.20	30	30	30.0	29.5	1009.9	0.95	1370	2.6270	2.8169	0.1899	139
18-Oct-17	21693	8797.43	8821.43	1440.00	40	40	40.0	26.2	1013.0	1.24	1787	2.6420	2.8733	0.2313	129
24-Oct-17	21721	8821.43	8845.43	1440.00	40	40	40.0	24.4	1018.5	1.25	1797	2.6415	2.8507	0.2092	116
30-Oct-17	21758	8845.43	8869.43	1440.00	40	40	40.0	22.7	1020.9	1.25	1803	2.6518	2.8400	0.1882	104
AM7b - Loi	Tung Villag	e House													
6-Oct-17	21677	17796.61	17820.61	1440.00	40	40	40.0	28.9	1013.1	1.12	1620	2.6322	2.7534	0.1212	75
12-Oct-17	31667	17820.61	17844.64	1441.80	36	36	36.0	29.5	1009.9	1.02	1477	2.6333	2.8397	0.2064	140
18-Oct-17	21692	17844.64	17868.64	1440.00	44	44	44.0	26.2	1013	1.26	1811	2.6237	2.7556	0.1319	73
24-Oct-17	21723	17868.64	17892.64	1440.00	44	44	44.0	24.4	1018.5	1.26	1821	2.6307	2.9073	0.2766	152
30-Oct-17	21759	17892.64	17916.64	1440.00	44	44	44.0	22.7	1020.9	1.27	1828	2.6385	2.9076	0.2691	147
AM8 - Po K	at Tsai Villa	ge No. 4													
6-Oct-17	21676	11693.23	11717.22	1439.40	34	34	34.0	28.9	1013.1	1.11	1602	2.6315	2.6589	0.0274	17
12-Oct-17	21666	11717.22	11741.26	1442.40	34	34	34.0	29.5	1009.9	1.09	1572	2.6354	2.6850	0.0496	32
18-Oct-17	21691	11741.26	11765.26	1440.00	28	28	28.0	26.2	1013	0.96	1380	2.6423	2.6758	0.0335	24
24-Oct-17	21722	11765.26	11789.68	1465.20	24	24	24.0	24.4	1018.5	0.87	1274	2.5976	2.6383	0.0407	32
30-Oct-17	21753	11789.68	11813.68	1440.00	33	33	33.0	22.7	1020.9	1.08	1555	2.6247	2.7575	0.1328	85
AM9b - Nai	m Wa Po Vil	lage House	No. 80												
6-Oct-17	21675	19072.50	19096.49	1439.40	30	30	30.0	28.9	1013.1	0.83	1190	2.5984	2.6281	0.0297	25
12-Oct-17	21665	19096.49	19120.53	1442.40	30	30	30.0	29.5	1009.9	1.00	1439	2.6353	2.7470	0.1117	78
18-Oct-17	21719	19120.53	19144.53	1440.00	30	30	30.0	26.2	1013	1.00	1446	2.6118	2.6820	0.0702	49
24-Oct-17	21752	19144.53	19168.54	1440.60	32	32	32.0	24.4	1018.5	1.07	1535	2.6314	2.7251	0.0937	61
30-Oct-17	21760	19168.54	19192.55	1440.60	38	38	38.0	22.7	1020.9	1.24	1787	2.6296	2.7340	0.1044	58



Construction Noise Monitoring Results, dB(A)

Date	Start Time	1 st Leq _{5mi}	L10	L90	2 nd Leq _{5min}	L10	L90	3 nd Leq _{5min}	L10	L90	4 th Leq _{5min}	L10	L90	5 th Leq _{5min}	L10	L90	6 th Leq _{5min}	L10	L90	Leq30	façade correction
NM1 - Tsung	Yuen	Ha Vill	age Hou	ıse No.	63																
6-Oct-17	10:17	56.8	58.6	54.1	57.8	59.8	55.0	58.3	60.5	55.1	58.3	60.0	54.4	58.3	8.00	54.5	58.7	61.5	55.1	58	NA
12-Oct-17	9:59	55.9	58.4	53.2	57.2	59.4	54.2	57.4	59.8	54.5	58.6	60.4	55.4	61.9	63.9	57.7	60.9	62.8	56.9	59	NA
18-Oct-17	9:45	56.7	58.6	53.7	56.1	57.7	53.5	55.9	57.8	53.6	60.1	63.1	54.4	57.3	59.7	53.2	56.6	58.7	53.7	57	NA
24-Oct-17	13:48	56.7	58.5	54.5	56.8	58.5	54.5	57.2	59.0	54.5	57.4	59.0	54.5	56.8	58.5	54.5	55.7	57.0	53.5	57	NA
30-Oct-17	9:13	56.3	58.0	52.5	57.0	58.5	52.0	54.0	56.0	51.0	59.6	62.5	51.0	63.6	66.8	59.7	58.7	62.9	53.2	59	NA
NM2a - Villa	ge Hou	ise near	· Lin Ma	a Hang	Road																
6-Oct-17	9:39	70.4	72.5	67.6	69.8	71.5	67.9	70.6	72.9	68.2	71.4	73.6	68.9	71.1	73.5	68.4	72.1	75.3	67.4	71	74
12-Oct-17	9:24	69.6	67.2	53.6	64.6	65.4	52.5	62.6	63.9	52.9	59.8	60.4	53.4	64.4	65.5	54.5	63.8	64.6	52.5	65	68
18-Oct-17	10:21	70.8	73.2	62.5	64.8	65.7	59.7	62.4	64.1	59.9	59.6	61.1	58.9	64.8	64.5	59.9	63.0	63.0	58.2	66	69
24-Oct-17	11:28	72.3	66.5	62.0	63.1	63.5	62.0	65.4	67.5	62.5	65.4	65.5	63.0	66.4	69.5	62.5	66.1	68.0	63.0	68	71
30-Oct-17	10:20	75.0	67.0	63.0	64.9	66.0	63.0	65.2	66.5	62.5	69.4	71.0	63.0	71.6	68.5	63.0	70.4	74.0	59.5	71	74
NM3 - Ping Y	eung V	Village 1	House																		
4-Oct-17	9:04	63.2	63.2	52.6	63.1	63.4	51.9	65.1	65.8	52.8	63.2	63.2	51.9	66.0	65.8	52.2	67.7	65.2	53.1	65	NA
10-Oct-17	10:06	64.7	69.2	55.0	58.3	61.1	53.4	59.9	62.5	54.8	57.9	59.5	53.2	56.6	57.4	53.5	57.9	58.5	54.7	60	NA
16-Oct-17	10:17	65.9	65.1	54.4	60.5	60.7	53.8	54.6	55.5	52.0	55.5	56.6	53.7	62.5	63.5	52.9	60.7	61.0	53.8	62	NA
27-Oct-17	10:22	58.8	61.5	53.4	59.2	62.7	54.8	57.5	59.8	53.5	59.6	61.7	53.9	60.6	62.0	53.5	58.7	60.8	53.7	59	NA
NM4 - Wo Ke	eng Sh	an Villa	ge Hou	se																	
4-Oct-17	9:39	61.9	60.4	54.3	64.4	63.3	53.7	60.8	59.2	53.1	61.5	60.9	53.8	62.9	62.0	54.7	61.3	60.7	53.9	62	NA
10-Oct-17	10:46	65.1	62.8	52.4	62.8	64.1	56.4	66.6	70.4	52.7	64.4	61.6	52.7	63.2	60.8	52.0	64.7	61.7	53.7	65	NA
	10:58	61.3	60.1	53.4	64.6	63.5	54.6	65.3	64.0	53.9	65.2	63.6	52.8	62.1	64.5	54.8	66.5	57.0	55.7	65	NA
27-Oct-17	11:08	62.2	63.7	56.1	61.3	60.6	54.7	64.2	63.9	54.7	60.4	60.8	52.0	65.5	64.9	52.6	65.0	62.5	51.5	64	NA
NM5- Ping Y	eung V	⁷ illage I	House																		
4-Oct-17	10:14	52.1	53.9	48.1	49.6	51.7	47.7	51.9	54.1	48.1	51.2	54.0	48.3	51.1	53.2	48.2	50.9	52.1	47.9	51	NA
10-Oct-17	11:23	55.4	56.9	52.5	50.6	53.1	45.9	50.8	53.0	47.2	49.2	52.7	44.3	50.3	53.7	45.2	51.6	54.1	46.2	52	NA
16-Oct-17	11:36	53.9	55.0	51.0	55.4	56.2	52.0	50.5	53.3	50.2	53.7	54.4	49.6	51.2	53.4	48.8	53.4	54.8	48.9	53	NA
27-Oct-17	9:30	52.4	54.3	49.9	53.1	56.8	50.7	52.6	55.4	47.6	48.4	55.3	45.1	50.6	56.7	46.4	49.6	56.5	47.8	51	NA
NM6 – Tai To	ng Wu	ı Village	e House	2																	
4-Oct-17	10:47	58.8	61.2	53.0	58.2	61.2	52.4	57.1	59.7	50.9	57.9	61.2	51.0	57.2	60.4	50.8	58.8	61.5	50.9	58	NA
10-Oct-17	14:26	59.1	62.6	53.2	58.7	61.9	52.2	58.1	61.5	52.7	59.5	62.0	53.6	58.2	60.3	52.0	57.3	59.4	51.0	59	NA
16-Oct-17	13:44	59.3	60.4	52.4	58.4	60.5	52.0	59.5	61.5	53.0	58.6	60.7	53.6	57.9	59.5	52.9	59.4	60.9	53.0	59	NA
27-Oct-17	10:16	58.4	62.6	53.9	57.6	61.7	52.4	59.9	63.7	54.6	56.2	59.4	51.6	55.3	58.4	51.6	57.4	60.9	52.5	58	NA



Date	Start Time	1 st Leq _{5mi}	L10	L90	2 nd Leq _{5min}	L10	L90	3 nd Leq _{5min}	L10	L90	4 th Leq _{5min}	L10	L90	5 th Leq _{5min}	L10	L90	6 th Leq _{5min}	L10	L90	Leq30	façade correction
NM7 – Po Ka	at Tsai	Village																			
4-Oct-17	13:00	68.9	70.2	54.4	69.0	63.0	54.3	60.0	61.6	54.7	59.2	60.1	54.7	59.9	60.5	54.2	60.5	61.5	55.2	65	NA
10-Oct-17	13:38	58.8	60.6	55.0	59.1	60.8	55.6	65.5	62.1	56.0	60.7	61.0	55.2	59.5	60.6	54.1	58.9	59.0	54.5	61	NA
16-Oct-17	14:25	58.8	59.4	54.1	65.2	62.9	55.8	60.8	60.5	55.0	58.7	58.9	54.6	59.3	59.5	54.0	58.6	59.5	55.6	61	NA
27-Oct-17	13:39	59.2	61.4	57.6	60.3	62.8	58.4	58.2	60.7	57.4	60.2	64.3	56.1	61.9	65.6	57.8	57.4	60.1	55.3	60	NA
NM8 - Villag	e Hous	se, Tong	Hang																		
6-Oct-17	10:51	59.8	65.4	50.8	58.4	63.8	50.9	59.8	64.7	51.8	60.8	66.5	52	58.9	63.2	51	61.5	67.2	52.2	60	NA
12-Oct-17	10:58	59.8	61	57.5	60.3	61.5	58.5	61.1	62.5	58	60.1	61.5	58	60.7	62.5	58.5	60.7	61.5	59	60	NA
18-Oct-17	11:19	59.1	60.5	57	58.4	60	56.5	58.7	60.5	56	60	61.5	57	59.5	61	56.5	59.4	60.5	57.5	59	NA
24-Oct-17	11:18	59.3	64.2	50	60.6	66.5	51.8	58.1	64.7	50	61.5	67.5	51	59.7	64.6	51.9	60.7	65.9	50.8	60	NA
30-Oct-17	11:29	62.5	63.5	61	63	64.5	61	62.9	63	61	62.5	63.5	61.5	63	64	62	62.8	63.5	61	63	NA
NM9 - Villag	e Hous	se, Kiu T	Γau Vill	lage																	
6-Oct-17	10:08	61.3	60.2	57.6	61.8	61.3	57.9	62.4	62.7	58.0	60.5	61.5	57.5	60.7	60.6	56.3	60.3	60.9	56.0	61	NA
12-Oct-17	10:07	66.4	68.0	64.0	66.4	68.0	64.5	66.9	69.0	64.5	66.8	68.0	65.0	67.2	69.0	65.0	66.9	68.5	65.0	67	NA
18-Oct-17	10:21	66.2	67.5	64.0	66.7	68.0	65.0	66.1	66.5	63.0	65.2	67.0	63.5	64.7	67.0	62.5	64.5	66.0	62.5	66	NA
24-Oct-17	10:36	62.6	65.2	59.2	61.1	64.6	59.5	62.3	65.9	59.2	61.3	64.5	58.9	60.0	63.9	58.8	61.4	64.8	58.0	62	NA
30-Oct-17	10:34	66.0	67.0	56.5	63.9	68.0	56.5	62.4	66.5	55.0	65.2	69.0	56.0	62.6	65.5	55.5	68.1	64.5	57.0	65	NA
NM10 - Nam	Wa Po	o Villag	e House	No. 80																	
6-Oct-17	9:22	60.9	62.2	59.5	59.5	61.7	58.0	61.6	62.5	60.6	61.9	62.2	59.0	60.5	61.6	58.0	62.7	62.5	59.2	61	64
12-Oct-17	9:15	65.7	67.5	63.0	66.2	68.5	62.0	65.2	66.5	63.0	66.0	67.5	64.0	66.3	68.0	64.0	66.3	68.0	64.0	66	69
18-Oct-17	9:29	62.2	63.5	57.5	60.0	62.0	57.5	59.8	61.5	57.5	62.1	65.5	57.5	66.6	68.0	63.5	65.8	67.0	64.0	64	67
24-Oct-17	9:50	61.5	62.5	59.8	59.6	61.6	57.4	60.9	62.8	59.8	61.9	62.6	58.7	61.5	61.8	57.6	60.5	60.8	56.5	61	64
30-Oct-17	9:43	62.4	63.0	61.0	66.1	70.0	61.0	62.5	63.0	60.5	62.6	63.5	60.0	61.9	63.0	60.0	70.0	73.5	63.0	65	68



Water Quality Monitoring Data for Contract 6 and SS C505

Date	3-Oct-17	-	-		-	•	=	•	•	-	•	•	•	-
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS	(mg/L)
WM1-C	0.27	0.27	29.6	20.6	4.86	4.0	63.8	64.4	18.4	10.0	8.5	0.5	8	9.0
W IVI I -C	9:27	0.37	29.6	29.6	4.91	4.9	64.9	64.4	19.3	18.9	8.5	8.5	8	8.0
3373.41	0.40	0.21	29.8	20.0	4.62	4.7	60.8	61.4	22.4	22.0	8.4	0.4	14	140
WM1	9:40	0.21	29.8	29.8	4.71	4./	61.9	61.4	23.1	22.8	8.4	8.4	14	14.0

Date	4-Oct-17#	-	·	-	-	•	•	•	-
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	pН	SS	(mg/L)
WM1 C	0.20	0.24				25.0 25.2		10	10.0
WM1-C	9:30	0.34				25.4		10	10.0
WM1	9:40	0.26				38.0		26	26.0
VV IVI I	9.40	0.20				38.7		26	20.0

Date	5-Oct-17	-	•		_	•	•		•	•	•	•	•	-
Location	Time	Depth (m)	Temp	o (oC)	DO (1	ng/L)	DO	(%)	Turbidi	ty (NTU)	p	Н	SS	(mg/L)
WM1-C	0.20	0.24	30.3	20.2	4.55	1.6	60.2	(0.2	23.6	22.0	8.4	0.4	12	11.5
W MIT-C	9:30	0.34	30.3	30.3	4.57	4.6	60.3	60.3	23.9	23.8	8.4	8.4	11	11.5
WM1	9:40	0.26	29.9	29.9	4.55	16	60.1	60.2	38.3	38.0	8.1	0 1	30	29.5
VV IVI I	9.40	0.26	29.9	29.9	4.57	4.6	60.3	00.2	37.6	36.0	8.1	0.1	29	29.3

Date	7-Oct-17													
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	p	H	SS	(mg/L)
WM1-C	0.41	0.31	29.4	29.4	4.4	4.4	57.6	58.3	23.6	24.2	8.5	0.5	18	17.0
W WIT-C	8:41	0.31	29.4	29.4	4.47	4.4	58.9	38.3	24.7	24.2	8.5	8.5	16	17.0
WM1	8:57	0.19	29	29.0	4.59	16	59.6	60.3	33.0	33.6	8.4	0.4	30	21.5
VV IVI I	8.37	0.19	29	29.0	4.67	4.6	60.9	00.5	34.1	33.0	8.4	8.4	33	31.3

Date	10-Oct-17	-	•		_	•	•		•	•	•	•	•	
Location	Time	Depth (m)	Temp	o (oC)	DO (1	ng/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS	(mg/L)
WM1 C	0.45	0.24	30.9	20.0	3.93	4.0	52.7	52.0	31.4	21 /	8.5	0.5	29	28.0
WM1-C	9:45	0.34	30.9	30.9	3.98	4.0	53.3	53.0	31.4	31.4	8.5	8.5	27	28.0
WM1	9:55	0.26	31.8	21.0	4.3	4.3	56.3	56.5	21.8	21.7	8	8.0	16	16.0
VV IVI I	9.55	0.26	31.8	31.6	4.3	4.3	56.7	30.3	21.6	21.7	8	8.0	16	10.0



Date	12-Oct-17													
Location	Time	Depth (m)	Temp	o(oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	H	SS	(mg/L)
WM1-C	9:35	0.34	31.4 31.4	31.4	3.89 3.94	3.9	52.2 52.7	52.5	25.7 25.7	25.7	8.4 8.4	8.4	23 22	22.5
WM1	9:45	0.25	28.6 28.6	28.6	4.42 4.38	4.4	58.1 57.8	58.0	19.9 18.3	19.1	8.2 8.2	8.2	15 14	14.5

Date	14-Oct-17					•						-		
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS	(mg/L)
WM1-C	0.47	0.20	22.3	22.2	4.92	4.0	57.1	50.0	29.1	29.4	8.5	0.5	26	25.0
W IVIT-C	8:47	0.29	22.3	22.3	4.97	4.9	58.9	58.0	29.7	29.4	8.5	8.5	24	25.0
WM1	9:11	0.19	23.5	23.5	4.7	4.7	55.5	55.8	21.0	21.4	8.6	9.6	17	16.5
VV IVI I	9.11	0.19	23.5	23.3	4.74	4.7	56.1	33.8	21.7	21.4	8.6	8.6	16	16.5

Date	16-Oct-17													
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	H	SS	(mg/L)
WM1 C	10.00	0.25	25.5	25.5	5.3	5.2	64.5	64.2	over	0110mm0m 00	8.6	0.6	1880	1070.0
WM1-C	10:00	0.35	25.5	23.3	5.28	3.3	64.0	64.3	range	overrange	8.6	8.6	2060	1970.0
WM1	10.10	0.28	24.8	24.8	5.45	5.5	65.8	66.1	1006.0	1007.0	8.3	0.2	833	813.0
VV IVI I	10:10	0.28	24.8	24.8	5.5	3.3	66.3	66.1	1008.0	1007.0	8.3	8.3	793	813.0

Date	18-Oct-17		_			•		•	_			_		
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	H	SS	(mg/L)
WM1 C	10.00	0.21	28.2	20.2	4.23	1.6	54.3	57.2	21.2	20.9	8.8	0.0	18	10.0
WM1-C	10:00	0.31	28.2	28.2	4.91	4.6	60.3	57.3	20.3	20.8	8.8	8.8	18	18.0
WM1	10:30	0.26	28.8	28.8	4.27	4.2	55.3	55.1	29.3	28.8	8.4	8.4	30	28.5
VV IVI I	10.30	0.20	28.8	20.0	4.23	4.3	54.9	33.1	28.3	20.0	8.4	0.4	27	28.3

Date	20-Oct-17	-	•				•					_		
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	H	SS	(mg/L)
WM1 C	0.45	0.24	26.2	26.2	5.34	5.2	65.7	64.0	22.9	22.2	8.5	0.5	22	22.0
WM1-C	9:45	0.34	26.2	26.2	5.21	3.3	64.0	64.9	23.7	23.3	8.5	8.5	22	22.0
3373.4.1	0.55	0.22	23	22.0	5.71	5 7	67.0	667	30.2	20.0	8.6	9.6	25	25.0
WM1	9:55	0.22	23	23.0	5.62	3.7	66.3	66.7	27.8	29.0	8.6	8.6	25	25.0



Date	23-Oct-17													
Location	Time	Depth (m)	Temp	o(oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	H	SS	(mg/L)
WM1-C	9:50	0.33	26.2	26.2	4.11	4.1	50.8	51.0	15.5	15.7	8.5	8.5	13	12.0
W WIT-C	9.30	0.33	26.2	20.2	4.14	4.1	51.1	31.0	15.8	13.7	8.5	8.3	11	12.0
WM1	10:00	0.20	25.6	25.6	4.71	4.7	57.2	57.5	23.7	22.5	8.3	8.3	20	20.0
WM1	10.00	0.20	25.6	23.0	4.77	4.7	57.8	31.3	23.2	23.5	8.3	0.3	20	20.0

Date	25-Oct-17	-	•		-	•	•		=	•	•	•	•	
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS	(mg/L)
WM1 C	0.45	0.24	22.4	22.4	8.49	0.4	97.7	07.1	25.3	25.2	8.2	0.2	23	22.0
WM1-C	9:45	0.34	22.4	22.4	8.37	8.4	96.5	97.1	25.3	25.3	8.2	8.2	21	22.0
W/M1	0.55	0.26	23.4	23.4	7.94	7.0	93.4	03.5	34.3	24.7	8	8.0	27	26.5
WM1	9:55	0.26	23.4	23.4	7.95	7.9	93.5	93.3	35.1	34.7	8	8.0	26	26.5

Date	27-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidi	ty (NTU)	p	H	SS	(mg/L)
WM1 C	0.50	0.24	20.6	20.6	6.81	6.0	75.8	75.0	24.2	22.6	8	9.0	20	20.5
WM1-C	9:50	0.34	20.6	20.6	6.82	6.8	75.9	75.9	22.9	23.6	8	8.0	21	20.5
WM1	10:00	0.22	22	22.0	7.65	7.7	87.5	87.6	24.0	24.2	8	8.0	20	20.5
VV IVI I	10.00	0.22	22	22.0	7.66	7.7	87.6	87.0	24.4	24.2	8	8.0	21	20.3

Date	30-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS	(mg/L)
WM1 C	12.52	0.21	22.9	22.0	8.41	0.4	97.7	07.0	16.0	16.1	8.1	0.1	14	12.0
WM1-C	13:53	0.31	22.9	22.9	8.42	8.4	98.1	97.9	16.1	16.1	8.1	8.1	12	13.0
WM1	13:40	0.24	23.7	22.7	8.11	8.1	95.9	96.3	17.5	17.6	8.1	0 1	13	13.0
VV IVI I	13.40	0.24	23.7	23.1	8.14	0.1	96.7	90.3	17.7	17.6	8.1	0.1	13	13.0

Remarks: **Additional water quality monitoring for the parameters with Action/Limit Level exceedance triggered only.



Water Quality Monitoring Data for Contract 2 and 3

Date	3-Oct-17		-					•				-		
Location	Time	Depth (m)	Temp	o (oC)	DO (1	ng/L)	DO	(%)	Turbid	ity (NTU)	р	Н	SS	(mg/L)
WM4-CA	11:33	0.18	28.3	28.3	6.37	6.4	82.0	83.2	8.5	8.6	8.6	8.6	<2	
W WI4-CA	11.33	0.18	28.3	28.3	6.41	0.4	84.3	83.2	8.6	8.0	8.6	8.0	<2	
WM4-CB	11:52	0.38	29.4	29.4	5.59	5.6	73.4	73.5	11.3	11 1	8.1	0 1	7	6.5
W M4-CB	11.32	0.38	29.4	29.4	5.6	5.6	73.5	13.3	10.8	11.1	8.1	0.1	6	6.5
3373.4.4	11.10	0.24	29.3	20.2	5.62	57	73.4	72.0	32.5	22.0	8.9	9.0	27	20.0
WM4	11:19	0.24	29.3	29.3	5.71	5.7	74.4	73.9	33.4	33.0	8.9	8.9	29	28.0

Date	5-Oct-17	-	•		-		•	•	-		•	3		
Location	Time	Depth (m)	Temp	o (oC)	DO (r	ng/L)	DO	(%)	Turbid	ity (NTU)	р	Н	SS	(mg/L)
WM4-CA	11:10	0.16	29.4	29.4	5.34	5.4	69.8	70.0	7.0	6.9	8.5	0.5	<2	~2
WM4-CA	11.10	0.16	29.4	29.4	5.36	5.4	70.1	70.0	6.7	6.8	8.5	8.5	<2	~2
WM4-CB	11:30	0.30	29.3	29.3	4.45	15	58.2	58.4	15.9	15.3	7.9	7.9	16	16.0
W M4-CB	11.30	0.30	29.3	29.3	4.47	4.5	58.5	38.4	14.7	13.3	7.9	7.9	16	16.0
3373.4.4	11.00	0.16	28.6	20.6	5.16	5.2	66.7	(()	15.9	15.0	8.7	8.7	19	10.0
WM4	11:00	0.16	28.6	28.6	5.18	5.2	67.0	66.9	15.7	15.8	8.7	8.7	19	19.0

Date	7-Oct-17				_		•	•			•	-	•	
Location	Time	Depth (m)	Temp	o (oC)	DO (1	ng/L)	DO	(%)	Turbid	ity (NTU)	р	Н	SS	(mg/L)
WM4-CA	11:37	0.22	28.2	28.2	5.79	5.8	74.3	74.7	3.4	2.5	9.3	0.2	4	1.5
WW4-CA	11.57	0.22	28.2	26.2	5.84	3.8	75.1	/4./	3.5	3.3	9.3	9.3	5	4.5
WM4-CB	11:59	0.38	28.7	28.7	4.38	4.4	56.7	57.1	10.5	11 1	8.2	0.2	13	12.5
WW4-CB	11.39	0.38	28.7	20.7	4.41	4.4	57.4	57.1	11.7	11.1	8.2	8.2	12	12.3
WM4	11.14	0.27	28.5	20.5	4.79	10	61.7	62.4	12.5	12.0	9	0.0	15	14.0
W W14	11:14	0.27	28.5	28.5	4.85	4.8	63.0	62.4	13.0	12.8	9	9.0	13	14.0

Date	10-Oct-17	•	•	-			-	٠	-	•	•	•	-	•
Location	Time	Depth (m)	Temp	o(oC)	DO (1	ng/L)	DO	(%)	Turbid	ity (NTU)	p	Н	SS	(mg/L)
WM4-CA	12:05	0.15	31	31.0	5.48	5.5	73.4	73.4	2.6	2.6	8.6	8.6	2	2.5
WW4-CA	12.03	0.15	31	31.0	5.48	3.3	73.4	/3.4	2.6	2.6	8.6	8.0	3	2.5
WM4-CB	12.15	0.21	30.9	30.9	4.55	1.6	61.1	(1.2	6.2	6.5	7.9	7.9	7	7.5
WW4-CB	12:15	0.31	30.9	30.9	4.56	4.6	61.2	61.2	6.8	6.5	7.9	7.9	8	7.5
3373.4.4	11.55	0.15	30.1	20.1	5.17	5.2	68.3	69.4	34.1	22.0	9	0.0	37	20.0
WM4	11:55	0.15	30.1	30.1	5.2	5.2	68.5	68.4	31.5	32.8	9	9.0	41	39.0



Date	12-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbid	ity (NTU)	p	H	SS	(mg/L)
WM4-CA	11:10	0.15	29.8	29.8	5.47	5.5	72.0	72.1	3.0	2.2	8.6	8.6	4	2.5
W M4-CA	11.10	0.13	29.8	29.8	5.48	3.3	72.1	/2.1	3.7	3.3	8.6	8.0	3	3.5
WM4-CB	11:20	0.30	30	30.0	4	4.0	52.3	52.4	5.7	5.4	7.9	7.9	6	5.0
WW4-CB	11.20	0.30	30	30.0	4.02	4.0	52.5	32.4	5.0	3.4	7.9	7.9	4	3.0
WM4	11:00	0.15	29.9	29.9	4.45	1.5	58.7	58.9	9.6	10.2	8.3	0.2	11	10.5
W W14	11.00	0.13	29.9	29.9	4.48	4.5	59.1	36.9	11.0	10.3	8.3	8.3	10	10.5

Date	14-Oct-17		-			•	-	•	-		•	•	-	
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbid	ity (NTU)	p	Н	SS	(mg/L)
WM4-CA	11.07	0.27	22.4	22.4	6.39	6.4	73.9	74.2	7.1	7.1	8.4	0.4	10	0.0
WW4-CA	11:27	0.27	22.3	22.4	6.47	6.4	74.7	74.3	7.1	7.1	8.4	8.4	8	9.0
WM4 CD	11.40	0.25	22.9	22.0	3.71	2.7	43.2	44.0	10.4	10.6	8.7	0.7	11	11.5
WM4-CB	11:49	0.35	22.9	22.9	3.77	3.7	44.8	44.0	10.7	10.6	8.7	8.7	12	11.5
WAA	11.04	0.20	23.5	22.5	4.98	5.0	58.2	59.0	34.7	24.0	8.1	0.1	32	21.5
WM4	11:04	0.29	23.5	23.5	4.97	5.0	57.7	58.0	35.1	34.9	8.1	8.1	31	31.5

Date	16-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbid	ity (NTU)	р	Н	SS	(mg/L)
WM4-CA	12:05	0.18	25.4	25.4	5.11	5 1	62.3	62.4	8.1	8.2	8.4	8.4	6	5.5
WW4-CA	12.03	0.18	25.4	23.4	5.12	3.1	62.4	02.4	8.2	0.2	8.4	0.4	5	3.3
WM4-CB	12:15	0.32	26.2	26.2	3.71	2.7	45.7	45.9	18.1	18.1	8	8.0	11	11.0
W WI4-CB	12.13	0.32	26.2	20.2	3.74	3.7	46.1	43.9	18.1	10.1	8	0.0	11	11.0
3373.44	11.55	0.16	25.8	25.0	4.93	4.0	60.1	50.0	128.0	120.5	8.4	0.4	74	77.0
WM4	11:55	0.16	25.8	25.8	4.88	4.9	59.7	59.9	133.0	130.5	8.4	8.4	80	77.0

Date	17-Oct-17#		•			•		•	<u>.</u>	
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbid	ity (NTU)	рН	SS	(mg/L)
WM4-CA	9:35	0.16				8.8	8.9		5	5.0
W WI4-CA	9.55	0.10				9.0	8.9		5	5.0
WM4-CB	9:43	0.31				9.8	9.9		6	6.0
WW4-CB	9.43	0.51				10.1	9.9		6	6.0
WM4	9:25	0.15				91.6	92.4		58	58.0
vv IVI4	9.23	0.13				93.2	92.4		58	38.0



Date	18-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbid	ity (NTU)	p	Н	SS	(mg/L)
WM4-CA	12:15	0.15	26.4	26.4	5.46	5.5	67.8	67.9	2.9	2.9	8.7	8.7	3	3.0
W M4-CA	12.13	0.13	26.4	20.4	5.47	3.3	67.9	07.9	2.9	2.9	8.7	0.7	3	3.0
WM4-CB	12:25	0.31	27.7	27.7	4.06	4.1	51.6	51.0	7.1	7.0	8	8.0	8	8.0
WW4-CB	12.23	0.51	27.7	21.1	4.08	4.1	51.9	51.8	7.0	7.0	8	0.0	8	8.0
WMA	12.00	0.15	27	27.0	5.14	5.2	64.3	615	14.3	14.2	9.5	0.5	16	16.5
WM4	12:08	0.15	27	27.0	5.17	5.2	64.6	64.5	14.2	14.3	9.5	9.5	17	16.5

Date	19-Oct-17#		-	-	<u> </u>	•		<u> </u>	-	
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbid	ity (NTU)	рН	SS	(mg/L)
WM4-CA	11:10	0.18				2.4	2.4		2	2.0
W M4-CA	11.10	0.18				2.4	2.4		2	2.0
WM4-CB	11:20	0.31				5.5	5 1		6	6.0
WM4-CB	11:20	0.31				4.6	3.1		6	6.0
WM4	11:00	0.15				10.2	9.8		15	15.0
W W14	11:00	0.13				9.5	9.8		15	15.0

Date	20-Oct-17													
Location	Time	Depth (m)	Temp	o (oC)	DO (r	ng/L)	DO	(%)	Turbid	ity (NTU)	р	H	SS	(mg/L)
WM4-CA	11:50	0.16	25.2	25.2	6.33	6.3	76.8	76.9	4.9	4.9	8.8	8.8	2	2.0
W WI4-CA	11.30	0.10	25.2	23.2	6.35	0.5	76.9	70.9	4.8	4.9	8.8	0.0	2	2.0
WM4-CB	12:00	0.18	26.3	26.3	5.16	5.2	64.2	64.1	6.0	5.9	8	8.0	5	5.5
WW4-CB	12.00	0.18	26.3	20.3	5.14	3.2	63.9	04.1	5.9	3.9	8	8.0	6	5.5
3373.4.4	11.40	0.15	25.6	25.6	5.61	5.6	68.3	69.2	27.8	27.0	8.4	0.4	27	26.5
WM4	11:40	0.15	25.6	25.6	5.59	5.6	68.1	68.2	26.1	27.0	8.4	8.4	26	26.5

Date	23-Oct-17		•		-		•	•	-		•	•	-	
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbid	ity (NTU)	р	Н	SS	(mg/L)
WM4-CA	11:25	0.16	23.6	23.6	6.69	6.7	78.4	43.3	3.2	2.4	8.8	8.8	<2	~ 2
W M4-CA	11.23	0.10	23.6	25.0	6.67	0.7	8.2	43.3	3.5	3.4	8.8	0.0	<2	~2
WM4-CB	11:30	0.31	24.6	24.6	5.19	5.2	61.8	62.0	6.8	6.6	8.2	8.2	7	7.0
WW4-CB	11.30	0.51	24.6	24.0	5.24	3.2	62.2	02.0	6.4	6.6	8.2	8.2	7	7.0
WM4	11:20	0.15	24.1	24.1	5.77	5 0	68.1	68.2	13.9	13.8	8.6	8.6	17	17.5
W W14	11.20	0.13	24.1	24.1	5.79	5.8	68.3	08.2	13.7	13.8	8.6	8.0	18	17.3



Date	25-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbid	ity (NTU)	p	Н	SS	(mg/L)
WM4-CA	11:50	0.18	25.1	25.1	8.81	8.8	106.7	106.7	1.1	1.2	9.49	0.5	<2	-2
W M4-CA	11.30	0.18	25.1	23.1	8.81	0.0	106.7	100.7	1.2	1.2	9.49	9.5	<2	<2
WM4-CB	12:00	0.22	26.4	26.4	7.14	7.1	88.8	88.8	5.7	5.7	8.66	8.7	6	6.0
W M4-CB	12.00	0.22	26.4	20.4	7.13	7.1	88.7	00.0	5.6	3.7	8.66	8.7	6	6.0
WM4	11.40	0.15	25.6	25.6	7.51	7.5	90.8	00.0	9.6	10.1	8.9	9.0	14	12.5
WM4	11:40	0.15	25.6	25.6	7.52	7.3	90.9	90.9	10.6	10.1	8.9	8.9	13	13.5

Date	27-Oct-17	-	-		_	•	•	•	-	•	•	-	-	
Location	Time	Depth (m)	Temp	o (oC)	DO (1	ng/L)	DO	(%)	Turbid	ity (NTU)	р	Н	SS	(mg/L)
WM4-CA	11.25	0.18	23.6	23.6	8.68	0.7	104.2	104.3	1.3	1.2	8.2	8.2	<2	-2
W WI4-CA	11:35	0.18	23.6	23.0	8.7	8.7	104.3	104.3	1.2	1.3	8.2	8.2	<2	<2
WM4-CB	11:45	0.30	25.9	25.9	6.88	6.9	84.7	010	7.7	7.8	7.7	7.7	11	11.5
WW4-CB	11.43	0.30	25.9	23.9	6.89	0.9	84.8	84.8	7.8	7.8	7.7	7.7	12	11.5
WM4	11:30	0.15	24.4	24.4	7.45	7.4	89.2	89.1	7.2	7.2	8.5	0.5	10	0.5
W IVI4	11.30	0.15	24.4	24.4	7.44	7.4	89.0	89.1	7.3	7.3	8.5	8.5	9	9.5

Date	30-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbid	ity (NTU)	p	H	SS((mg/L)
WM4-CA	11:49	0.11	23.9	23.9	8.47	8.5	100.6	100.8	4.7	4.7	8.2	8.2	<2	<2
W WI4-CA	11.49	0.11	23.8	23.9	8.51	8.3	100.9	100.8	4.7	4.7	8.2	8.2	<2	~2
WM4-CB	12:07	0.17	24.5	24.5	7.91	7.9	94.6	95.2	8.0	9.0	7.8	7.8	9	8.0
W M4-CB	12.07	0.17	24.5	24.3	7.95	7.9	95.7	93.2	8.0	8.0	7.8	7.8	7	8.0
3373.4.4	11.20	0.17	22.8	22.0	8.69	0.7	101.0	101.0	11.8	11.0	7.9	7.0	16	155
WM4	11:39	0.17	22.7	22.8	8.71	8.7	102.7	101.9	11.9	11.9	7.9	7.9	15	15.5

Remarks: **Additional water quality monitoring for the parameters with Action/Limit Level exceedance triggered only.

Action Level
Limit Level



Water Quality Monitoring Data for Contract 6

Date	3-Oct-17		-		_	•	•	•	•	•				
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidit	y (NTU)	p]	Н	SS(1	mg/L)
WM2A-C	10:07	0.33	28.7	28.7	4.66	4 7	60.3	61.2	6.9	6.9	8.40	8.4	<2	<2
VV 1V1271 C	10.07	0.55	28.7	20.7	4.71	7.7	62.1	01.2	7.0	0.5	8.40	0.1	<2	-,2
WM2A	9:54	0.21	28.8	28.8	4.79	4.8	62.0	61.5	14.1	14.8	8.40	8.4	5	5.5
WIVIZA	9.34	0.21	28.8	20.0	4.75	4.8	61.0	01.3	15.4	14.8	8.40	8.4	6	3.3

Date	4-Oct-17#													
Location	Time	Depth (m)	Temp	(oC)	DO (n	ng/L)	DO	(%)	Turbidit	y (NTU)	p]	Н	SS(1	ng/L)
WM2A-C	10:10	0.28							43.1	42.8			36	26.0
W WIZA-C	10.10	0.28							42.4	42.8			36	36.0
WM2A	0.55	0.20							15.6	15.6			6	6.0
W WIZA	9:55	0.20							15.5	15.6			6	6.0

Date	5-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidit	y (NTU)	p.	H	SS(mg/L)
WM2A C	10.10	0.28	29.4	29.4	4.25	4.2	55.7	56.5	53.0	50.7	8.30	0.2	34	25.0
WM2A-C	10:10	0.28	29.4	29.4	4.38	4.3	57.3	56.5	52.3	52.7	8.30	8.3	36	35.0
WM2A	9:55	0.20	30	30.0	4.47	1.5	59.1	59.3	15.6	15.6	8.40	8.4	7	7.0
vv ivI2A	9.33	0.20	30	30.0	4.5	4.5	59.5	39.3	15.6	13.0	8.40	0.4	7	7.0

Date	7-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidit	y (NTU)	p.	Н	SS(mg/L)
WM2A-C	0.40	0.21	26.3	26.3	5.2	5.3	64.2	64.0	6.9	7.0	8.50	0.5	3	2.0
W MZA-C	9:49	0.31	26.3	20.3	5.27	3.2	65.3	64.8	7.0	7.0	8.50	8.5	3	3.0
33/3/2/4	0.24	0.17	28.2	20.2	4.74	4.0	60.7	61.4	20.9	21.1	8.40	0.4	13	12.0
WM2A	9:24	0.17	28.1	28.2	4.81	4.8	62.1	61.4	21.3	21.1	8.40	8.4	11	12.0

Date	10-Oct-17	•							•		•			
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(1	mg/L)
WM2A-C	10.25	0.28	26.9	26.9	4.76	4.7	60.2	60.0	4.9	10	8.40	8.4	3	2.0
WIVIZA-C	10:35	0.28	26.9	20.9	4.72	4.7	59.8	00.0	4.7	4.8	8.40	0.4	3	3.0
33/3 AO A	10:05	0.20	31.1	21.1	4.38	4.4	57.6	57.9	11.3	11.2	8.20	0.2	4	4.0
WM2A	10:05	0.20	31.1	31.1	4.4	4.4	57.9	37.8	11.1	11.2	8.20	8.2	4	4.0

Date	12-Oct-17			<u> </u>	<u> </u>	<u> </u>	<u>-</u>	
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	pН	SS(mg/L)



WM2A-C	10:10	0.25	26.2 26.2	26.2	4.66 4.64	4.7	58.9 58.8	58.9	4.8 4.8	4.8	8.40 8.40	8.4	2 <2	2.0
WM2A	0.55	0.20	28.4	28.4	4.67	4.7	60.0	60.1	14.0	1.4.2	8.30	0.2	8	9.0
W WIZA	9:55	0.20	28.4	20.4	4.68	4./	60.1	00.1	14.5	14.3	8.30	8.3	8	8.0

Date	14-Oct-17	•				•		-	•	•		-	•	•
Location	Time	Depth (m)	Temp	o (oC)	DO (1	mg/L)	DO	(%)	Turbidit	y (NTU)	p.	Н	SS(mg/L)
WM2A-C	9:30	0.31	22.5 22.5	22.5	5.54 5.67	5.6	63.3 64.9	64.1	6.3	6.3	8.50 8.50	8.5	<2 <2	<2
WM2A	9:44	0.14	24 24.1	24.1	4.85 4.89	4.9	57.4 58.8	58.1	8.5 8.6	8.5	8.50 8.50	8.5	4	4.0

Date	16-Oct-17	•				٠		-	•	•		-	•	
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidit	y (NTU)	p.	Н	SS(mg/L)
WM2A-C	10:45	0.30	24.9	24.9	5.41	5.1	65.5	65.6	84.6	84.0	8.50	0.5	60	61.0
WWZA-C	10.43	0.30	24.9	24.9	5.42	5.4	65.7	03.0	83.4	84.0	8.50	8.5	62	61.0
WM2A	10:20	0.21	24.2	24.2	5.25	5.2	62.7	62.8	468.0	465.5	8.50	8.5	329	329.0
WIVIZA	10.20	0.21	24.2	24.2	5.26	3.3	62.8	02.8	463.0	405.5	8.50	8.3	329	329.0

Date	17-Oct-17#					•		-		-		-	•	-
Location	Time	Depth (m)	Temp ((oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	p]	Н	SS(mg/L)
WM2A-C	10:35	0.28		=					5.7 5.6	5.7			2 2	2.0
WM2A	10:20	0.20		-					72.8 66.4	69.6			37 37	37.0

Date	18-Oct-17	•				•	3	-	•	•			•	-
Location	Time	Depth (m)	Temp	(oC)	DO (1	mg/L)	DO	(%)	Turbidit	y (NTU)	p.	H	SS(mg/L)
WM2A-C	11:20	0.28	26	26.0	4.75	4.7	58.5	58.5	3.7	3.5	8.40	8.4	3	3.0
			26 25.6		4.74 5.18		58.4 63.3		32.6		8.40 8.20		31	
WM2A	11:10	0.20	25.6	25.6	5.16	5.2	63.6	63.5	31.6	32.1	8.20	8.2	33	32.0

Date	19-Oct-17#								
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	pН	SS(1	mg/L)
WM2A-C	10:15	0.28				3.3 3.1 3.2		4	4.0
WM2A	10:00	0.20				22.3 22.0		20	20.0



_				_									_	
									21.7				20	
D-4-	20.0-4.17				_	•	-	-	-	-	-			
Date	20-Oct-17	D 4 ()	TD.	(0)	DO /	/T)	DO	(0/)	TD 1:1:	() I/DI I)			gg/	/T \
Location	Time	Depth (m)	Temp	(oC)		mg/L)		(%)		y (NTU)		H	1	ng/L)
WM2A-C	10:20	0.28	22.3 22.3	22.3	5.86 5.85	5.9	67.3 67.2	67.3	3.9	3.7	8.50 8.50	8.5	<2 <2	<2
WM2A	10:05	0.20	23 23	23.0	5.54 5.55	5.5	64.6 64.7	64.7	12.2 12.5	12.4	8.40 8.40	8.4	13 12	12.5
Date	23-Oct-17				_		-	-		-	•	-		
Location	Time	Depth (m)	Temp	(oC)	DO (mg/L)	DO	(%)	Turhidit	y (NTU)	n	Н	SS(r	ng/L)
WM2A-C	10:35	0.28	22.5 22.5	22.5	5.34	5.4	61.4 61.9	61.7	3.6 3.3	3.4	8.50 8.50	8.5	<2 <2 <2	<2
WM2A	10:10	0.20	24.4 24.4	24.4	4.81	4.8	57.6 57.3	57.5	7.9 8.5	8.2	8.60 8.60	8.6	5 6	5.5
Date	25-Oct-17						-	-						
Location	Time	Depth (m)	Temp	o (oC)	DO (mg/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(r	ng/L)
WM2A-C	10:35	0.28	22.8 22.8	22.8	8.6 8.63	8.6	99.1 99.4	99.3	4.4 4.4	4.4	8.00 8.00	8.0	<2 <2	<2
WM2A	10:15	0.20	23.2	23.2	7.57 7.59	7.6	89.0 89.3	89.2	19.0	19.6	8.10 8.10	8.1	12 12	12.0
Date	27-Oct-17			-	-		-	-	•	-	•	-		
Location	Time	Depth (m)	Tomn	o (oC)	DO (mg/L)	DO	(%)	Turbidit	y (NTU)	n	H	SS(1	ng/L)
WM2A-C	10:25	0.28	21 21	21.0	7.38 7.37	7.4	82.7 82.6	82.7	3.8 3.8	3.8	7.90 7.90	7.9	<2 <2 <2	<2
WM2A	10:10	0.20	22.2 22.2	22.2	7.14 7.16	7.2	82.0 82.3	82.2	8.7 8.7	8.7	7.90 7.90 7.90	7.9	4 4	4.0
Data	30-Oct-17				•	•	•		•				•	
Date		Donth (m)	Temp	(oC)	DO /	ma/L)	DO	(0/.)	Tunkidia	w (NITII)		ii	00/-	ma/L)
Location WM2A-C	Time 13:01	Depth (m) 0.21	21.5	21.5	8.39	mg/L) 8.4	95.0	95.6	7.8	y (NTU) 7.8	8.00	H 8.0	<2	mg/L) <2
WM2A	13:19	0.17	21.5 22.9	22.9	8.41 7.5	7.5	96.1 87.2	87.6	7.8 6.1	6.1	8.00 8.00	8.0	<2 3	3.5
emarks:		al water qualit	22.9 v monitorin		7.52 trameters w		87.9 imit Level e		6.2 triggered on		8.00	0.0	4	3.3

 $Z:\label{loop} Z:\label{loop} Z:\label{loop} Z:\label{loop} A \ Report\ \ EM\&A \ Report\ \ \ (October\ 2017)\ \ \ R1307v2.docx$

Action Level Limit Level



Water Quality Monitoring Data for Contract 2 and 6

Date	3-Oct-17				-		•		•	•		•	•	3
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(n	ng/L)
WM3-C	10.27	0.17	28.9	28.9	5.26	5.2	68.4	69.2	10.8	10.8	11.2	11.2	18	17.0
W IVI3-C	10:27	0.17	28.9	28.9	5.31	3.3	69.9	09.2	10.8	10.8	11.2	11.2	16	17.0
WM3	10:41	0.19	29.8	29.8	4.81	4.9	63.4	64.2	9.7	9.8	9.7	0.7	4	5.0
W IVI3	10.41	0.19	29.8	29.8	4.91	4.9	65.0	04.2	9.9	9.8	9.7	9.7	6	3.0

Date	5-Oct-17	•					•					•	•	
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(n	ng/L)
WM3-C	10.25	0.15	29	29.0	4.61	1.6	60.0	<i>(</i> 0.1	8.2	0.4	11	11.0	6	6.0
W W13-C	10:25	0.15	29	29.0	4.63	4.6	60.2	60.1	8.5	8.4	11	11.0	6	6.0
WM3	10.25	0.15	28.8	28.8	4.77	4.8	61.8	62.4	8.0	7.0	9.1	0.1	7	8.0
VV 1V1.5	10:35	0.13	28.8	20.0	4.86	4.0	62.9	02.4	7.6	7.8	9.1	9.1	9	0.0

Date	7-Oct-17	•				3	•		•	•	3	•	3	
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(n	ng/L)
WM3-C	10.17	0.10	27.6	27.7	5.22	5.2	66.1	67.0	7.3	7.4	11.3	11.2	11	11.0
W M3-C	10:17	0.19	27.7	21.1	5.31	3.3	67.9	67.0	7.4	7.4	11.3	11.3	11	11.0
WM3	10:31	0.15	28	28.0	5.32	5.1	67.8	68.5	12.3	12.6	10	10.0	6	6.0
VV IVI3	10.51	0.13	28	20.0	5.41	5.4	69.1	00.3	12.9	12.0	10	10.0	6	0.0

Date	10-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(n	ng/L)
WM2 C	11.17	0.15	29.3	29.3	4.82	4.7	62.9	(2.0	15.8	17.4	11.4	11 /	24	25.5
WM3-C	11:17	0.15	29.3	29.3	4.48	4.7	63.0	63.0	19.0	17.4	11.4	11.4	27	25.5
WM3	11:25	0.15	29.6	29.6	4.72	47	61.9	62.0	3.7	2.7	10.4	10.4	8	9.0
VV IVI3	11.23	0.13	29.6	29.0	4.72	4.7	62.1	02.0	3.8	3.7	10.4	10.4	10	9.0

Date	12-Oct-17	•	•		_	-	•	-	-	•	-	•	•	
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	p]	Н	SS(n	ng/L)
WM3-C	10:25	0.15	29.8 29.8	29.8	4.7 4.78	4.7	61.8 62.7	62.3	11.7 9.9	10.8	11.4 11.4	11.4	32 31	31.5
WM3	10:35	0.15	29.1 29.1	29.1	4.81 4.78	4.8	62.5 62.2	62.4	3.6 3.3	3.4	10.3 10.3	10.3	3 3	3.0



Date	14-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(n	ng/L)
WM2 C	10.11	0.20	24.2	24.2	5.87	5.0	69.7	70.0	4.2	4.2	8.7	0.7	7	9.0
WM3-C	10:11	0.20	24.1	24.2	5.91	5.9	70.3	/0.0	4.3	4.2	8.7	8.7	9	8.0
W/M2	10:30	0.17	24.3	24.3	5.21	5.2	61.7	62.1	5.6	5.7	8.8	8.8	4	4.0
WM3	10.30	0.17	24.3	24.3	5.3	3.3	62.4	02.1	5.7	3.7	8.8	0.0	4	4.0

Date	16-Oct-17	•					•		•	•		•	•	
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(n	ng/L)
WM3-C	11:05	0.15	25.1	25.1	5.16	5.2	62.6	62.9	20.0	19.8	9.3	0.3	29	28.5
W W13-C	11.03	0.15	25.1	23.1	5.21	3.2	63.1	02.9	19.5	19.8	9.3	9.3	28	28.3
WM3	11:15	0.15	25.2	25.2	4.63	4.6	56.3	56.5	22.5	22.8	8.5	8.5	24	25.0
VV 1V13	11.13	0.13	25.2	23.2	4.66	4.0	56.7	30.3	23.0	22.8	8.5	0.3	26	23.0

Date	18-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(n	ng/L)
WM3-C	11.20	0.15	27.2	27.2	5.1	5 1	63.9	64.0	3.8	2.7	11.3	11.2	9	10.0
W W13-C	11:38	0.15	27.2	21.2	5.11	3.1	64.0	04.0	3.6	3.7	11.3	11.3	11	10.0
WM3	11:43	0.15	27.1	27.1	4.8	1.0	60.6	60.6	3.7	2.6	10	10.0	4	2.5
VV IVI 3	11.43	0.13	27.1	27.1	4.79	4.8	60.6	00.0	3.5	3.6	10	10.0	3	3.3

Date	20-Oct-17	•	-		_	-	•		-	•	-	•	•	
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(n	ng/L)
WM2 C	10.45	0.15	26.4	26.4	5.36	5.4	66.4	66.1	6.7	6.1	10.2	10.2	23	22.0
WM3-C	10:45	0.15	26.4	26.4	5.35	5.4	66.3	66.4	5.6	6.1	10.2	10.2	23	23.0
WM3	11:00	0.15	28.2	28.2	4.07	4.1	52.3	52.4	3.0	2.9	11.2	11.2	6	6.0
VV IVI 3	11.00	0.15	28.2	20.2	4.07	4.1	52.4	52.4	2.8	2.9	11.2	11.2	6	0.0

Date	23-Oct-17	•	-		_	3	•		•	•	-	•	<u>-</u>	
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	р	H	SS(n	ng/L)
WM2 C	10.50	0.15	23.9	22.0	5.42	5 A	64.0	(2.0	24.0	24.0	11.3	11.3	26	25.0
WM3-C	10:50	0.15	23.9	23.9	5.41	5.4	63.8	63.9	25.8	24.9	11.3	11.3	24	25.0
33/3/2	11.00	0.15	25.3	25.2	5.23	5.2	63.5	(2.6	5.7	<i>F</i> 0	9.8	0.0	8	7.0
WM3	11:00	0.15	25.3	25.3	5.24	5.2	63.7	63.6	6.0	5.8	9.8	9.8	6	7.0



Date	25-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	p.	Н	SS(n	ng/L)
WM3-C	11:00	0.15	25.7	25.7	8.38	8.4	102.7	102.6	2.6	2.4	11.6	11.6	7	5.5
W W13-C	11.00	0.15	25.7	23.1	8.36	0.4	102.5	102.0	2.2	2.4	11.6	11.0	4	3.3
WM3	11:15	0.15	24.8	24.8	8.24	0.2	100.3	100.4	4.5	1.6	10.8	10.8	4	1.5
W IV13	11.13	0.13	24.8	24.8	8.25	8.2	100.4	100.4	4.6	4.6	10.8	10.8	5	4.5

Date	27-Oct-17	•	•		_		•		•	•	-	•	-	5'
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(n	ng/L)
WM3-C	10:40	0.15	25.1	25.1	7.13	7.1	87.3	87.3	2.8	2.9	11	11.0	4	4.0
W W13-C	10.40	0.13	25.1	23.1	7.14	7.1	87.3	87.3	2.9	2.9	11	11.0	4	4.0
WM3	10:55	0.15	23.5	23.5	7.15	7.2	84.2	84.3	2.3	2.2	9.4	9.4	4	3.5
VV 1V13	10.55	0.13	23.5	23.3	7.17	1.2	84.4	04.3	2.0	2.2	9.4	9.4	3	3.3

Date	30-Oct-17													
Location	Time	Depth (m)	Temp	(oC)	DO (1	ng/L)	DO	(%)	Turbidit	y (NTU)	p.	Н	SS(n	ng/L)
WM3-C	10:48	0.21	29.9	29.9	8.98	8.9	108.1	108.9	10.7	10.7	7.5	7.5	12	13.0
W W13-C	10.48	0.21	29.9	29.9	8.91	8.9	109.7	108.9	10.6	10.7	7.5	7.3	14	13.0
WM3	11:03	0.17	23	23.0	8.78	0 0	102.2	102.5	11.1	11.1	7.7	77	10	9.5
VV 1V13	11.03	0.17	23	23.0	8.79	8.8	102.7	102.3	11.1	11.1	7.7	7.7	9	9.3


Remarks: **Additional water quality monitoring for the parameters with Action/Limit Level exceedance triggered only.


Action Level
Limit Level


Appendix J


Graphical Plots for Monitoring Result


Air Quality - 1-hour TSP

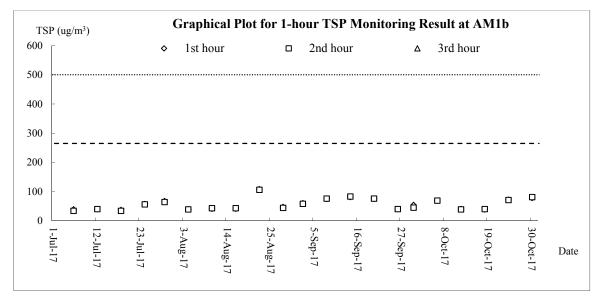


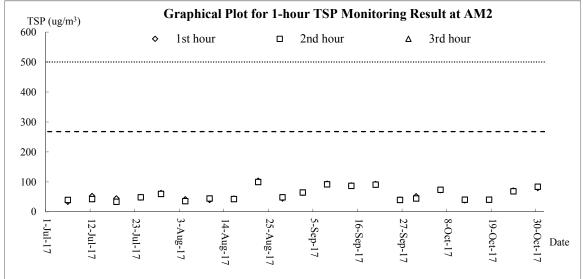


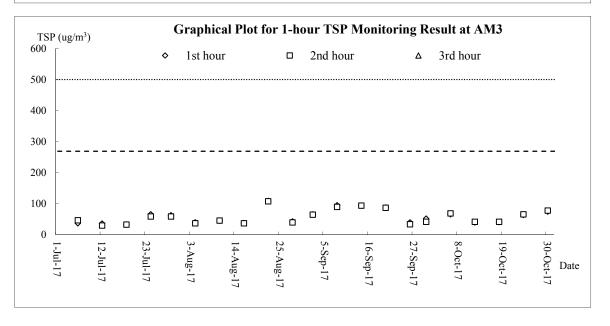


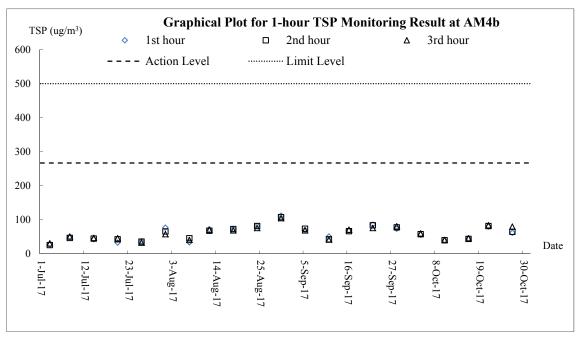


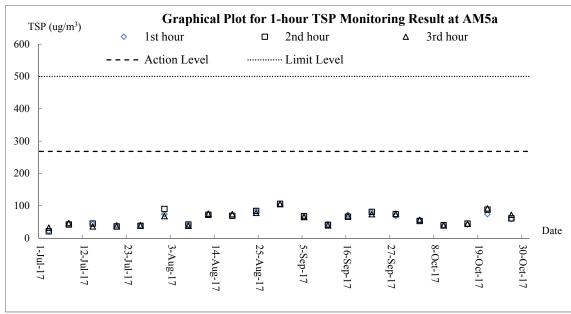

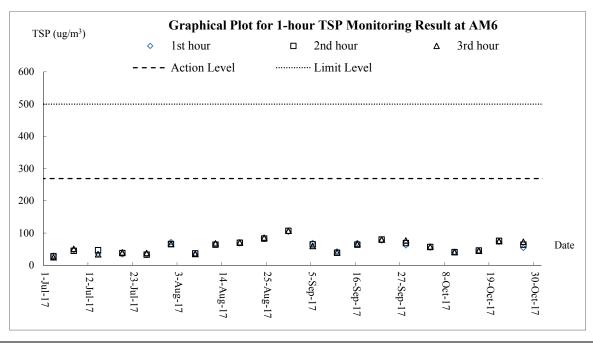


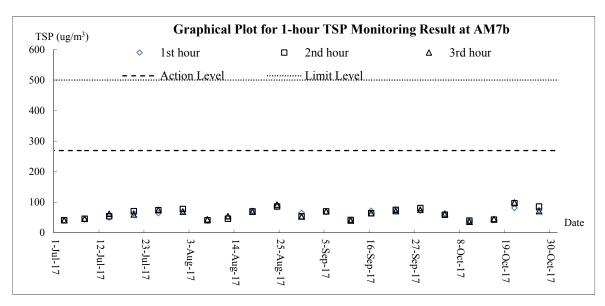


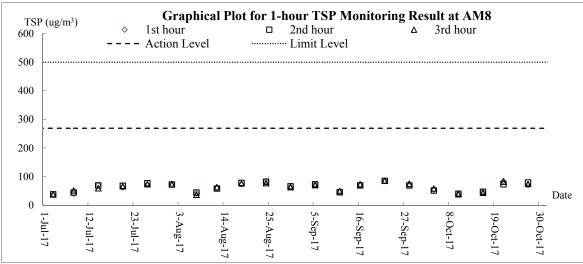


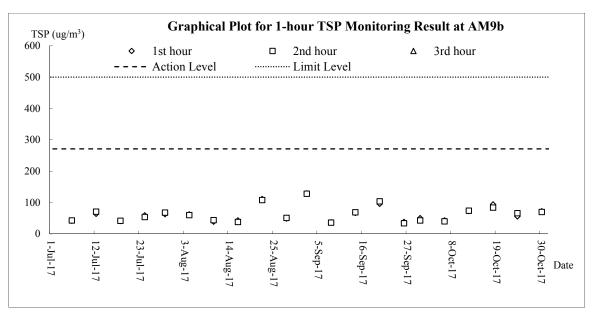



Air Quality – 24-hour TSP

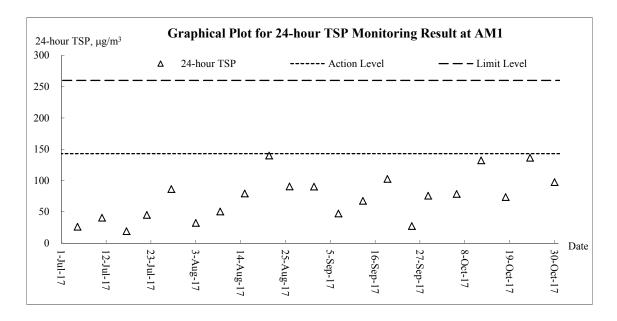


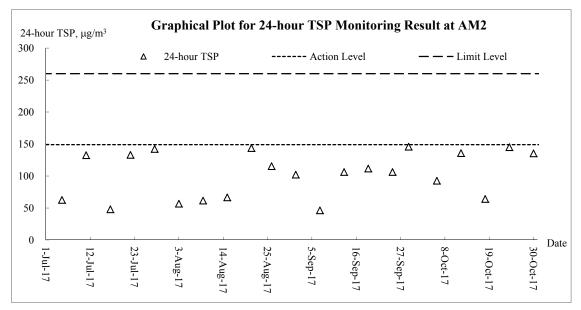


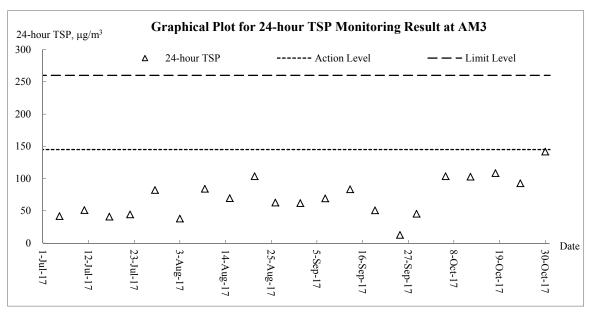


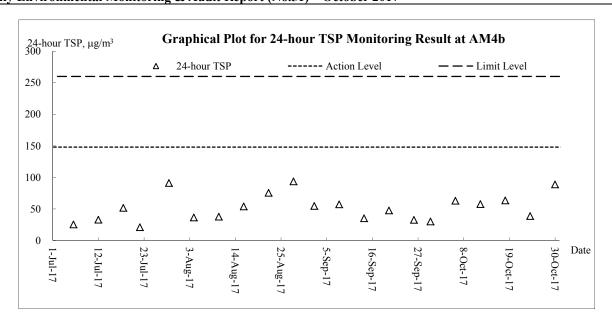


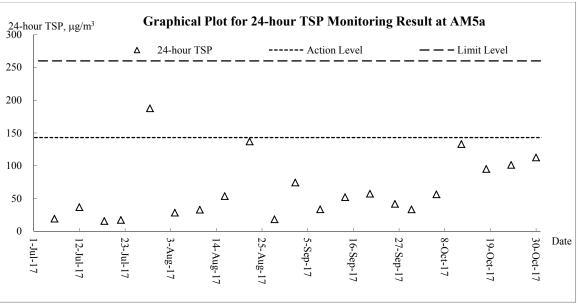

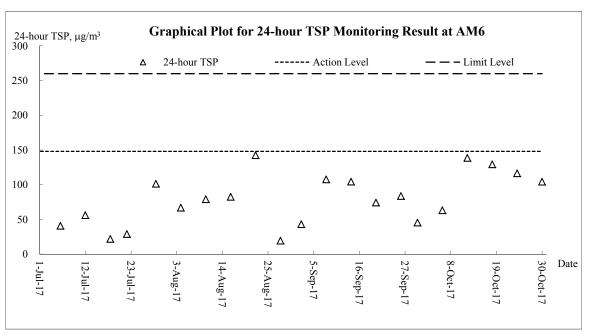


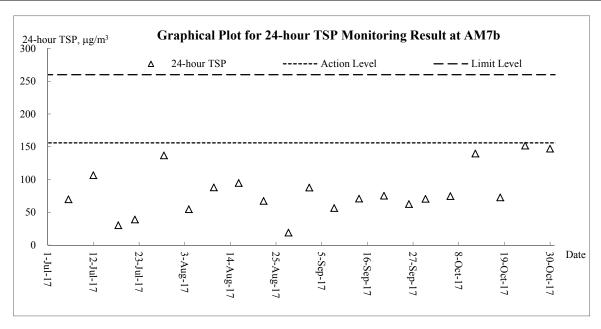


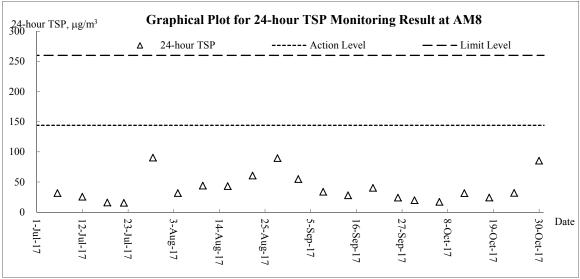


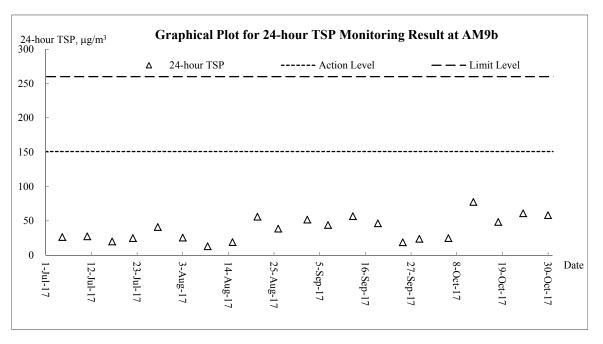



Noise

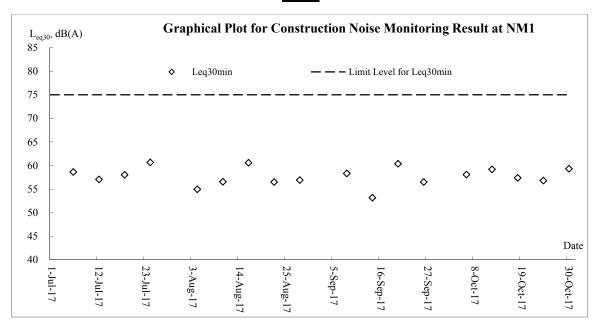


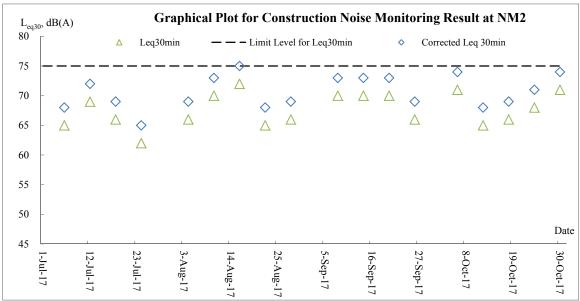


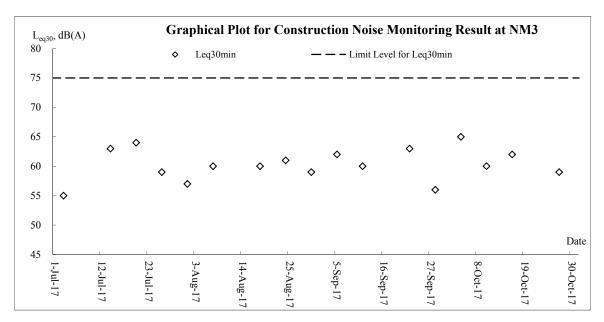


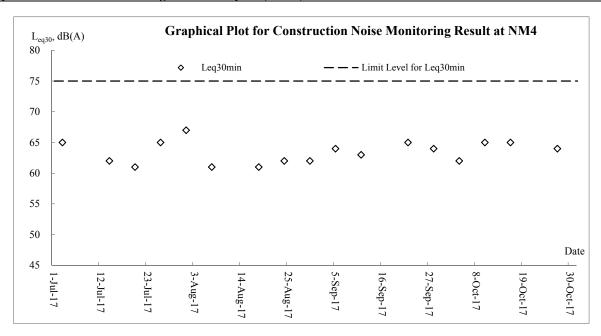


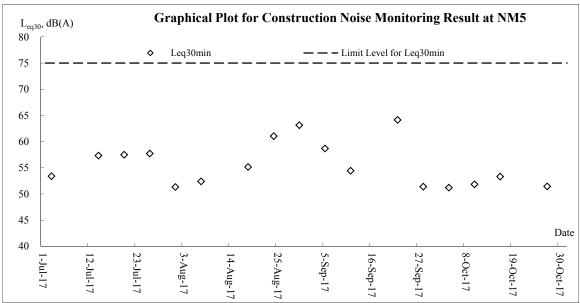


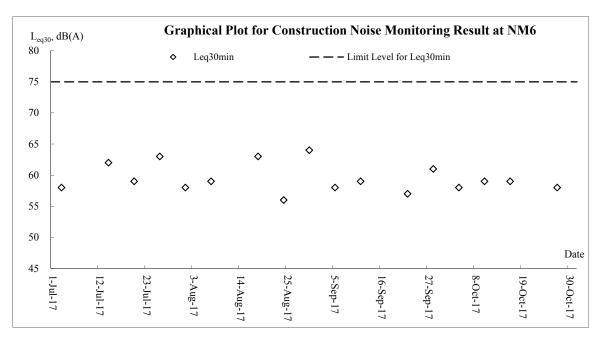

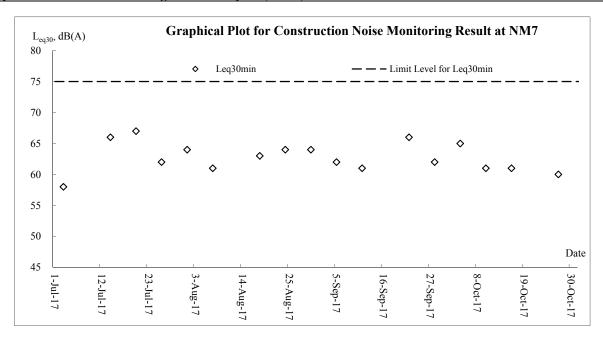


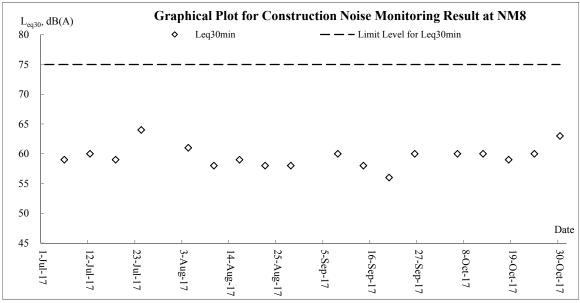


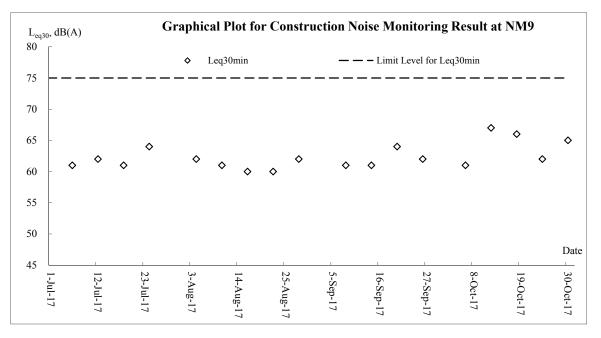


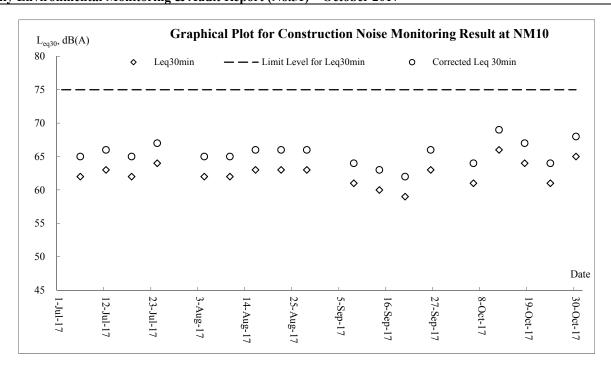



Water Quality

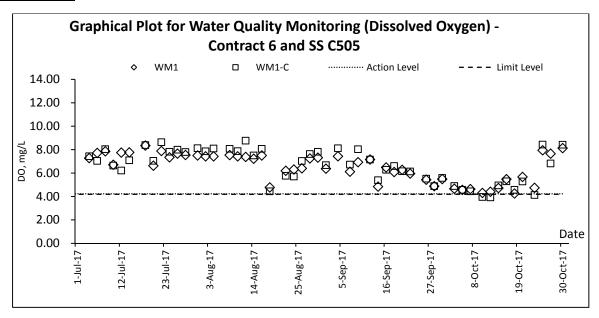


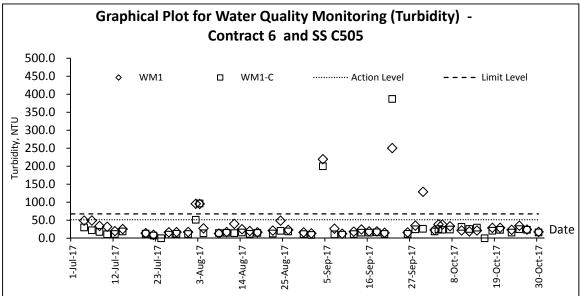


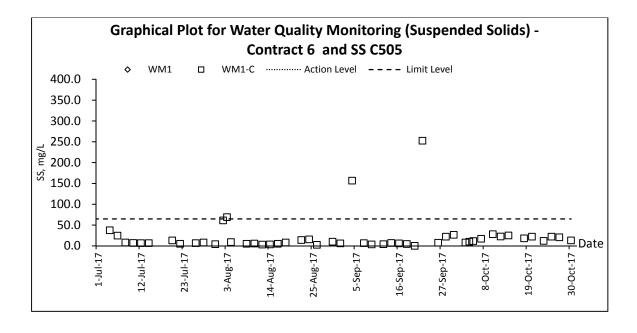


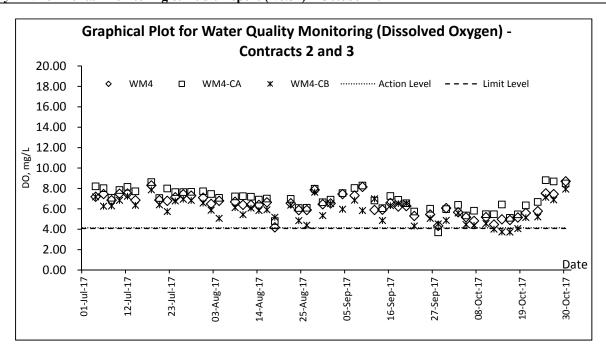


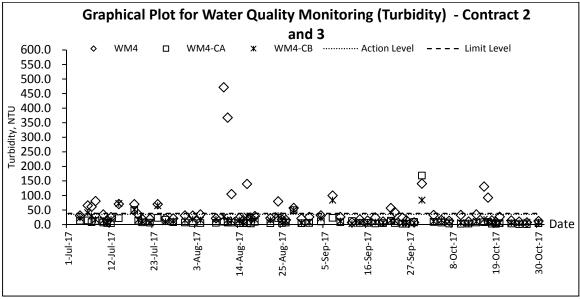


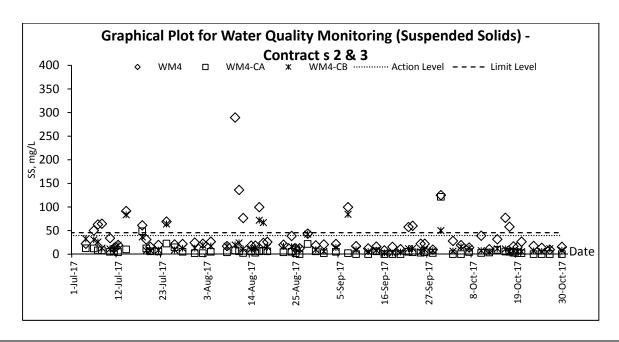


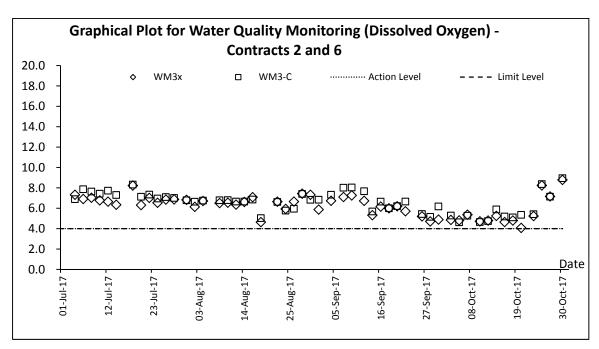


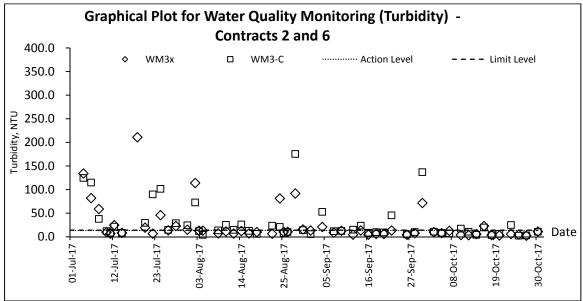

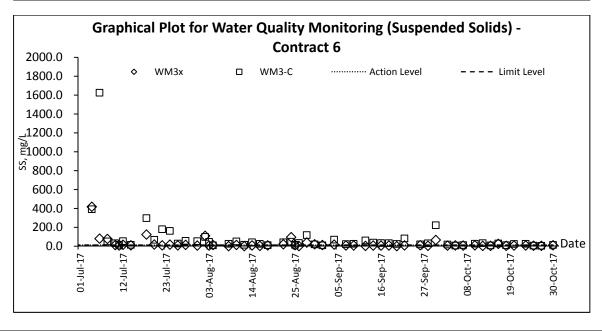

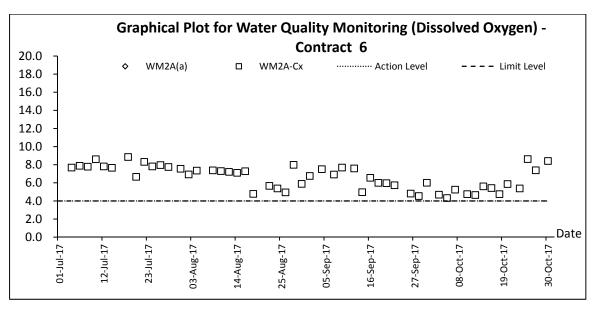

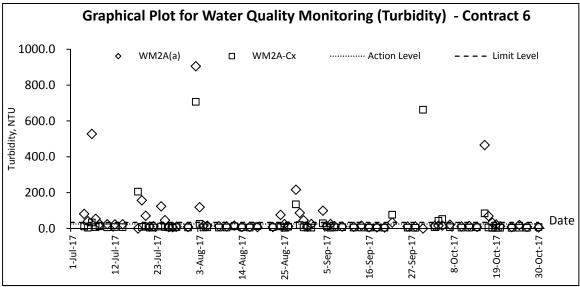

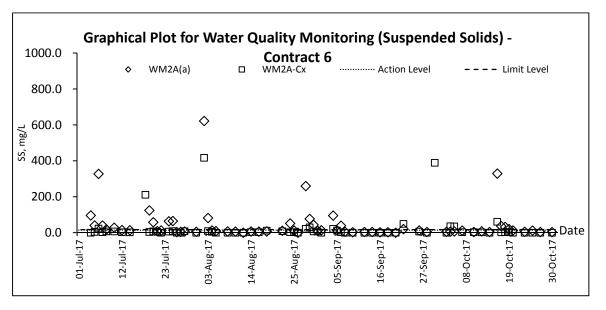

Appendix K

Meteorological Data

				r	Ta Kwu i	Ling Station	1
Date		Weather	Total Rainfall (mm)	Mean Air Temp. (°C)	Wind Speed (km/h)	Mean Relative Humidity (%)	Wind Direction
1-Oct-17	Sun	Mainly cloudy with a few showers.	6.6	28.2	5.9	75.9	E/SE
2-Oct-17	Mon	Moderate to fresh easterly winds	3.6	29.4	5	82.5	E/NE
3-Oct-17	Tue	Mainly cloudy with a few showers.	0	30.3	6.1	73	E/NE
4-Oct-17	Wed	Moderate east to northeasterly winds	9.5	28.5	10	83.7	E/NE
5-Oct-17	Thu	Moderate east to northeasterly winds	Trace	28.8	7.3	71	E/NE
6-Oct-17	Fri	Sunny intervals during the day.	0.2	29.6	6.5	70	E/NE
7-Oct-17	Sat	Moderate to fresh easterly winds	0	29.8	10.2	78.6	E/NE
8-Oct-17	Sun	Mainly cloudy with a few showers.	0	29.9	8.4	69	E/NE
9-Oct-17	Mon	Moderate east to northeasterly winds	Trace	29.9	8.2	70	E/NE
10-Oct-17	Tue	Moderate east to northeasterly winds	Trace	29.9	7.8	71.2	E/NE
11-Oct-17	Wed	Sunny intervals during the day.	0.2	30.2	8.6	72.7	E/NE
12-Oct-17	Thu	Mainly fine and dry	0	29.4	8	69	N
13-Oct-17	Fri	Fresh north to northeasterly winds,	0	26.3	14.1	59.5	N
14-Oct-17	Sat	Moderate east to northeasterly winds	0.4	22.5	10.5	69.2	E/NE
15-Oct-17	Sun	Sunny intervals during the day.	20.7	21.3	18.5	86.5	N
16-Oct-17	Mon	Moderate to fresh easterly winds	17.1	24.7	7.5	92.5	E/NE
17-Oct-17	Tue	Mainly cloudy with a few showers.	41.3	23.9	6.5	85.7	N/NW
18-Oct-17	Wed	Moderate east to northeasterly winds	Trace	25.7	8.2	75.5	N/NW
19-Oct-17	Thu	Moderate east to northeasterly winds	0	24.5	11.3	65.5	N/NW
20-Oct-17	Fri	Sunny intervals during the day.	0	24.6	11.5	62.5	N
21-Oct-17	Sat	Mainly fine and dry	0	23.8	6.9	64.9	N/NE
22-Oct-17	Sun	Fresh north to northeasterly winds,	0	21.6	2.5	70	N/NW
23-Oct-17	Mon	Mainly cloudy with a few rain patches.	0	21.2	5.5	70	N/NW
24-Oct-17	Tue	Moderate east to northeasterly winds	0	23	4.9	63.5	N/NW
25-Oct-17	Wed	Sunny intervals during the day.	Trace	23.6	6.5	70.5	E/NE
26-Oct-17	Thu	Mainly fine and dry	0	23.6	6.5	67	E/NE
27-Oct-17	Fri	Mainly fine and dry	0	Maintena nce	5.6	Maintena nce	S/SW
28-Oct-17	Sat	Sunny intervals during the day.	0	23	6.9	54.3	N/NE
29-Oct-17	Sun	Moderate northeasterly winds, occasionally fresh offshore.	0	22.6	9.3	53	E/NE
30-Oct-17	Mon	Mainly fine and dry	Trace	22.2	10.5	45.5	E/NE

Appendix L

Waste Flow Table



Contract No. CV/2012/08
Liantang/ Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works – Contract 2

Name of Department:	CEDD	Contract No./ Work Order No.:	CV/2012/08

Appendix I - Monthly Summary Waste Flow Table for 2017

(All quantities shall be rounded off to 3 decimal places)

Month		Actual Qu	antities of Inert C&D M	aterials Generated / Im	ported (in '000 m3)			Actual Quantities o	f Other C&D Materials	/ Wastes Generated	
	Total Quantities Generated	Broken Concrete (including rock for recycling into aggregates)	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill	Imported C&D Material	Metal	Paper/ Cardboard Packaging	Plastic (Recycled)	Chemical Waste	Others (e.g. General Refuse etc.) (in '000 m3)
	[a+b+c+d)	(a)	(b)	(c)	(d)		(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m3)
January	72.9008	0.0000	2.0045	31.5900	39.3063	9.1064	0.1440	0.3600	1.9179	1.7600	0.3210
February	85.5922	0.0000	1.4413	29.9165	54.2343	8.4347	0.0769	0.3000	2.1663	4.3480	0.3365
March	36.8512	0.0000	0.5903	33.0669	3.1940	7.7980	0.3892	0.4000	1.3527	4.0720	0.4167
April	41.5646	0.0000	1.2335	33.1649	7.1663	7.9084	0.4200	0.3200	2.0268	13.0254	0.3862
May	34.0768	0.0000	0.4115	29.0822	4.5830	8.3119	0.4765	0.3700	2.7135	3.5440	0.3907
June	38.4359	0.0000	0.6721	13.5900	24.1738	8.0061	0.0917	0.3300	3.3687	4.8760	0.3265
Half-year total	309.4216	0.0000	6.3533	170.4106	132.6577	49.5655	1.5983	2.0800	13.5459	31.6254	2.1777
July	85.5801	0.0000	1.2343	2.8380	81.5079	8.2250	0.0802	0.3200	3.1617	1.5080	0.5330
August	73.2350	0.0000	0.3805	0.8032	72.0514	8.4800	0.0311	0.3500	4.0788	2.8400	0.5071
September	69.9895	0.0000	0.0705	1.4936	68.4254	7.1930	0.0423	0.3400	2.1170	1.1560	0.5672
October	77.6273	0.0000	0.0000	0.0000	77.6273	0.2297	0.0280	0.3000	2.2253	8.9592	0.6288
November	0.0000			•							
December	0.0000										
Yearly Total	615.8535	0.0000	8.0385	175.5453	432.2696	73.6932	1.7799	3.3900	25.1287	46.0886	4.4137

(All quantities shall be rounded off to 3 decimal places)

Year		nerated / Imported (in '				Actual Quantities of	of Other C&D Materials	/ Wastes Generated			
1000	Total Quantities Generated	Broken Concrete	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill	Imported C&D Material	Metal	Paper/ Cardboard Packaging	Plastic (Recycled)	Chemical Waste	Others (e.g. General Refuse etc.) (in '000 m3)
	[a+b+c+d)	(a)	(b)	(c)	(d)		(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m3)
2013	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000	0.0000
2014	425.4406	0.0000	2.7362	376.3945	46.3099	5.6245	3.2100	0.4390	0.0070	10.8800	2.2609
2015	570.9459	0.0000	20.8159	543.2162	6.9138	4.5492	14.1300	3.9220	11.9700	16.1920	1.1696
2016	905.0989	0.0000	7.4372	427.7834	469.8783	24.8350	259.2290	3.8500	18.7262	34.2936	1.9720
2017	615.8535	0.0000	8.0385	175.5453	432.2696	73.6932	1.7799	3.3900	25.1287	46.0886	4.4137
2018											
Total	2517.3389	0.0000	39.0278	1522.9395	955.3716	108.7019	278.3489	11.6010	55.8319	107.4542	9.8162

Remar	k

1) Density of C&D material to be	2.2	metric ton/m3
2) Density of General Refuse to be	1.6	metric ton/m3

3) Density of Spent Oil to be

|--|

Name of Department: CEDD Contract No.: CV/2012/09

Monthly Summary Waste Flow Table for 2017 (year)

	Actua	 Quantities	of Inert C&D	Materials G	enerated Mo	onthly	Actual	Quantities o	f C&D Wastes	Generated	Monthly
		Hard Rock									
0.4 4 -	Total	and Large	Reused in	Reused in	Disposed			Paper/			Others, e.g.
Month	Quantity	Broken	the	other	as Public	Imported		cardboard		Chemical	general
	Generated	Concrete	Contract	Projects	Fill	Fill	Metals	packaging	Plastics	Waste	refuse
	(in '000m ³)	(in m³)	(in '000m ³)								
Jan	1.150	0.204	0.150	0.000	0.796	1.150	0.000	0.000	0.001	0.000	0.170
Feb	1.160	0.308	0.192	0.000	0.660	0.926	0.000	0.000	0.001	0.000	0.140
Mar	2.287	0.565	0.060	0.000	1.662	1.055	0.000	0.000	0.000	0.000	0.115
Apr	1.004	0.064	0.036	0.000	0.903	0.463	0.000	0.000	0.004	0.000	0.075
May	0.497	0.005	0.120	0.000	0.372	0.050	0.767	0.000	0.000	0.000	0.105
Jun	1.249	0.150	0.150	0.000	0.948	0.008	0.000	0.000	0.000	0.000	0.135
Sub-total	7.347	1.297	0.708	0.000	5.342	3.651	0.767	0.000	0.006	0.000	0.740
Jul	1.917	0.180	0.120	0.000	1.617	0.542	0.000	0.000	0.000	0.000	0.065
Aug	1.297	0.118	0.120	0.000	1.059	0.099	0.000	0.000	0.000	0.000	0.130
Sep	2.448	0.437	0.090	0.000	1.921	0.291	0.000	0.000	0.000	0.000	0.115
Oct	2.156	0.544	0.240	0.000	1.372	0.939	0.000	0.000	0.000	0.000	0.090
Nov											
Dec											
Total	15.165	2.576	1.278	0.000	11.311	5.522	0.767	0.000	0.006	0.000	1.140

Note:

- 1. Assume the density of soil fill is 2 ton/m³.
- 2. Assume the density of rock and broken concrete is 2.5 ton/m³.
- 3. Assume each truck of C&D wastes is 5m³.
- 4. The inert C&D materials except slurry and bentonite are disposed at Tuen Mun 38.
- 5. The slurry and bentonite are disposed at Tseung Kwun O 137.
- 6. The non-inert C&D wastes are disposed at NENT.
- 7. Assume the density of metal is 7,850 kg/m³.
- 8. Assume the density of plastic is 941 kg/m³.
- 9. Assume the density of paper is 800 kg/m³.

Name of Department: CEDD Contract No.: NE/2014/02

Monthly Summary Waste Flow Table for 2017

		Actua	al Quantities of Inert C&D	Materials Generated M	Ionthly			Actual Quanti	ties of C&D Wastes Gen	erated Monthly	
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m ³)
2016	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Jan-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Feb-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Mar-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Apr-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
May-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Jun-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Jul-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Aug-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Sep-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Oct-17	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Nov-17											
Dec-17											
Total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000

	Forecast of Tota	al Quantities of C&D Mat	erials to be Generated fro	om the Contract*						
Total Quantity Generated	" Reused in the Contract Disposed as Public Fill Imported Fill				Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse	
(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m ³)
0.500	0.000	0.000	0.000	0.500	0.000	0.500	0.200	0.000	0.000	0.200

Notes:

- (1) The performance targets are given in PS Clause 1.84(14).
- (2) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Sites.
- $(3)\ Plastics\ refer\ to\ plastic\ bottles/containers,\ plastic\ sheets/foam\ from\ packaging\ materials.$
- (4) Estimate 6.5m3 capacity per dump truck

Monthly Summary Waste Flow Table for 2017 (year)

Name of Person completing the record: K.M. Lui (EO)

Project : Li	angtang / Heung	Yuen Wai Bou	ndary Control I	Point Site Form					2013/08			
		Actual Quantit	ies of Inert C&	D Materials Ge	nerated Monthly		Actual Quantities of C&D Wastes Generated Monthly					
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse	
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000 m ³)	
Jan	40.128	0	19.297	6.067	14.764	0	0	0.171	0	0	0.065	
Feb	48.065	0	16.328	7.123	24.614	0	0	0.294	0	0	0.107	
Mar	49.230	0	5.661	15.029	28.540	0	0	0.494	0	0	0.217	
Apr	52.348	0	10.824	31.732	9.792	0	0	0.331	0	0.290	0.162	
May	47.339	0	24.850	12.383	10.106	0	0	0	0	0	0.228	
Jun	1.108	0	0	0	1.108	0	0	0.285	0	0	0.258	
Sub-total	238.218	0	76.960	72.334	88.92418	0	0	1.575	0	0.29	1.037	
Jul	0.934	0	0	0	0.934	0	0	0.360	0	0	0.288	
Aug	1.656	0	0.432	0	1.224	0	0	0.291	0	0	0.510	
Sep	4.210	0	1.386	0	2.824	0	0	0.339	0	0	0.513	
Oct	0.970	0	0.520	0	0.450	0	0	0	0	0	0.515	
Nov												
Dec												
Total	989.150	0	162.989	270.626	555.53555	53.939	0	5.338	0.007	34.045	7.715	

Notes:

⁽¹⁾ The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.

⁽²⁾ Plastics refer to plastic bottles/containers, plastic sheets/ foam from packaging materials.

⁽³⁾ Broken concrete for recycling into aggregates.

MONTHLY SUMMARY WASTE FLOW TABLE

Name of Departi	ment: CEDD		
Contract Title:	Liantang/ Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works – Contract 7	Contract No.:	NE/2014/03

Monthly Summary Waste Flow Table for 2017 (year)

		Actual Quan	tities of Inert C&I	Materials Genera	ted Monthly		Act	ual Quantities of No	on-Inert C&D Wa	stes Generated Mo	nthly
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/cardboard packaging	Plastic (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m ³)	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m3)
Jan	0	0	0	0	0	0	0.1	0.05	0.001	0	0.01
Feb	0	0	0	0	0	0	0.5	0.04	0.001	0	0.015
Mar	0.822	0	0	0	0.822	0	2.2	0.04	0.001	0	0.025
Apr	1.473	0	0	0	1.473	0	3.1	0.04	0.001	0	0.02
May	1.129	0	0	0	1.129	0	4.5	0.04	0.001	0	0.03
June	0.317	0	0	0	0.317	0	4	0.04	0.001	0	0.04
Sub-total	3.741	0	0	0	3.741	0	14.4	0.25	0.006	0	0.14
July	0.931	0	0	0	0.931	0	2	0.04	0.001	0	0.025
Aug	0	0	0	0	0	0	2.5	0.04	0.001	0	0.01
Sept	0.068	0	0	0	0.068	0	2	0.04	0.001	0	0.01
Oct	0.381	0	0	0	0.381	0	11.7	0.04	0.001	0	0.008
Nov		_									
Dec											
Total	5.12128	0	0	0	5.12128	0	32.6	0.41	0.01	0	0.1927

Notes: (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.

⁽²⁾ Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.

Contract No. / Works Order No.: - SSC505

Monthly Summary Waste Flow Table for 2017 [year] [to be submitted not later than the 15th day of each month following reporting month]

(All quantities shall be rounded off to 3 decimal places.)

		Actual Quantities of Inc	ert Construction Waste Ge	nerated Monthly	
Month	(a)=(b)+(c)+(d)+(e) Total Quantity Generated	(b) Broken Concrete (see Note 4)	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed of as Public Fill
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)
Jan	3.160	0.000	2.003	0.000	1.157
Feb	1.374	0.000	0.249	0.000	1.125
Mar	0.548	0.000	0.054	0.000	0.494
Apr	4.136	0.013	1.139	0.000	2.984
May	4.201	0.000	1.191	0.000	3.010
Jun	9.813	0.000	1.317	0.000	8.496
Sub-total	23.230	0.013	5.953	0.000	17.264
Jul	9.101	0.000	1.223	0.000	7.878
Aug	6.341	0.000	2.532	0.000	3.809
Sep	5.142	0.000	4.992	0.000	0.150
Oct	2.610	0.000	0.250	0.000	2.360
Nov	-	-	-	-	-
Dec	1	-	-	-	-
Total	46.423	0.013	14.950	0.000	31.460

Form No. D/OI.03/09.002

					Actual Qua	ntities of Nor	ı-inert Constr	uction Waste	Generated M	onthly			
Month	Tim	ıber	Me	tals	Paper/ ca packa		Plas (see N		Chemica	al Waste		ecyclable (see Page 3)	General Refuse disposed of at Landfill
	(in '0	00kg)	(in '0	00kg)	(in '0	00kg)	(in '0	00kg)	(in '0	00kg)	(in '0	00kg)	(in '000m ³)
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated
Jan	0.000	0.000	458.150	458.150	0.560	0.560	0.058	0.058	0.000	0.000	0.024	0.024	0.481
Feb	0.000	0.000	177.180	177.180	0.370	0.370	0.036	0.036	0.000	0.000	0.008	0.008	0.280
Mar	0.000	0.000	97.370	97.370	3.380	3.380	1.573	1.573	0.000	0.000	0.036	0.036	0.423
Apr	0.000	0.000	148.110	148.110	0.300	0.300	1.223	1.223	0.000	0.000	29.795	29.795	0.358
May	0.000	0.000	405.500	405.500	0.440	0.440	0.040	0.040	0.000	0.000	0.006	0.006	0.644
Jun	0.000	0.000	338.580	338.580	0.710	0.710	0.036	0.036	0.000	0.000	0.002	0.002	0.878
Sub-total	0.000	0.000	1624.890	1624.890	5.020	5.020	2.926	2.926	0.000	0.000	29.871	29.871	3.062
Jul	0.000	0.000	296.540	296.540	0.650	0.650	1.040	1.040	0.000	0.000	0.002	0.002	1.651
Aug	0.000	0.000	239.720	239.720	0.700	0.700	0.000	0.000	0.000	0.000	0.000	0.000	1.554
Sep	0.000	0.000	68.060	68.060	0.570	0.570	1.037	1.037	0.000	0.000	0.001	0.001	1.606
Oct	0.000	0.000	53.130	53.130	0.000	0.000	3.000	3.000	0.000	0.000	0.000	0.000	1.651
Nov	-	-	-	-	-	-	-	-	-	-	-	-	-
Dec	-	-	-	-	-	-	-	-	-	-	-	-	-
Total	0.000	0.000	2282.340	2282.340	6.940	6.940	8.003	8.003	0.000	0.000	29.873	29.873	9.523

Description of mod	Description of mode and details of recycling if any for the month e.g. XX kg of used timber was sent to YY site for transformation into fertilizers									
3000kg of plastic barrier were sent to Forest Hill for recycling.	53.13 tons of scrap metals from LCAL were sent to Hop Hing Metal Works and Wai Hung for recycling									

Notes:

- (1) The performance targets are given in the Particular Specification on Environmental Management Plan.
- (2) The waste flow table shall also include construction waste that are specified in the Contract to be imported for use at the site.
- (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
- (4) Broken concrete for recycling into aggregates.
- (5) If necessary, use the conversion factor: 1 full load of dumping truck being equivalent to 6.5 m³ by volume.

Appendix M

Implementation Schedule for Environmental Mitigation Measures



EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure	Who to implement the	Location of the measure	When to implement the	What requirements or standards for the measure to
	Her.		& Main Concerns to address	measure?	illeasure	measure?	achieve?
Air Quali	ty Impact (Construction)					
3.6.1.1	2.1	 General Dust Control Measures The following dust suppression measures should be implemented: Frequent water spraying for active construction areas (4 times per day for active areas in Po Kak Tsai and 8 times per day for all other active areas), including areas with heavy construction and slope cutting activities 80% of stockpile areas should be covered by impervious sheets Speed of trucks within the site should be controlled to about 10 km/hr All haul roads within the site should be paved to avoid dust 	To minimize adverse dust emission generated from various construction activities of the works sites	Contractor	Construction Works Sites	During Construction	EIA Recommendation and Air Pollution Control (Construction Dust) Regulation
		emission due to vehicular movement					
3.6.1.2	2.1	Best Practice for Dust Control The relevant best practices for dust control as stipulated in the Air Pollution Control (Construction Dust) Regulation should be adopted to further reduce the construction dust impacts of the Project. These best practices include: Good site management	emission generated	Contractor	Construction Works Sites	During Construction	EIA Recommendation and Air Pollution Control (Construction Dust) Regulation
		 The Contractor should maintain high standard of housekeeping to prevent emission of fugitive dust. Loading, unloading, handling and storage of raw materials, wastes or by-products should be carried out in a manner so as to minimize the release of visible dust emission. 					
		Any piles of materials accumulated on or around the work areas should be cleaned up regularly.					
		Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimizing generation of fugitive dust emissions.					
		 The material should be handled properly to prevent fugitive dust emission before cleaning. Disturbed Parts of the Roads 					
		 Each and every main temporary access should be paved with 					



Objectives of the What requirements Who to Recommended When to **Recommended Mitigation Measures** EM&A implement Location of the or standards for the EIA Ref. Measure implement the Ref. the measure measure to measure? & Main Concerns measure? achieve? to address

concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials; or

 Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.

Exposed Earth

Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies.

Loading, Unloading or Transfer of Dusty Materials

 All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.

Debris Handlina

- Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides.
- Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped.

Transport of Dusty Materials

 Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.

Wheel washing

Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.

Use of vehicles

- Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.
- Where a vehicle leaving the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle.



EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?
		Site hoarding Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit. Blasting The areas within 30m from the blasting area should be wetted with water prior to blasting.					
Air Qualit	ty Impact (Operation)					
3.5.2.2	2.2	 The following odour containment and control measures will be provided for the proposed sewage treatment work at the BCP site: The treatment work will be totally enclosed. Negative pressure ventilation will be provided within the enclosure to avoid any fugitive odorous emission from the treatment work. Further odour containment will be achieved by covering or confining the sewage channels, sewage tanks, and equipment with potential odour emission. Proper mixing will be provided at the equalization and sludge holding tanks to prevent sewage septicity. Chemical or biological deodorisation facilities with a minimum odour removal efficiency of 90% will be provided to treat potential odorous emissions from the treatment plant including sewage channels / tanks, filter press and screening facilities so as to minimize any potential odour impact to the nearby ASRs. 	To minimize potential odour impact from operation of the proposed sewage treatment work at BCP	DSD	BCP	Operation Phase	EIA recommendation
Noise Imp	pact (Cons	truction)					
4.4.1.4	3.1	Adoption of Quieter PME Use of the recommended quieter PME such as those given in the BS5228: Part 1:2009 and presented in Table 4.14, which can be found in Hong Kong.	To minimize the construction air-borne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and Noise Control Ordinance (NCO)



EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?
4.4.1.4	3.1	Use of Movable Noise Barrier The use of movable barrier for certain PME can further alleviate the construction noise impacts. In general, a 5 dB(A) reduction for movable PME and 10 dB(A) for stationary PME can be achieved depending on the actual design of the movable noise barrier. The Contractor shall be responsible for design of the movable noise barrier with due consideration given to the size of the PME and the requirement for intercepting the line of sight between the NSRs and PME. Barrier material with surface mass in excess of 7 kg/m² is recommended to achieve the predicted screening effect.	To minimize the construction airborne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and NCO
4.4.1.4	3.1	Use of Noise Enclosure/ Acoustic Shed The use of noise enclosure or acoustic shed is to cover stationary PME such as air compressor and concrete pump. With the adoption of the noise enclosure, the PME could be completely screened, and noise reduction of 15 dB(A) can be achieved according to the GW-TM.	To minimize the construction airborne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and NCO
4.4.1.4	3.1	Use of Noise Insulating Fabric Noise insulating fabric can be adopted for certain PME (e.g. drill rig, pilling auger etc). The insulating fabric should be lapped such that there are no openings or gaps on the joints. Technical data from manufacturers state that by using the Fabric, a noise reduction of over 10 dB(A) can be achieved on noise level.	To minimize the construction airborne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and NCO



EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure	Who to implement the	Location of the measure	When to implement the	What requirements or standards for the measure to
			& Main Concerns to address	measure?		measure?	achieve?
4.4.1.4	3.1	Good Site Practice	To minimize the	Contractors	Construction	During	EIA recommendation,
		The good site practices listed below should be followed during each phase of construction:	construction air- borne noise impact		Work Sites	Construction	EIAO and NCO
		 Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; 					
		 Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction programme; 					
		• Mobile plant, if any, should be sited as far from NSRs as possible;					
		 Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; 					
		 Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and 					
		 Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities. 					
Noise Im	pact (Oper	ration)					
		Road Traffic Noise					
Table 4.42 and Figure 4.20.1 to	3.2	Erection of noise barrier/ enclosure along the viaduct section.	To minimize the road traffic noise along the connecting road of BCP	Contractor	Loi Tung and Fanling Highway Interchange	Before Operation	EIAO and NCO
4.20.4		Fixed Plant Noice					
Table	3.2	Fixed Plant Noise Specification of the maximum allowable sound power levels of the	To minimize the	Managing	BCP,	Before	EIA recommendation,
4.46	J. <u>C</u>	proposed fixed plants during daytime and night-time.	fixed plant noise impact	Authority of the buildings / Contractor	Administration Building and all ventilation buildings	Operation	EIAO and NCO



EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?
4.5.2.4	3.2	 The following noise reduction measures shall be considered as far as practicable during operation: Choose quieter plant such as those which have been effectively silenced; Include noise levels specification when ordering new plant (including chillier and E/M equipment); Locate fixed plant/louver away from any NSRs as far as practicable; Locate fixed plant in walled plant rooms or in specially designed enclosures; Locate noisy machines in a basement or a completely separate building; Install direct noise mitigation measures including silencers, acoustic louvers and acoustic enclosure where necessary; and Develop and implement a regularly scheduled plant maintenance programme so that equipment is properly operated and serviced in order to maintain a controlled level of noise. 	To minimize the fixed plant noise impact	Managing Authority of the buildings / Contractor	BCP, Administration Building and all ventilation buildings	Before Operation	EIAO and NCO
Water Qu	uality Impac	ct (Construction)					
5.6.1.1	4.1	Construction site runoff and drainage The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. The following measures are recommended to protect water quality and when properly implemented should be sufficient to adequately control site discharges so as to avoid water quality impacts:	To control site runoff and drainage; prevent high sediment loading from reaching the nearby	Contractor	Construction Works Sites	Construction Phase	Practice Note for Professional Persons on Construction Site Drainage (ProPECC Note PN 1/94)
		At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system should be undertaken by the Contractor prior to the commencement of construction.	watercourses				
		The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas.					



Objectives of the What requirements Who to Recommended When to **Recommended Mitigation Measures** EM&A implement Location of the or standards for the Measure EIA Ref. implement the Ref. the measure measure to measure? & Main Concerns measure? achieve? to address

Temporary ditches should be provided to facilitate the runoff discharge into stormwater drainage system through a sediment/silt trap. The sediment/silt traps should be incorporated in the permanent drainage channels to enhance deposition rates, if practical.

- Sand/silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM standards under the WPCO. The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending upon the flow rate. The detailed design of the sand/silt traps should be undertaken by the Contractor prior to the commencement of construction.
- All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit should be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.
- Measures should be taken to minimize the ingress of site drainage into excavations. If excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from foundation excavations should be discharged into storm drains via silt removal facilities.
- If surface excavation works cannot be avoided during the wet season (April to September), temporarily exposed slope/soil surfaces should be covered by tarpaulin or other means, as far as practicable, and temporary access roads should be protected by crushed stone or gravel, as excavation proceeds. Interception channels should be provided (e.g. along the crest/edge of the excavation) to prevent storm runoff from washing across exposed soil surfaces. Arrangements should always be in place to ensure that adequate surface protection measures can be safely carried out well before the arrival of a rainstorm. Other measures that need to be implemented before, during and after rainstorms are summarized in ProPECC Note PN 1/94.
- The overall slope of the site should be kept to a minimum to reduce



EIA Ref.	EM&A	Recommended Mitigation Measures	Objectives of the Recommended Measure	Who to implement	Location of the	When to implement the	What requirements or standards for the
	Ref.		& Main Concerns to address	the measure?	measure	measure?	measure to achieve?
		the erosive potential of surface water flows.	·				
		All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exit where practicable. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains.					
		Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system.					
		Manholes (including newly constructed ones) should be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and stormwater runoff being directed into foul sewers.					
		■ Precautions should be taken at any time of the year when rainstorms are likely. Actions should be taken when a rainstorm is imminent or forecasted and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC Note PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes.					
		■ Bentonite slurries used in piling or slurry walling should be reconditioned and reused wherever practicable. Temporary enclosed storage locations should be provided on-site for any unused bentonite that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.					
5.6.1.1	4.1	Good site practices for works within water gathering grounds	To minimize water	Contractor	Construction	Construction	ProPECC Note PN
		The following conditions should be complied, if there is any works to be carried out within the water gathering grounds:	quality impacts to the water gathering grounds		Works Sites within the water gathering	Phase	1/94



Objectives of the What requirements Who to Recommended When to **Recommended Mitigation Measures** EM&A implement Location of the or standards for the Measure EIA Ref. implement the Ref. the measure measure to measure? & Main Concerns measure? achieve? to address grounds Adequate measures should be implemented to ensure no pollution

- or siltation occurs to the catchwaters and catchments.
- No earth, building materials, oil or fuel, soil, toxic materials or any materials that may possibly cause contamination to water gathering grounds are allowed to be stockpiled on site.
- All surplus spoil should be removed from water gathering grounds as soon as possible.
- Temporary drains with silt traps should be constructed at the site boundary before the commencement of any earthworks.
- Regular cleaning of silt traps should be carried out to ensure proper operation at all time.
- All excavated or filled surfaces which have the risk of erosion should always be protected form erosion.
- Facilities for washing the wheels of vehicles before leaving the site should be provided.
- Any construction plant which causes pollution to catchwaters or catchments due to the leakage of oil or fuel should be removed off site immediately.
- No maintenance activities which may generate chemical wastes should be undertaken in the water gathering grounds. Vehicle maintenance should be confined to designated paved areas only and any spillages should be cleared up immediately using absorbents and waste oils should be collected in designated tanks prior to disposal off site. All storm water run-off from these areas should be discharged via oil/petrol separators and sand/silt removal traps.
- Any soil contaminated with fuel leaked from plant should be removed off site and the voids arising from removal of contaminated soil should be replaced by suitable material approved by the Director of Water Supplies.
- Provision of temporary toilet facilities and use of chemicals or insecticide of any kind are subject to the approval of the Director of Water Supplies.
- Drainage plans should be submitted for approval by the Director of



Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockplies of cement and other construction materials should be kept covered when not being used. Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. 5.6.1.3 4.1 Sewage effluent from construction workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. 5.6.1.4 4.1 Hydrogeological Impact Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflows. The pre-injection grouting where necessary to further enhance the groundwater inflows control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. Water Quality Impact (Operation)	EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?
always be maintained. Earthworks near catchwaters or streamcourses should only be carried out in dry season between October and March, Advance notice must be given before the commencement of works on site quoting WSD's approval letter reference. 5.6.1.2 4.1 Good step ractices of general construction activities Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of property to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction materials should be kept covered when not being used. Olls and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. Sewage effluent from construction workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate disposal and maintenance. To minimize water workfull workfull workfull workfull workfull and adequate portable toilets and be responsible for appropriate disposal and maintenance. To minimize water workfull workfu			Water Supplies.	'				
carried out in dry season between October and March, Advance notice must be given before the commencement of works on site quoting WSD's approval letter reference. 5.6.1.2 4.1 Good site practices of general construction activities Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Slockpiles of cement and other construction materials should be kept covered when not being used. Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. 5.6.1.3 4.1 Sewage effluent from construction workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be responsible for appropriate and adequate portable toilets and be responsible for appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. Hydrogeological Impact Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-side. Water Quality Impact (Operation)								
5.6.1.2 4.1 Good site practices of general construction activities Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction materials should be kept covered when not being used. Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. 5.6.1.3 4.1 Sewage effluent from construction workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. To minimize water workforce and the storage and works sites with on-site sanitary facilities. To minimize water and contractor works sites with on-site sanitary facilities. To minimize water and works sites with on-site sanitary facilities. To minimize water and contractor appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. To minimize water and contractor appropriate water around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The per-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflows control. On-site treatment for the groundwater inflows control. On-site treatment for the groundwater inflows control. On-site treatment for the groundwater inflows control. On-site water and based on			,					
Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction materials should be kept covered when not being used. Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. 5.6.1.3 4.1 Sewage effluent from construction workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. 5.6.1.4 4.1 Hydrogeological Impact Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflows control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. Water Quality Impact (Operation)								
be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction materials should be kept covered when not being used. Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. Sewage effluent from construction workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. Hydrogeological Impact Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. Water Quality Impact (Operation)	5.6.1.2 4.	.1	Good site practices of general construction activities		Contractor			EIA Recommendation
pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. 5.6.1.3 4.1 Sewage effluent from construction workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. For minimize water quality impacts To minimi			be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction	quality impacts		works sites	phase	
Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. 5.6.1.4 4.1 Hydrogeological Impact Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. Water Quality Impact (Operation) To minimize water Quality impacts Works sites with on-site sanitary facilities To minimize water Quality impacts To minimize wate			pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The					
be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. 5.6.1.4 4.1 Hydrogeological Impact Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. Water Quality Impact (Operation) Contructor quality impacts To minimize water Contractor quality impacts To minimize water quality impacts Contruction works sites of the drill and blast tunnel	5.6.1.3 4.	.1	Sewage effluent from construction workforce		Contractor	All construction	Construction	EIA Recommendation
Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. Water Quality Impact (Operation)			be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for	quality impacts		on-site sanitary	phase	and Water Pollution Control Ordinance (WPCO)
limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. Water Quality Impact (Operation)	5.6.1.4 4.	.1	Hydrogeological Impact		Contractor			EIA Recommendation
			limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge	quality impacts		the drill and	phase	and WPCO
	Water Qualit	ty Impac	et (Operation)					
No mitigation measure is required.			No mitigation measure is required.					



EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure	Who to implement the	Location of the measure	When to implement the	What requirements or standards for the measure to
	no.		& Main Concerns to address	measure?	measure	measure?	achieve?
Sewage a	and Sewera	age Treatment Impact (Construction)					
6.7	5	The sewage generated by the on-site workforce should be collected in chemical toilets and disposed of off-site by a licensed waste collector.	To minimize water quality impacts	Contractor	All construction works sites with on-site sanitary facilities	Construction phase	EIA recommendation and WPCO
Sewage a	and Sewera	age Treatment Impact (Operation)					
6.6.3	5	Sewage generated by the BCP and Chuk Yuen Village Resite will be collected and treated by the proposed on-site sewage treatment facility using Membrane Bioreactor treatment with a portion of the treated wastewater reused for irrigation and flushing within the BCP.	To minimize water quality impacts	DSD	BCP	Operation phase	EIA recommendation and WPCO
6.5.3	5	Sewage generated from the Administration Building will be discharged to the existing local sewerage system.	To minimize water quality impacts	DSD	Administration Building	Operation phase	EIA recommendation and WPCO
Waste Ma	anagement	Implication (Construction)					
7.6.1.1	6	Good Site Practices Adverse impacts related to waste management such as potential hazard, air, odour, noise, wastewater discharge and public transport as mentioned in section 3.4.7.2 (ii)(c) of the Study Brief are not expected to arise, provided that good site practices are strictly followed. Recommendations for good site practices during the construction activities include:	To minimize adverse environmental impact	Contractor	Construction works sites (general)	Construction Phase	EIA recommendation; Waste Disposal Ordinance; Waste Disposal (Chemical Wastes) (General) Regulation; and ETWB TC(W) No.
		Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site					19/2005, Environmental Management on Construction Site
		 Training of site personnel in proper waste management and chemical handling procedures 					
		 Provision of sufficient waste disposal points and regular collection of waste 					
		Dust suppression measures as required under the Air Pollution Control (Construction Dust) Regulation should be followed as far as practicable. Appropriate measures to minimise windblown litter and dust/odour during transportation of waste by covering trucks or in enclosed containers					
		 General refuse shall be removed away immediately for disposal. As 					




	entai ivion	itoring and Audit Manual					
EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?
		such odour is not anticipated to be an issue to distant sensitive receivers					
		Provision of wheel washing facilities before the trucks leaving the works area so as to minimise dust introduction from public road					
		 Covers and water spraying system should be provided for the stockpiled C&D material to prevent dust impact or being washed away 					
		 Designate different locations for storage of C&D material to enhance reuse 					
		■ Well planned programme for transportation of C&D material to lessen the off-site traffic impact. Well planned delivery programme for offsite disposal and imported filling material such that adverse noise impact from transporting of C&D material is not anticipated					
		Site practices outlined in ProPECC PN 1/94 "Construction Site Drainage" should be adopted as far as practicable, such as cleaning and maintenance of drainage systems regularly					
		 Provision of cover for the stockpile material, sand bag or earth bund as barrier to prevent material from washing away and entering the drains 					
7.6.1.2	6	Waste Reduction Measures	To reduce the	Contractor	Construction	Construction	EIA recommendation
		Good management and control can prevent the generation of a significant amount of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:	quantity of wastes		works sites (General)	Phase	and Waste Disposal Ordinance
		 Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal 					
		 Encourage collection of aluminium cans by providing separate labelled bins to enable this waste to be segregated from other general refuse generated by the work force 					
		 Proper storage and site practices to minimise the potential for damage or contamination of construction materials 					
		Plan and stock construction materials carefully to minimise amount					



EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure	Who to implement the	Location of the measure	When to implement the	What requirements or standards for the measure to
	nei.		& Main Concerns to address	measure?	illeasure	measure?	achieve?
		of waste generated and avoid unnecessary generation of waste					
		In addition to the above measures, specific mitigation measures are recommended below for the identified waste arising to minimise environmental impacts during handling, transportation and disposal of these wastes.					
7.6.1.3	6	C&D Materials	To minimize	Contractor	Construction	Construction	EIA recommendation;
		In order to minimise impacts resulting from collection and transportation of C&D material for off-site disposal, the excavated materials should be reused on-site as backfilling material as far as practicable. The surplus rock and other inert C&D material would be disposed of at the Government's Public Fill Reception Facilities (PFRFs) at Tuen Mun Area 38 for beneficial use by other projects in the HKSAR as the last resort. C&D waste generated from general site clearance and tree felling works would require disposal to the designated landfill site. Other mitigation requirements are listed below:	impacts resulting from C&D material		Works Sites (General)	Phase	Waste Disposal Ordinance; and ETWB TCW No. 31/2004
		 A Waste Management Plan should be prepared and implemented in accordance with ETWB TC(W) No. 19/2005 Environmental Management on Construction Site; and 					
		■ In order to monitor the disposal of C&D material and solid wastes at public filling facilities and landfills, and to control fly-tipping, a trip-ticket system (e.g. ETWB TCW No. 31/2004) should be included.					
7.6.1.4	6	General refuse General refuse should be stored in enclosed bins or compaction units separated from other C&D material. A reputable waste collector is to be employed by the Contractor to remove general refuse from the site separately. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' litter.	To minimize impacts resulting from collection and transportation of general refuse for off-site disposal	Contractor	Construction works sites (General)	Construction phase	Waste Disposal Ordinance and Public Health and Municipal Services Ordinance - Public Cleansing and Prevention of Nuisances Regulation
7.6.1.5	6	Chemical waste If chemical wastes are produced at the construction site, the Contractor will be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical	To minimize impacts resulting from collection and transportation of chemical waste for off-site disposal	Contractor	Construction works sites (General)	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation and Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes

Appendix N

Investigation Report for Exceedance

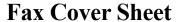



To Mr. Vincent Chan Fax No By e-mail

Company CRBC-CEC-Kaden JV

cc

From Nicola Hon Date 20 October 2017

Our Ref TCS00694/13/300/F1277a No of Pages 5 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report of Exceedance of Water Quality at Location WM1 on 30

September 2017

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear Sir,

Further to the following Notification of Exceedance (NOE) ref.:

TCS00694/13/300/F1163 dated 4 October 2017 TCS00694/13/300/F1171 dated 12 October 2017

Please find attached the "Investigation Report on Action or Limit Level Non-compliance" referenced above for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. Simon Leung (ER of C6/ AECOM) Fax: 2251 0698 Mr. Antony Wong (IEC, SMEC) By email



Agreement No. CE 45/2008 Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works Investigation Report on Action or Limit Level Non-compliance

Project		CE 45/2008			
Date		30 September 2017			
Location		WM1			
Time		9:30			
Parameter		Turbidity (NTU)	Suspended Solids (mg/L)		
A adiam I amal		51.3 AND 120% of upstream control	54.5 AND 120% of upstream control		
Action Level		station of the same day	station of the same day		
Limit Level		67.6 AND 130% of upstream control	64.9 AND 130% of upstream control		
		station of the same day	station of the same day		
Measured W	/M1-C	26.1	26.5		
Levels W	/M1	129.0	159.0		
Exceedance		Limit Level	Limit Level		
Investigation			n provided from CCKJV, construction		
Results,		activities carried out during 30			
Recommendat		construction of underpass and			
	igation	monitoring locations and works are	ea are shown in <i>Figure 1</i> .		
Measures		was observed at WM1 and the v	en on 30 September 2017, turbid water water quality at WM1-C was slightly conducted during rain. (Photo 1 to 2)		
		heavy rain on 30 September 2017 water quality throughout the rive	ation from the Observatory, there was and the total rainfall was 35mm. The er course was highly affected by the noff from the surrounding environment		
		and 12 October 2017, it was obser depressed road was conducted at B to the site condition and active site the works was limited. (Photo 3) facilities were implemented prope (AquaSed SH-20) were functioned generated from the site were defacilities for treatment before of	the two the RE, IEC, CCKJV and ET on 3 wed that construction of underpass and wridge Y which near WM1. According to activities, wastewater generated from It was observed that wheel washing rly and wastewater treatment facilities d properly. (Photo 4) All wastewater liverted to the wastewater treatment discharge of site. As water quality was covered with tarpaulin sheet to		
		Y and site condition was genera	lity mitigation implemented for Bridge ally in order, it was considered that 7 were related to the rainstorm and not		
		has been increased to daily due t until no exceedances were trigg monitoring was carried out on 3 at were triggered. Nevertheless, t implement the water mitigation	on, the monitoring frequency at WM1 to the limit level exceedance recorded ered in consecutive days. Additional and 4 October 2017 and no exceedances the Contractor should continue fully measures as recommended in the tronmental mitigation measures in the		



Prepared By:

Designation:

Environmental Consultant

Signature:

20 October 2017



Photo Record



Photo 1On 30 September 2017, turbid water was observed at WM1 and the water sampling was conducted during rainstorm.



On 30 September 2017, the water quality at WM1-C was slightly turbid the water sampling was conducted during rainstorm.



Photo 3
During site inspection on 3 and 12 October 2017, it was observed that construction of underpass and depressed road was conducted at Bridge Y and wastewater generated from the works was limited. It was observed that wheel washing facilities were implemented properly and wastewater treatment facilities (AquaSed SH-20) were functioned properly to treat the wastewater generated on site.



During site inspection on 3 and 12 October 2017, no adverse water quality impact was observed and contributed to WM1.



Photo 5As water quality mitigation measures, the slope was covered with tarpaulin sheet to minimize muddy runoff.

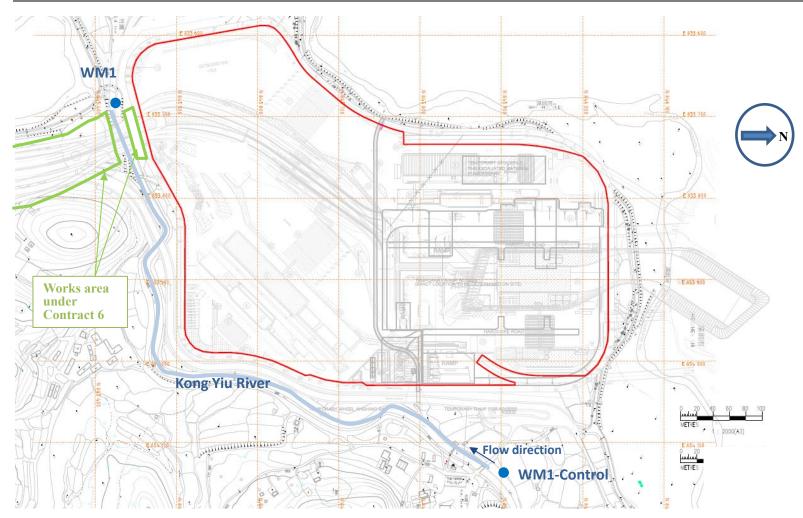


Figure 1 Location Map for Water Quality Monitoring Locations WM1 and WM1-C





To Mr. Kim Lui **Fax No** 2752 0696

Company Leighton Contractors (Asia) Limited

cc

From Nicola Hon Date 19 October 2017

Our Ref TCS00769/15/300/F0229 No of Pages 7 (Incl. cover sheet)

RE Architectural Services Department (ArchSD) Contract No: SS C505

Construction of Liantang/Heung Yuen Wai Boundary Control Point (BCP) - BCP

Buildings and Associated Facilities

Investigation Report of Exceedance of Water Quality at Location WM1 on 30

September 2017

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear Sir,

Further to the Notification of Exceedance (NOE) ref. of following:-

TCS00769/15/300/F0225 dated 4 October 2017 TCS00769/15/300/F0227 dated 12 October 2017

Please find attached the "Investigation Report on Action or Limit Level Non-compliance" referenced above for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. William WL Cheng (ASD)

Mr. Justin Cheung (Ronald Lu)

Mr. Antony Wong (IEC, SMEC)

Mr. Simon Leung (ER, AECOM)

By e-mail

By e-mail

By e-mail



Agreement No. CE 45/2008 Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report on Action or Limit Level Non-compliance

Project		CE 45/2008		
Contract		SS C505		
Location		WM1		
Date		30 September 2017		
Time		9:30		
Parameter		Turbidity (NTU)	Suspended Solids (mg/L)	
Action Leve	al .	51.3 AND 120% of upstream control	54.5 AND 120% of upstream control	
Action Leve	,ı	station of the same day	station of the same day	
Limit Level		67.6 AND 130% of upstream control	64.9 AND 130% of upstream control	
		station of the same day	station of the same day	
Measured	WM1-C	26.1	26.5	
levels	WM1	129.0	159.0	
Exceedance		Limit Level	Limit Level	
Investigatio Results, Recommend & M Measures		construction activities carried out excavation, rebar fixing, erection of and backfilling they are illustrated	provided by the Contractor, the major to on 30 September 2017 included formwork, concerting, superstructure of in Figure 1 . It is noted that the were not closed to Kong Yiu River.	
			on 30 September 2017, turbid water quality at WM1-C was slightly turbid ed during rain. (Photo 1 to 2)	
		generated from the active construct During rainy day, the surface runof the temporary drainage which but drainage plan. All the wastewate passing through the perimeter chat treatment plant for treatment but Moreover, exportation of the stock stockpile was compacted after excat the stockpile would be collected by (Photo 6) It is noted that the disch	O17, it was observed that wastewater tion activities was limited. (Photo 3) If from the site would be collected by tilt according to the temporary site for generated from the site would be not and diverted to the wastewater efore discharge. (Figure 4 & 5) kpile was in progress in which the vation and the runoff generation from the temporary site drainage as well. The arge point connecting public drainage and the discharge water would not flow to the discharge water would not flow the temporary water would not flow the discharge water wat	
		4. In our investigation, it is considered rainstorm and unlikely due to the wo	I that the exceedances were related to orks under the Contract SS C505.	
		been increased to daily due to the line exceedances were triggered in conwas carried out on 3 and 4 Octobriggered. Nevertheless, the Contra	the monitoring frequency at WM1 has mit level exceedance recorded until no secutive days. Additional monitoring ober 2017 and no exceedances were actor should continue fully implement recommended in the implementation on measures in the EM&A Manual.	



Prepared By:_	Nicola Hon
Designation :	Environmental Consultant
Signature :	Aula
Date :	19 October 2017



Photo 1
On 30 September 2017, turbid water was observed at WM1 and the water sampling was conducted during rainstorm.



Photo 2On 30 September 2017, the water quality at WM1-C was slightly turbid the water sampling was conducted during rainstorm.



Photo 3During site inspection on 4 October 2017, it was observed that wastewater generated from the active construction activities was limited.




During rainy day, the surface runoff would be collected by the temporary drainage and all the wastewater generated from the site including runoff would be passing through the perimeter channel and diverted to the wastewater treatment plant for treatment before discharge.




During rainy day, the surface runoff would be collected by the temporary drainage and all the wastewater generated from the site including runoff would be passing through the perimeter channel and diverted to the wastewater treatment plant for treatment before discharge.




Exportation of the stockpile was in progress in which the stockpile was compacted after excavation and the runoff generation from the stockpile would be collected by the temporary site drainage as well.

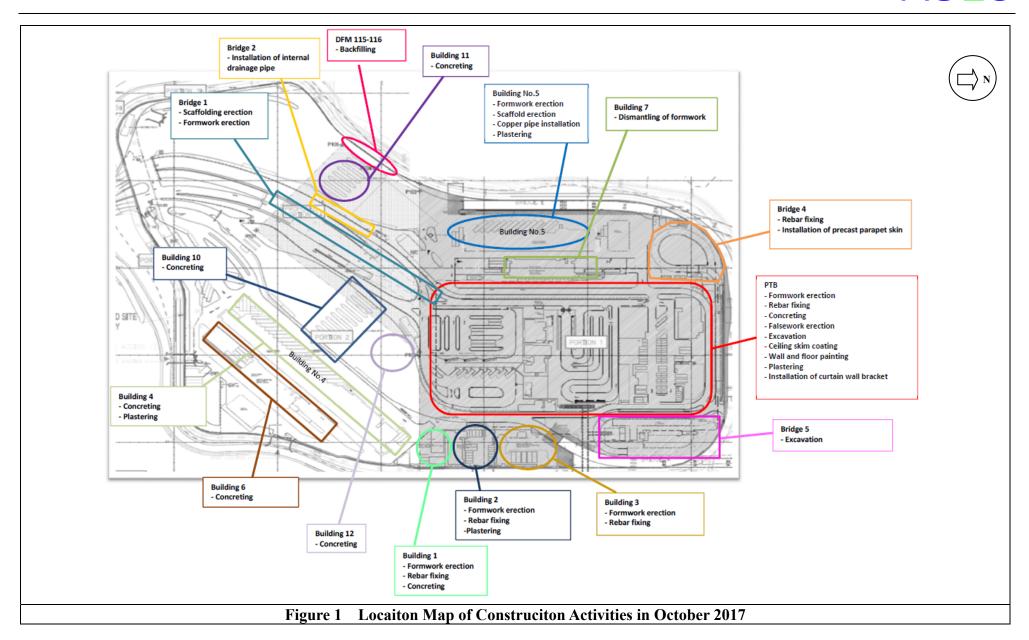



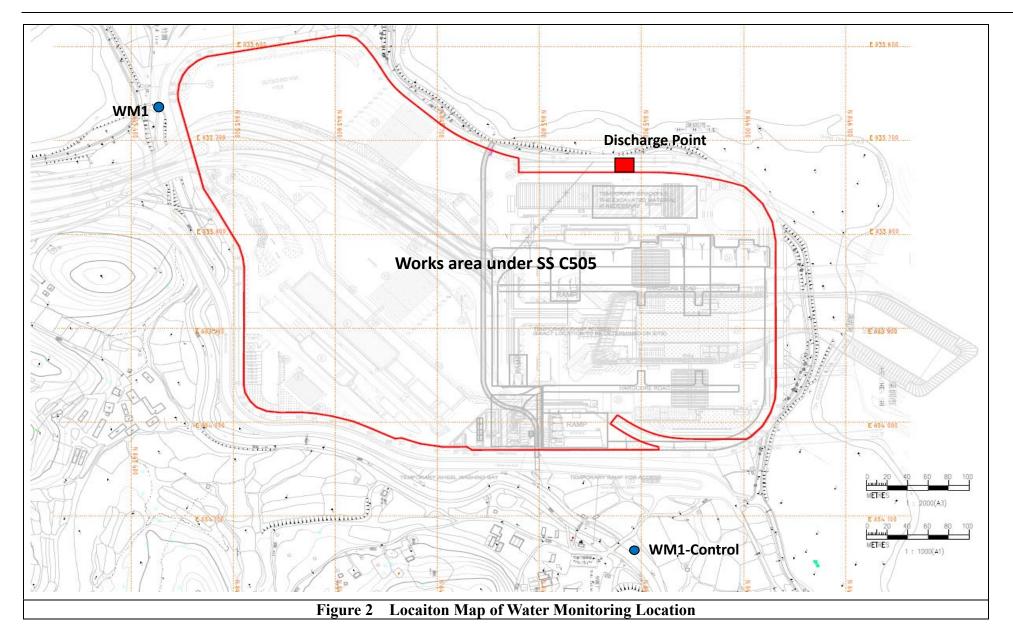



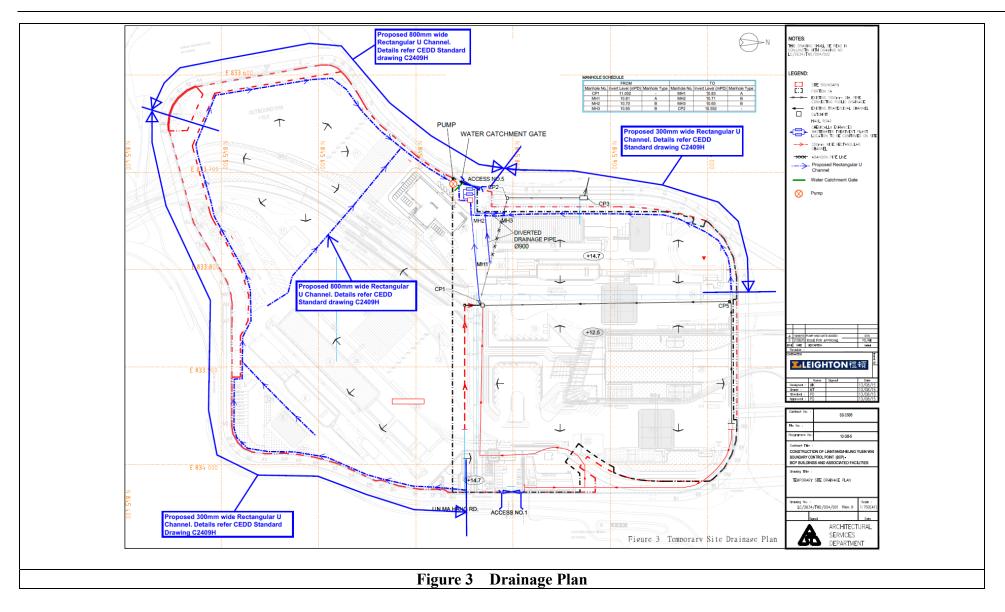





To Mr. Vincent Chan Fax No By e-mail

Company CRBC-CEC-Kaden JV

cc

From Nicola Hon Date 6 November 2017

Our Ref TCS00694/13/300/F1297a No of Pages 7 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report of Exceedance of Water Quality at Location WM2A(a) on 16,

17, 18 and 19 October 2017

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear Sir,

Further to the Notification of Exceedance (NOE) ref.:

TCS00694/13/300/F1280 dated 16 October 2017

TCS00694/13/300/F1285 dated 19 October 2017

TCS00694/13/300/F1291 dated 25 October 2017

TCS00694/13/300/F1300 dated 30 October 2017

Please find attached the "Investigation Report on Action or Limit Level Non-compliance" referenced above for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. Steve Lo (CE/BCP, NTEDO, CEDD)

Mr. Simon Leung (ER of C6/ AECOM)

Fax: 3547 1659

Mr. Antony Wong (IEC, SMEC)

Fax: 2251 0698

By email



Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works <u>Investigation Report on Action or Limit Level Non-compliance</u>

Project				CE	E 45/2008			
Date		16 Oct 2017	17 Oct 2017	18 Oct 2017	16 Oct 2017	17 Oct 2017	18 Oct 2017	19 Oct 2017
Location			•	W	M2A(a)			
Time		10:20	10:20	11:10	10:20	10:20	11:10	10:05
Parameter		Tur	bidity (NTU	J)	Suspended solids (mg/L)			
Action Level	l	24.9 AND 120% of upstream control station of the same day			14.6 AND 120% of upstream control station of the same day			
Limit Level		33.8 AND 130% of upstream			17.3 AND 130% of upstream control			
		control station of the same day			station of the same day			
Measured	WM2A-C	84.0	5.7	3.5	61.0	2.0	3.0	4.0
Levels	WM2A(a)	465.5	69.6	32.1	329.0	37.0	32.0	20.0
Exceedance		Limit	Limit	Action	Limit	Limit	Limit	Limit
Investigation	n Results,	Level 1. Accordi	Level	site inform	Level	Level	Level	Level
Recommendations & Mitigation Measures		Contract 6 (CCKJV), construction activities carried out on 16 to 19 October 2017 at Bridge D (upstream of WM2A(a)) were mainly bridge segment erection. The monitoring locations and works area are shown in <i>Figure 1</i> .						
		2. According to the site photo taken by the monitoring team on 16 October 2017, muddy water was observed throughout the river course including WM2A(a) and WM2A-C and there was heavy rainstorm during sampling. On 17 and 18 October 2017, muddy water observed at WM2A(a) whereas at WM2A-C was clear. On 19 October 2017, the water quality observed at both WM2A(a) and WM2A-C was both clear. (<i>Photo 1 to 8</i>)						
		3. According to the weather information from the Observatory, successive heavy rainstorm was recorded on 15 to 17 October 2017. The water quality throughout the river course was highly affected by the stirred up sediment and muddy runoff from the surrounding environment even outside the construction site. On 16 October 2017, muddy water was also observed at the upstream area and deflated of Nylon Dam was observed in which muddy water trapped in the dam was flowing to downstream. (<i>Photo 9</i>)						
		conduct the site inspecti- (a) Con	ed at Bridg environme on is summ astruction v	nspections a e D and adj ental perfor arized below works carrie	oin river commance, the w.	ourse in Oce observation	tober 201 on during was main	7 to audit g the site
		and (b) Def	no muddy lated of Nyldy water of	on and there runoff was or rlon Dam w lue to rain d stirred up	observed du as observed trapped in	ring the sit d on 12 and the dam w	e visit. d 26 Octo ould be f	ber 2017, lowing to



& 11)

- (c) The existing river water on observed on 12 October 2017 was slightly turbid even without the impact from the construction work. (*Photo 12*)
- (d) Wastewater treatment facilities were properly provided for Bridge D (*Figure 1*)
- (e) As water quality mitigation measures, the slope adjacent to river course was entirely covered with tarpaulin sheet and sand bags were placed along the construction area to avoid muddy runoff flowing to public area. (*Photo 13 and 14*)
- 5. In our investigation, CCKJC had implemented water mitigation measures such as providing temporary bund and tarpaulin sheet align the river course, there were no adverse water quality impact observed during the site inspection. Since the existing river water was found turbid even without adverse water impact of the site ad muddy water was also observed at upstream before water sampling on 16 October 2017, it is considered that the exceedances on 16 October 2017 was related to the rainstorm. For the exceedances on 17 to 19 October 2017, it is considered that the exceedances were due the residual impact after rain.
- 6. According to the Event and Action Plan, the frequency of water monitoring is increase to daily. Additional water quality monitoring were conducted on 20 and 21 October 2017 and no exceedances were recorded in both days. Nevertheless, the Contractor should continually implement the water mitigation measures as recommended in the implementation schedule for environmental mitigation measures in the EM&A Manual.

Prepared By:	Nicola Hon		
Designation:	Environmental Consultant		
Signature :	Aula		
Date:	6 November 2017		

Photo Record



Photo 1
On 16 October 2017, muddy water was observed at WM2A(a) and there was heavy rainstorm.



Photo 2On 16 October 2017, muddy water was observed at WM2A-C and there was heavy rainstorm.



Photo 3On 17 October 2017, muddy water was observed at WM2A(a).



Photo 4On 17 October 2017, the water quality observed at WM2A-C was clear.



Photo 5On 18 October 2017, muddy water was observed at WM2A(a).



Photo 6On 18 October 2017, the water quality observed at WM2A-C was clear.





Photo 7On 19 October 2017, the water quality observed at WM2A(a) was clear.

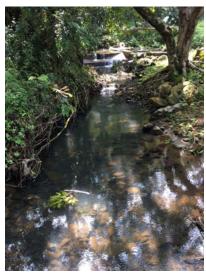


Photo 8On 19 October 2017, the water quality observed at WM2A-C was clear.



Photo 9Muddy water was also observed at the upstream area in early morning of 16 October 2017 due to the rainstorm.



During site inspection on 12 October 2017, deflated of Nylon Dam was observed, muddy water due to rain trapped in the dam would be flowing to downstream and stirred up the sediment at the river bed.

AUES



Photo 11

During site inspection on 26 October 2017, deflated of Nylon Dam was observed, muddy water due to rain trapped in the dam would be flowing to downstream and stirred up the sediment at the river bed.



Photo 12

During site inspection on 12 October 2017, it was observed that the existing river water was slightly turbid even without the impact from the construction work.



Photo 13

As water quality mitigation measures, the slope adjacent to river course was entirely covered with tarpaulin sheet.



Photo 14

As water quality mitigation measures, sand bags were placed along the construction area to avoid muddy runoff flowing to public area.



Figure 1 Location Map for Water Quality Monitoring Locations WM2A(a), WM2A-Control and work area under Contract





To Mr. Daniel Ho **Fax No 2638 7077**

Company Chun Wo Construction Ltd

cc

From Nicola Hon Date 2 November 2017

Our Ref TCS00670/13/300/F1299a No of Pages 7 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report of Exceedance of Water Quality at Location WM4 on 16 and 17

October 2017 (Contract 3)

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear Mr. Ho,

Further to the Notification of Exceedance (NOE) reference of the following.

TCS00670/13/300/F1281 dated 16 October 2017

TCS00670/13/300/F1286 dated 19 October 2017

TCS00670/13/300/F1292 dated 25 October 2017

Please find attached the "Investigation Report on Action or Limit Level Non-compliance" referenced above for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. Lu Pei Yu (CE/BCP, NTEDO, CEDD)

Mr. Alan Lee (ER of C3, AECOM)

Fax: 3547 1659

Fax: 2171 3498

Mr. Antony Wong (IEC, SMEC)

By e-mail



Investigation Report on Action or Limit Level Non-compliance

			GE 45/0	000	
Project		160 : 2017	CE 45/2		17.0 : 2017
Date		16 Oct 2017	17 Oct 2017	16 Oct 2017	17 Oct 2017
Location		11.55	WM4		0.27
Time		11:55	9:25	11:55	9:25
Parameter		Turbidity	<u>` </u>	Suspended So	
Action Level		35.2 AND 120% of upstream 39.4 AND 120% of up			•
ACTION LEVEL		control station of		control station of the same day	
Limit Level		38.4 AND 130% of upstream 45.5 AND 130% of u			•
	NVM 4 CA	control station of	•	control station of	· · · · · · · · · · · · · · · · · · ·
Measured	WM4-CA	8.2	8.9	5.5	5.0
Level	WM4-CB	18.1	9.9	11.0	6.0
Б. 1	WM4	130.5	92.4	77.0	58.0
Exceedance		Limit Level	Limit Level	Limit Level	Limit Level
Investigation	Results,	1. According to the			
Recommendat	tions &	C3 (Chun Wo),	the construction	activities carried	out on 16 and
Mitigation Me	easures	17 October 201	7 were mainly ger	neral site works su	ich as erection
				ion which the san	
		_		ould not genera	_
		wastewater.		6	· -
				1 575 16	1.17.0 . 1
		2. According to th			
				d at impact station	
		control station	WM4-CA, the	water quality at	the sampling
		location was ge	enerally clear but	t inflow of unkno	own source of
		muddy water v	was observed fro	om edge of the	channel. For
		_		CB, slightly turb	
				ereas the water qu	
			017. (Photo 1 to	•	arry was crear
			`	,	
				Chun Wo report	
			•	er attributed to site	
		muddy water w	as finally entered	l Ma Wat River an	d got detected
		at WM4. It v	vas suspected that	nt the muddy wat	er was via an
		underground pi	pe which connec	ting the box culve	ert in Kiu Tau
		Road (outside C	C3) to BC02 (unde	er Contract 3). (Ph	oto 7 & 8)
		4. Moreover, surp	rise site inspectio	n was carried out	by IFC on 17
				n regarding mudd	
				recorded. Chun W	-
				e of the concern	
				tarpaulin sheet to	minimize the
		muddy runoff. (Photo 9)		
		5. Joint site inspe	ction by the RE	E, IEC, Chun Wo	and ET was
		_	-	at the potential	
				findings of the	
		summarized bel		imanigo or tile	inspection the
				_	_
			-	was undertaken an	
		wastewater	was generated fro	om the construction	n site.
		(b) Muddy wat	er flowing via a	an underground p	oine from box
				tside C3) to BC02	
				er was unknown. (
		and the soul	co or muday wall	ci was anknown. (1 11010 10)



(c) Turbid discharge was observed from an AquaSed and it has been stopped by the Contractor immediately. The Contractor was requested to check the condition of the wastewater treatment facilities regularly and ensure the effluent was complied with the licence requirement. (Photo 11) (d) The water quality in the channel was generally in good condition. (Photo 12) (e) As water quality mitigation measures to minimize muddy runoff, the slope adjacent to the river course was covered with tarpaulin sheet. (Photo 13 & 14) 6. In our investigation, the deficiencies found during site inspection were rectified immediately. It was considered that the exceedances were mainly caused by the unknown source of muddy water attributed outside the site boundary and unlikely due to the works under Contract 3. 7. According to the Event and Action, the monitoring frequency at exceed station shall be increased to daily due to the limit level

consecutive days.

EM&A Manual.

exceedance recorded until no exceedances were triggered in

WM4 on 18 and 19 October 2017. However, the Contractor should continue to implement the environmental mitigation measures recommended in implementation schedule in the

There were no exceedances triggered at

Prepared By:

Designation:

Environmental Consultant

Signature:

2 November 2017



Photo Record



Photo 1

During water quality monitoring on 16 October 2017, turbid water was observed at WM4 and monitoring was carried out during rain.



Photo 2

During water quality monitoring on 16 October 2017, the water quality at WM4-CA was clear. However, inflow of unknown source of muddy water was observed from the edge of the channel.



Photo 3

During water quality monitoring on 16 October 2017, it was observed that the water quality at WM4-CB was slightly turbid.



Photo 4

During water quality monitoring on 17 October 2017, it was observed that the water quality at WM4 was slightly turbid.



Photo 5

During water quality monitoring on 17 October 2017, the water quality at WM4-CA was clear. However, inflow of unknown source of muddy water was observed from the edge of the channel.



Photo 6

During water quality monitoring on 17 October 2017, the water quality at WM4-CB was clear.





Photo 7

On 16 October 2017, Chun Wo reported to us that unknown source of muddy water attributed to site area and the muddy water was finally entered Ma Wat River and got detected at WM4. It was suspected that the muddy water was via an underground pipe which connecting the box culvert in Kiu Tau Road (outside C3) to BC02 (under Contract 3).



Photo 8

On 17 October 2017, Chun Wo reported to us that unknown source of muddy water attributed to site area and the muddy water was finally entered Ma Wat River and got detected at WM4. It was suspected that the muddy water was via an underground pipe which connecting the box culvert in Kiu Tau Road (outside C3) to BC02 (under Contract 3).



Photo 9

Surprise site inspection was carried out by IEC on 17 October 2017 and an observation regarding muddy runoff from construction site near BC02 was recorded. Chun Wo immediately enhanced the bund at the edge of the concern area and the covered entire expose slope with tarpaulin sheet to minimize the muddy runoff.



Photo 10

During site inspection on 18 October 2017, it was observed that muddy water flowing via an underground pipe from box culvert in Kiu Tau Road(outside C3) to BC02 and the source of muddy water was unknown.





Photo 11

During site inspection on 18 October 2017, turbid discharge was observed from an AquaSed and it has been stopped by the Contractor immediately. The Contractor was requested to check the condition of the wastewater treatment facilities regularly and ensure the effluent was complied with the licence requirement.



Photo 12

During site inspection on 18 October 2017, it was observed that the water quality in the channel was generally in good condition.



Photo 13

As water quality mitigation measures to minimize muddy runoff, the slope adjacent to the river course was covered with tarpaulin sheet.



Photo 14

As water quality mitigation measures to minimize muddy runoff, the slope adjacent to the river course was covered with tarpaulin sheet.

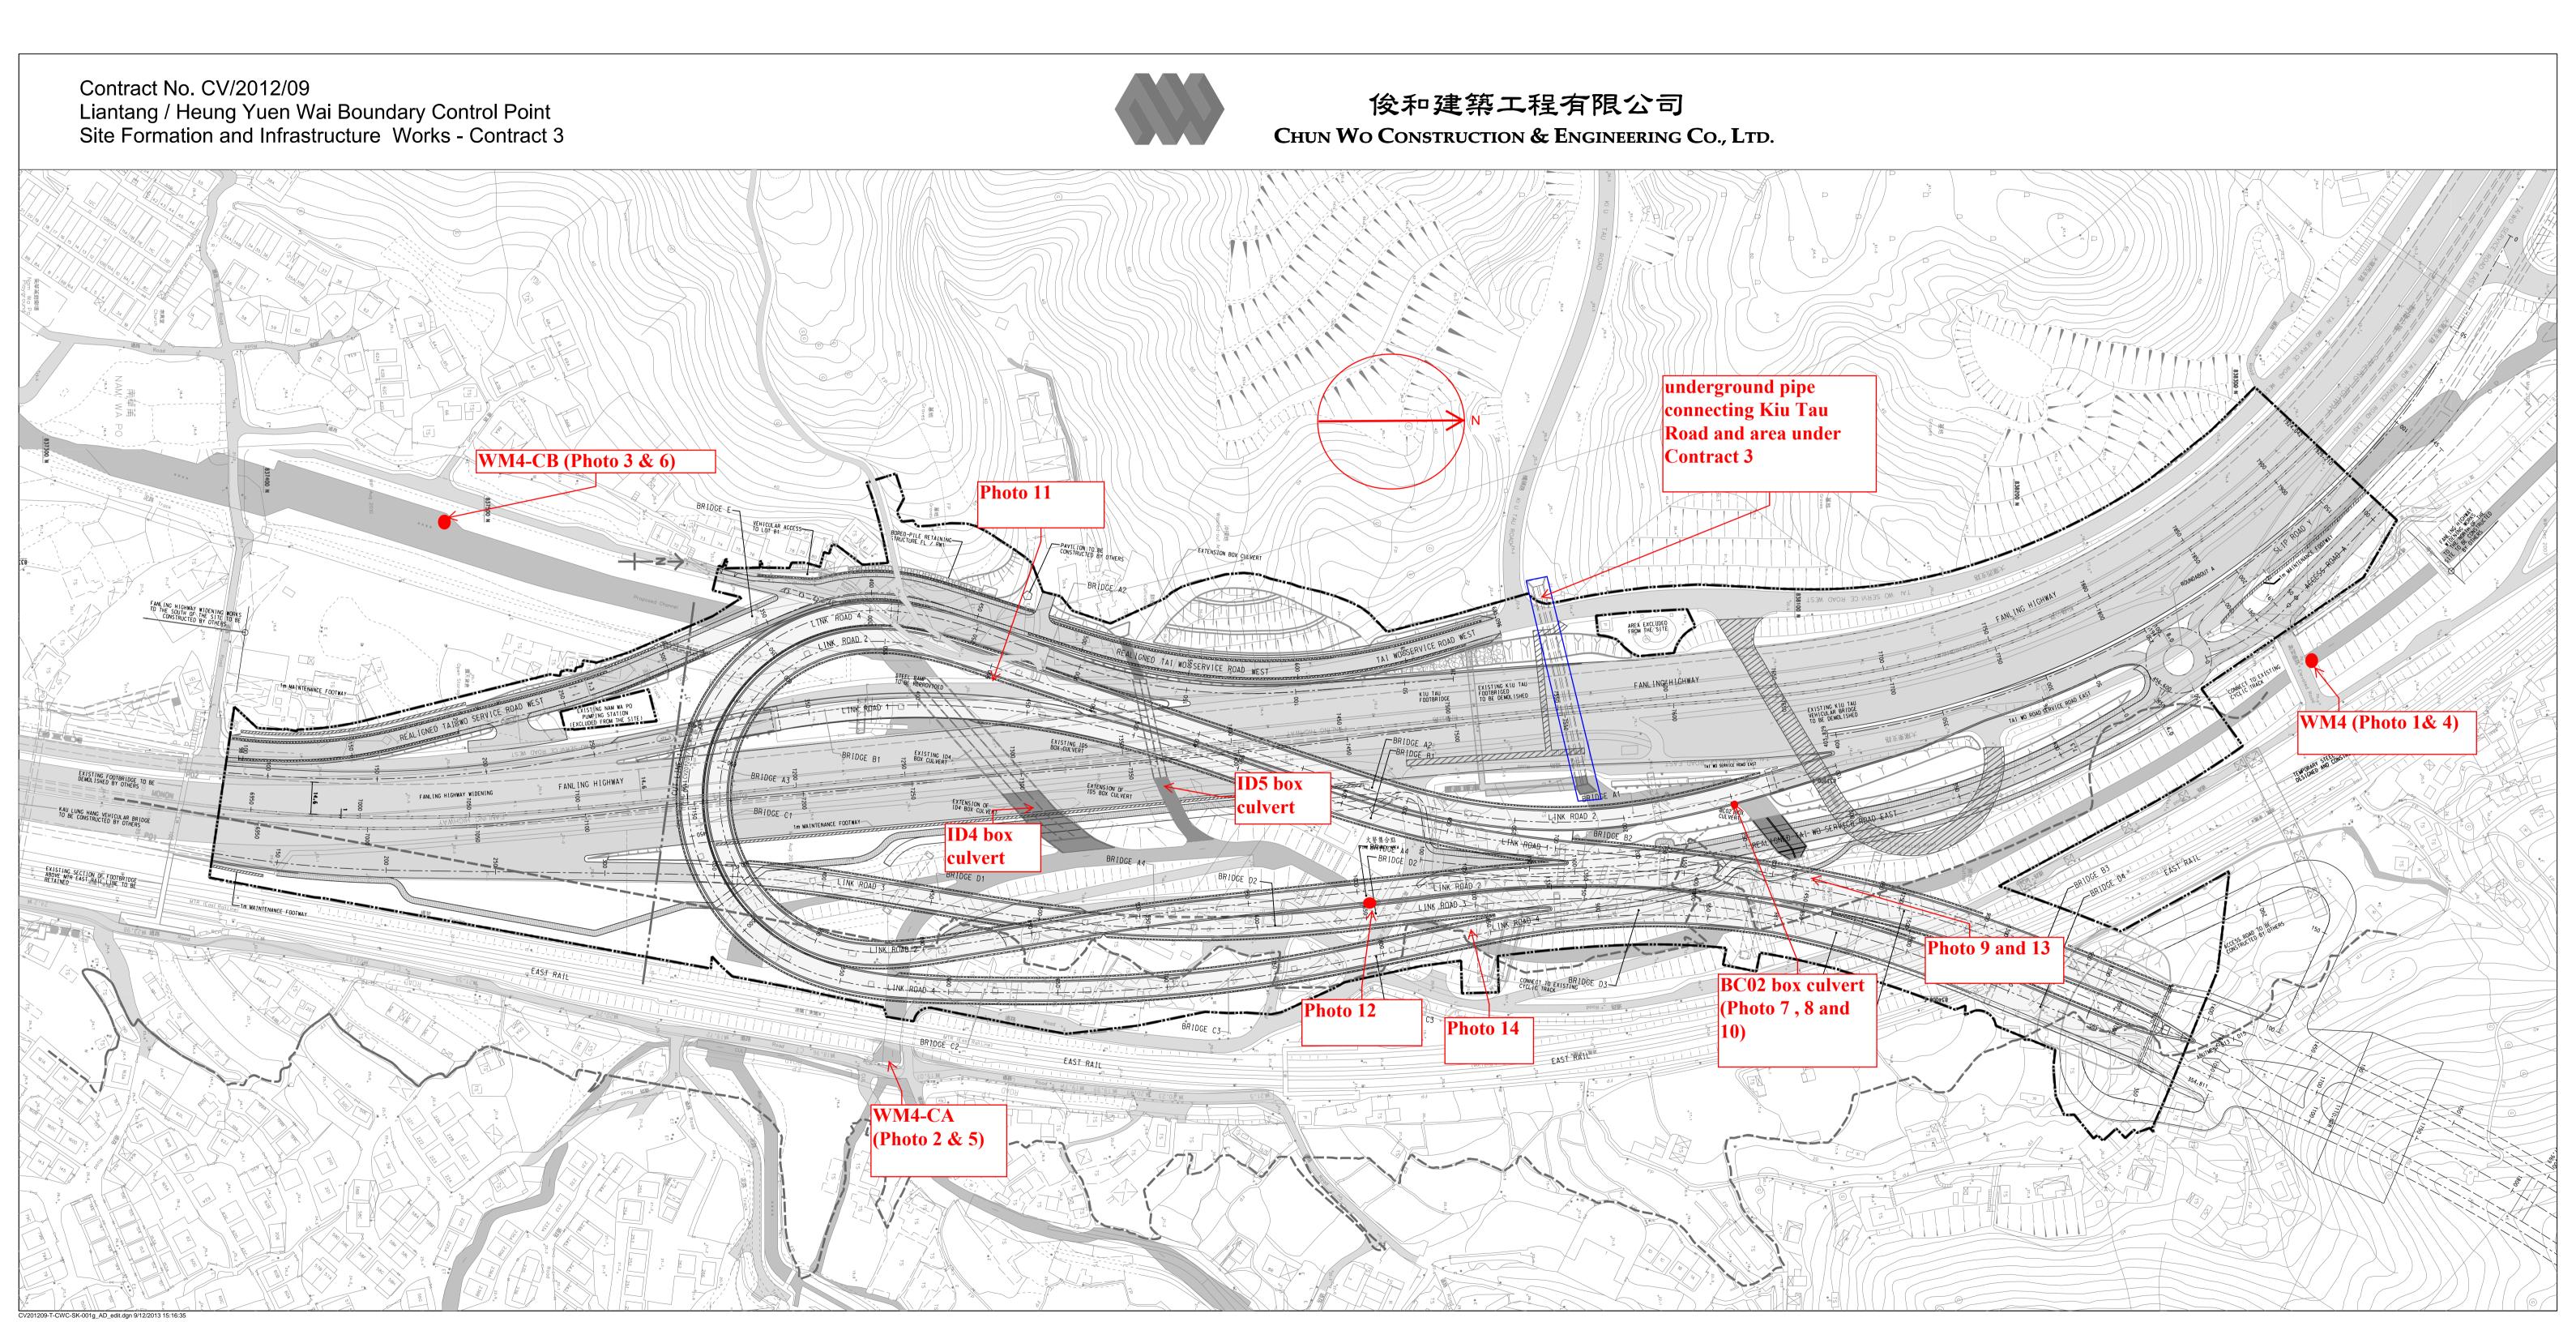


Figure 1. Location of Water Quality Monitoring Location



AUES

Fax Cover Sheet

To Mr. Roger Lee Fax No by e-mail

Company Dragages Hong Kong Limited

cc

From Nicola Hon Date 9 November 2017

Our Ref TCS00697/13/300/F1298a No of Pages 6 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report of Exceedance of Water Quality at Location WM4 on 16 and 17

October 2017 (Contract 2)

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear Mr. Lee,

Further to the Notification of Exceedance (NOE) reference of the following.

TCS00670/13/300/F1282 dated 16 October 2017

TCS00670/13/300/F1287 dated 19 October 2017

TCS00670/13/300/F1293 dated 25 October 2017

Please find attached the "Investigation Report on Action or Limit Level Non-compliance" referenced above for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. Raymond Leong (CE/BCP, NTEDO, CEDD/C2) Fax: 3547 1659
Mr. Edwin Ching (RE, AECOM) Fax: 2171 3498

Mr. Antony Wong (IEC, SMEC)

By e-mail



Agreement No. CE 45/2008 Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works Investigation Report on Action or Limit Level Non-compliance

Project		CE 45/2008				
Date		16 Oct 2017	17 Oct 2017	16 Oct 2017	17 Oct 2017	
Location			WM4	I		
Time		11:55	9:25	11:55	9:25	
Parameter		Turbid	ity (NTU)	Suspended	Solids (mg/L)	
A 41 T I		35.2 AND 120% of upstream control		39.4 AND 120% of upstream		
Action Level			the same day		of the same day	
Limit Level		38.4 AND 130% of upstream control		45.5 AND 130% of upstream		
Limit Level		station of	the same day	control station of the same day		
Maaguuad	WM4-CA	8.2	8.9	5.5	5.0	
Measured Level	WM4-CB	18.1	9.9	11.0	6.0	
Level	WM4	130.5	92.4	77.0	58.0	
Exceedance		Limit Level	Limit Level	Limit Level	Limit Level	
Investigation Results, Recommendations & Mitigation Measures		1. According to the site information provided by the Contractor of Contract 2 (DHK), construction activities carried out at South Portal Site (SP) on 16 and 17 October 2017 included tunnel and backfilling of spoil basin at SP tunnel and internal roof and slab construction for ventilation building. The construction site was generally hard paved to minimize muddy runoff.				
		2. According to the site photos taken by ET on 16 and 17 October 2017, turbid water was observed at impact station WM4. For control station WM4-CA, the water quality at the sampling location was generally clear but inflow of unknown source of muddy water was observed from edge of the channel. For another control station WM4-CB, slightly turbid water was observed at 16 October 2017 whereas the water quality was clear on 17 October 2017. (Photo 1 to 6)				
		3. On 16 and 17 October 2017, the Contractor of Contract 3 (Chun Wo) reported that unknown source of muddy water attributed to site area and the muddy water was finally entered Ma Wat River and got detected at WM4. It was suspected that the muddy water was via an underground pipe which connecting the box culvert in Kiu Tau Road (outside C3) to BC02 (under Contract 3). (Photo 7 & 8)				
		October 2017 site hoarding muddy water Follow up act sand bags to	rprise site inspection and observations reg in SP and getting to a from the wastewater ions were immediately prevent leakage from the sedimentation tan	arding muddy re existing channel treatment syster taken by DHK on the hoarding	and overflow of m were recorded. including deploy and decrease the	
		conducted or wastewater to	nt site inspection by n 20 and 27 Octobe reatment facilities im act 2 was functioned	r 2017. It wa plemented in S	as observed that South Portal Site	



- generally hard paved to minimize muddy runoff. No major water quality impact was observed adjacent to the river course.
- 6. In our investigation, the deficiencies found during site inspection were rectified immediately. It was considered that the exceedances were likely caused by the unknown source of muddy water attributed outside the site boundary and not related to the works under Contract 2.
- 7. According to the Event and Action, the monitoring frequency at exceed station shall be increased to daily due to the limit level exceedance recorded until no exceedances were triggered in consecutive days. There were no exceedances triggered at WM4 on 18 and 19 October 2017. However, the Contractor should continue to implement the environmental mitigation measures recommended in implementation schedule in the EM&A Manual.

Duananad Dr.	Nicole Hon
Prepared By:	Nicola Hon

Designation: Environmental Consultant

Signature :

Date: 9 November 2017



Photo Record



Photo 1

During water quality monitoring on 16 October 2017, turbid water was observed at WM4 and monitoring was carried out during rain.



Photo 2

During water quality monitoring on 16 October 2017, the water quality at WM4-CA was clear. However, inflow of unknown source of muddy water was observed from the edge of the channel.



Photo 3

During water quality monitoring on 16 October 2017, it was observed that the water quality at WM4-CB was slightly turbid.



Photo 4

During water quality monitoring on 17 October 2017, it was observed that the water quality at WM4 was slightly turbid.



Photo 5

During water quality monitoring on 17 October 2017, the water quality at WM4-CA was clear. However, inflow of unknown source of muddy water was observed from the edge of the channel.



Photo 6

During water quality monitoring on 17 October 2017, the water quality at WM4-CB was clear.

AUES



Photo 7

On 16 October 2017, Chun Wo reported to us that unknown source of muddy water attributed to site area and the muddy water was finally entered Ma Wat River and got detected at WM4. It was suspected that the muddy water was via an underground pipe which connecting the box culvert in Kiu Tau Road (outside C3) to BC02 (under Contract 3).



Photo 8

On 17 October 2017, Chun Wo reported to us that unknown source of muddy water attributed to site area and the muddy water was finally entered Ma Wat River and got detected at WM4. It was suspected that the muddy water was via an underground pipe which connecting the box culvert in Kiu Tau Road (outside C3) to BC02 (under Contract 3).



Photo 9

Surprise site inspection was carried out by IEC on 17 October 2017 and observation regarding muddy runoff through the site hoarding in SP was recorded. Follow up action was immediately taken by DHK including deploy sand bags to prevent leakage from the hoarding.



Photo 10

Surprise site inspection was carried out by IEC on 17 October 2017 and observations regarding muddy water from the wastewater treatment system were recorded. Follow up action was immediately taken by DHK including decrease the water level of the sedimentation tank.

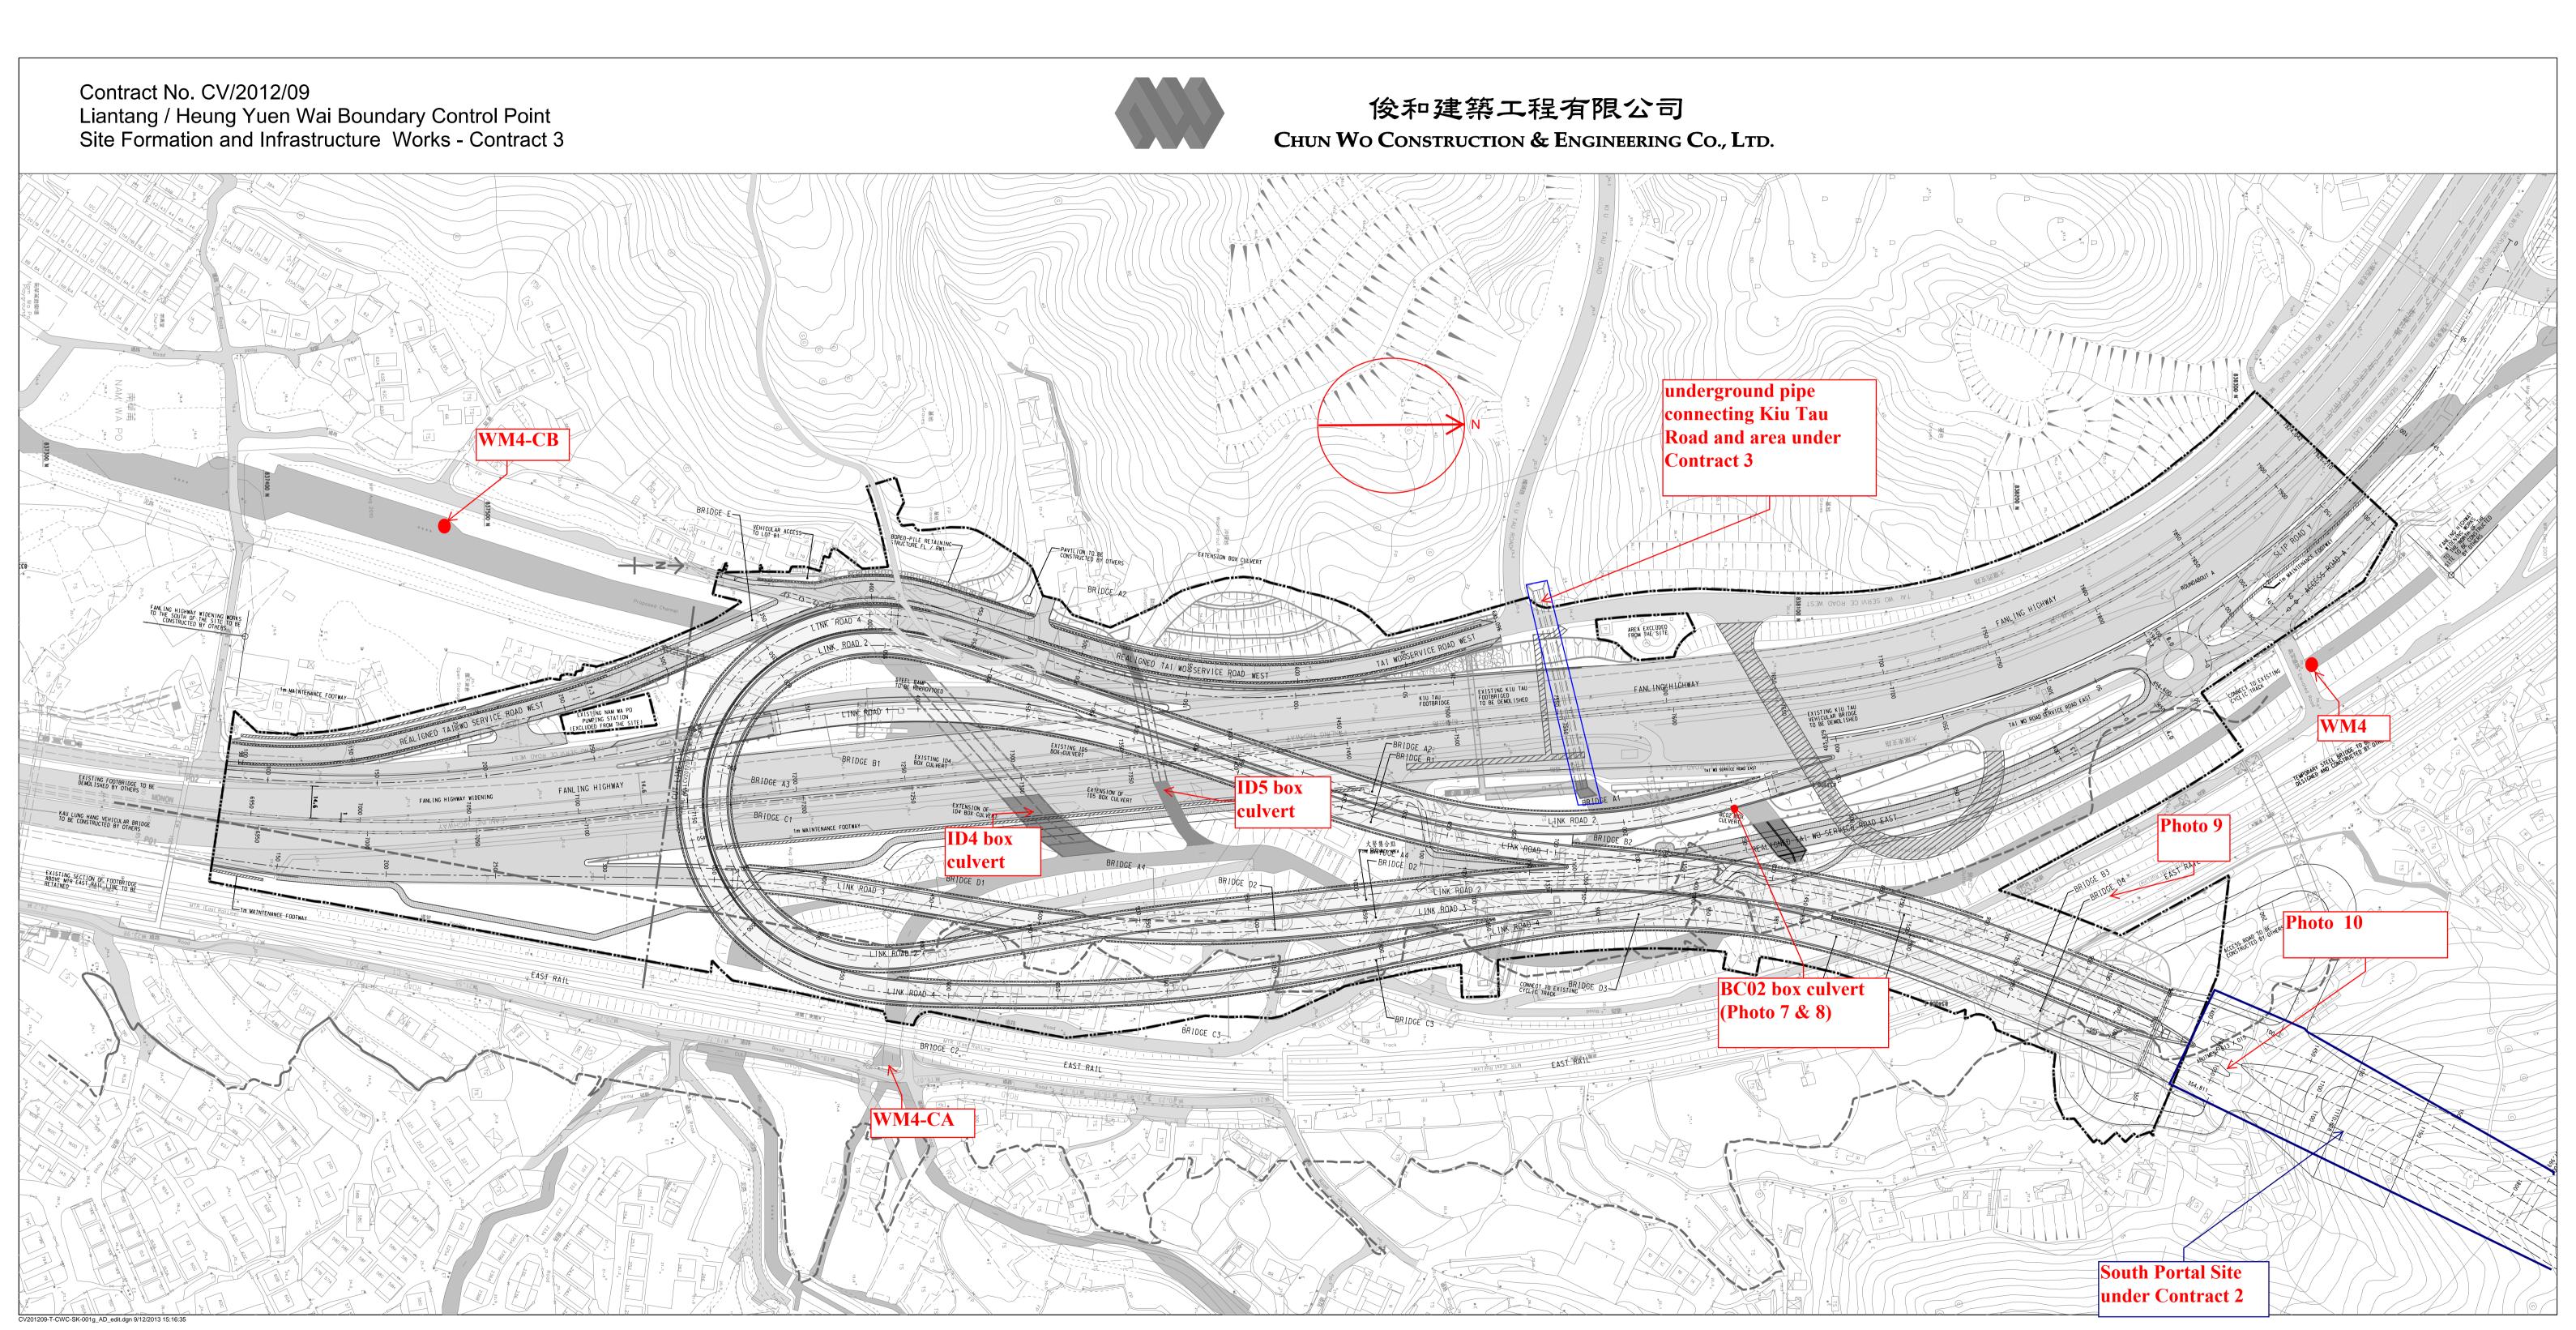


Figure 1. Location of Water Quality Monitoring Location

Appendix O

Investigation Report for Complaint



Fax Cover Sheet

To Mr. Vincent Chan Fax No By email

Company CRBC-CEC-Kaden JV

cc

From Nicola Hon Date 2 November 2017

Our Ref TCS00694/13/300/F1245d No of Pages 11 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works Investigation Report for Environmental Complaint of Cleanliness of Lin Ma Hang

Road

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear all,

Enclosed please find the investigation report for the captioned for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. Steve Lo (CE/BCP, NTEDO, CEDD)

Mr. Simon Leung (ER of C6, AECOM)

Mr. Antony Wong (IEC, SMEC)

Fax: 3547 1659

Fax: 2551 0698

By email

Investigation Report on Environmental Complaint / Enquires

Log No.	CE 45/2008 – 65		
Received Date by ET	8 September 2017		
Contract under Investigation	Contract 6		
Complaint Details	 Based on the complaint received on 30 August 2017 and supplementary information provided on 8 September 2017, the concerns of the complainant related to the EM&A issues are summarized below:- Large amount of dump trucks running on Lin Ma Hang Road causing dirt and debris accumulated on the road. The cleanliness of some construction site exits (especially for Bridge Construction Site) was unsatisfactory. Muddy water was found on Lin Ma Hang Road which suspected to be flowed from /seeped out of construction sites on Lin Ma Hang Road. The air quality of Lin Ma Hang Road was deteriorated by the construction work which affecting the nearby villagers. 		
Location	Lin Ma Hang Road (LMH Road)		
Date of Complaint	30 August 2017		
Environmental Aspect	Muddy water and Dust		
Complainant	undisclosed		
Complaint Route	Via Contract 6's Project Hotline		
Investigation Result	1. There were 3 works contracts along LMH Road namely, LT/C6 and LT/C7 under CEDD and Contract SS C505 under ASD, and the location plan is shown in <i>Figure 1</i> . This Investigation Report is prepared for LT/C6 to address the complainant concerns as described in "Complaint Details'. Upon receipt of the complaint, joint site inspection by RE, IEC, Contractor of C6 (CCKJV) and ET was carried out on 11 September 2017 along the LMH Road and all related construction site exits for complaint investigation. The observations during site inspection on 11 September 2017 are summarized in below. Concerns 1 and 2		
	Site Exit Gates 1 – 3 (for BCP Contract SS C505 and LT/C6)		
	 There were three vehicular site exits to access BCP works area, namely Gate 1, Gate 2 and Gate 3. While LT/C6 has some works in between LMH Road and the BCP Contract SS C505 site. All the three gates area shared by Contract SS C505 Contractor (Leighton) and LT/C6 Contractor. Gate 1 and Gate 2 are not in use most of the time. Whereas, Gate 3 is the main access currently maintained by SS C505 Contractor. 		
	3. Muddy trails were observed outside Gate 1 which a Grab Lorry was stopped at the entrance and silt was found on the footpath outside both Gates 1 and 2. (<i>Photo 1 & 2</i>) The arrangement of vehicle washing at Gates 1 and 2 was unclear and the condition of vehicle washing facilities should be improved. For Gate 3, wheel washing facilities was properly in place and no muddy trails, debris and muddy water were observed at the exit and adjoined LMH Road. (<i>Photo 3</i>)		
	Site Exit at Bridge Y		

Investigation Report on Environmental Complaint / Enquires

4. Vehicle washing facilities were provided for works area of Bridge Y. No muddy trails, debris and muddy water were observed at exit of Bridge Y and adjoined LMH Road. (*Photo 4 to 5*) However, at works area opposite to Bridge Y, silt and muddy water was observed at the site exit and footpath outside the exit. (*Photo 6*) CCKJV was requested to improve the cleanliness of site exit and properly maintain the vehicle washing facilities for that works area.

Site Exit at Bridge D (D08)

5. Vehicle washing facilities were provided for works area of Bridge D (D08), however, muddy trails were observed at the site exit and muddy water was found accumulated on the footpath after vehicle washing. (*Photo 7 & 8*) CCKJV was agreed to construct a bund at the site exit to prevent muddy water flowing from the site to public area.

Site Exit at Chuk Yuen Road

6. Vehicle washing facilities were provided for works area of Chuk Yuen Road. No muddy trails and debris and muddy water were observed at exit of Bridge Y and adjoined LMH Road. (*Photo 9 to 10*)

Site Exit at Bridge D

7. Vehicle washing facilities were provided for works area of Bridge D. A bund was provided at site exit to prevent wastewater from wheel washing flowing to the adjoined LMH Road. No muddy trails and debris and muddy water were observed at the exit of Bridge D and adjoined LMH Road. (*Photo 11 to 12*)

Arrangement of Water Tanker and Road Sweeper on LMH Road

8. LT/C6 has deployed water tanker continuously running along LMH Road in every normal working day as dust suppression measures. According to weekly site inspection records, no excessive muddy water due to road washing by water tanker was observed. (*Photo 13*) Since September 2017, road sweeper was also be deployed on LMH Road in order to remove debris and gravels on road surface and minimize generation of muddy water during rain. (*Photo 14*)

Concern 3

9. According to the observation during weekly site inspection, CCKJV has implemented air quality mitigation measures to minimize the dust impact to the public, such as water tanker has been deployed continuously along LMH Road to suppress the fugitive dust which generated during vehicular movement. Moreover, monitoring programme was executed under the project to closely monitor the air quality at the ASR and immediate action would be undertaken in case of exceedance. Having reviewed the air quality monitoring results in the last quarter, no exceedances were triggered at the air quality monitoring locations including AM1b, AM2a and AM3 which located near BCP and Lin Ma Hang Road. It is considered that the dust impact arising from the project was within acceptable level.

Investigation Report on Environmental Complaint / Enquires

Follow up action for Concerns 1 and 2

- 10. The deficiencies identified during the site inspection has been rectified by CCKJV and the follow up action as observed during site inspection on 26 October 2017 are summarized below:-
 - (a) Site accesses of Gates 1 & 2 were paved with concrete/ steel plate and wheel washing facilities including water jet was provided on the concrete ground near the site exit. (*Photo 15 & 16*) The site maintenance arrangements had agreed by both Contractors and they are summarized below and illustrated in *Annex A*.
 - (i) CCKJV and Leighton handle wheel washing for their own vehicles exit respectively at Gate 1 & 2 while Leighton handle wheel washing at Gate 3.
 - (ii) CCKJV placed concrete blocks at Gate 1 and 2 in front of BCP site exit. When the concrete blocks removed by Leighton to use Gate 1 & 2, wheel washing shall be provided by Leighton;
 - (iii) If the concrete blocks are in place at Gate 1 and 2, CCKJV shall maintain site exit and wheel washing issue.
 - (iv) At Gate 3, if muddy tracks are observed directly from the works area of C6 to Lin Ma Hang Road including the footpath, CCKJV should follow up.
 - (b) For site exit of Bridge D (D08), a bund was constructed at the exit to prevent muddy water flowing from the construction site and a warning sign for stop and carry out wheel washing was provided at the site exit. (*Photo 17*)
 - (c) For works area opposite to Bridge Y, the construction work with the concern area has been completed and the site exit was fenced off by barrier. (*Photo 18*)
- 11. In our investigation, the recent site inspection revealed that the condition of LMH Road has been improved and the deficiencies found on the site exits due to unclear arrangement had promptly rectified. Since the site arrangement is subject change all the time, the ET will keep closely inspect the site condition and cleanliness of adjoined roads in subsequent weekly site inspection.

Prepared By :	Nicola Hon			
Designation :	Environmental Consultant			
Signature :	Aul			
Date :	2 November 2017			

Photo Record



Photo 1 (Gate 1)

During site inspection on 11 September 2017, muddy trails were observed outside Gate 1 which a Grab Lorry was stopped at the entrance and silt was found at the footpath outside Gate1.



Photo 2 (Gate 2)

During site inspection on 11 September 2017, silt was found at the footpath outside Gate 2.



Photo 3 (Gate 3)

During the site inspection on 11 September 2017, wheel washing facilities was properly in place the main exit at Gate 3 and no muddy trails, debris and muddy water were observed.



Photo 4 (Bridge Y)

During the site inspection on 11 September 2017, wheel washing facilities including wheel washing bay and water jet were provided for works area of Bridge Y.



Photo 5 (Bridge Y)

During the site inspection on 11 September 2017, no muddy trails, debris and muddy water were observed at the exit of Bridge Y and adjoined LMH Road.



Photo 6 (opposite to Bridge Y)

At works area opposite to Bridge Y, silt and muddy water was observed at the site exit and footpath outside the exit.



Photo 7 (Bridge D (D08))

During the site inspection on 11 September 2017, muddy trails were observed at the site exit of Bridge D (D08)).



Photo 9 (Chuk Yuen Road)

During the site inspection on 11 September 2017, no muddy trails and debris and muddy water were observed at exit of Bridge Y and adjoined LMH Road.



Photo 11 (Bridge D)

During site inspection on 11 September 2017, wheel washing facilities was provided for works area of Bridge D and a bund was provided at site exit to prevent muddy water from wheel washing flowing to the adjoined LMH Road.

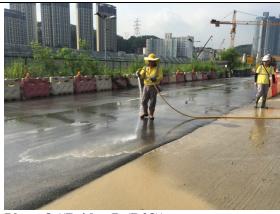


Photo 8 ((Bridge D (D08))

During the site inspection on 11 September 2017, wheel washing facilities was provided for works area of Bridge D (D08). However, muddy water was found accumulated on the footpath after washing of the site exit.



Photo 10 (Chuk Yuen Road)

During the site inspection on 11 September 2017, wheel washing facilities was provided for works area Chuk Yuen Road. No muddy trails and debris and muddy water were observed at the exit/



Photo 12 (Bridge D)

During site inspection on 11 September 2017, no muddy trails, debris and muddy water were observed at the exit of Bridge D and adjoined LMH Road.



Photo 13

During the regular site inspection, it was observed that the road surface of LMH Road was wetted by water bowsers to suppress fugitive dust.



Photo 15 (Gate 1)

During site inspection on 12 October 2017, it was observed that the site access of Gate 1 was paved with concrete and clear of mud and debris. Wheel washing facilities was provided on concrete ground near the site exit.



Photo 17 (Bridge D (D08))

A bund was constructed at the exit to prevent muddy water flowing from the construction site to public area. Moreover, a warning sign for stop and carry out wheel washing was provided at the site exit.



Photo 14

Since September 2017, road sweeper also deployed by CCKJV to enhance the road cleaning work in order to remove debris and gravels on road surface.



Photo 16 (Gate 2)

During site inspection on 12 October 2017, it was observed that the site access of Gate 2 was paved with concrete and clear of mud and debris. Wheel washing facilities was provided on concrete ground near the site exit.




Photo 18 (opposite to Bridge Y)


For works area opposite to Bridge Y, the construction work with the concern area has been completed and the site exit was fenced off by barrier




Figure 1 Location Plan for Site exits along Lin Ma Hang Road

GATE 1

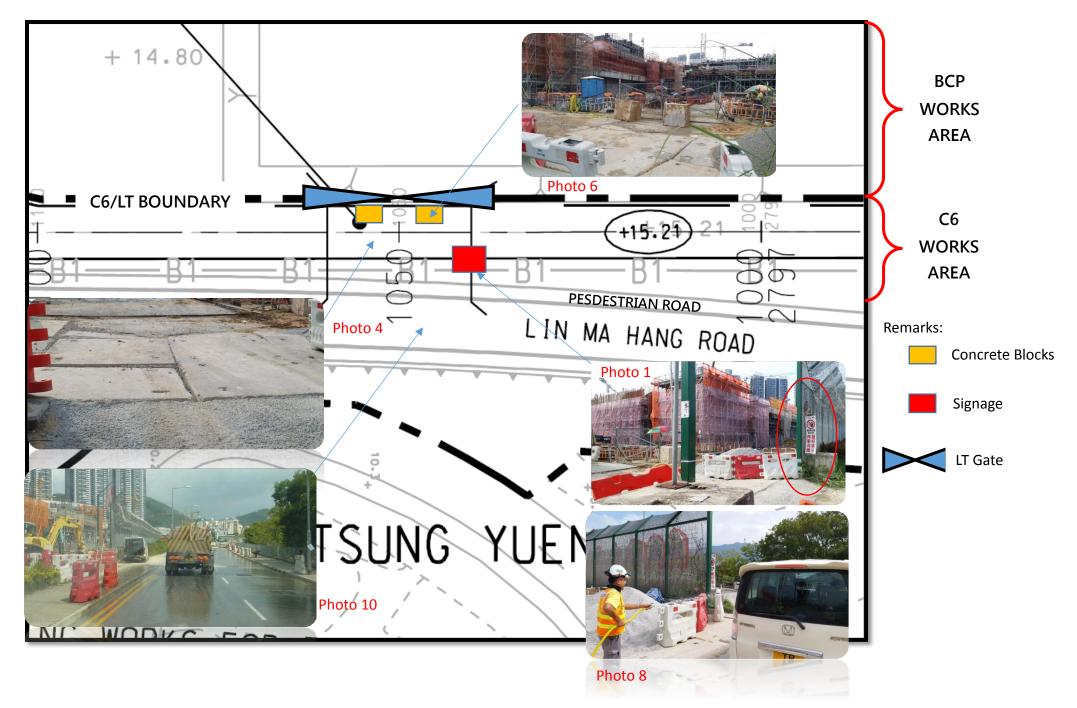

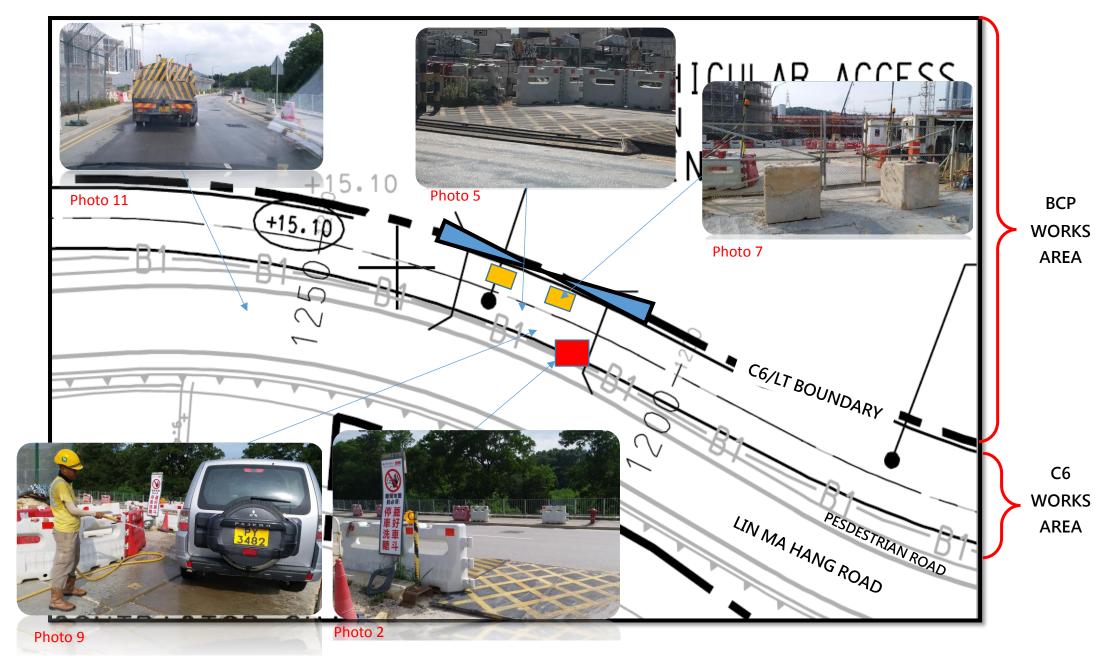

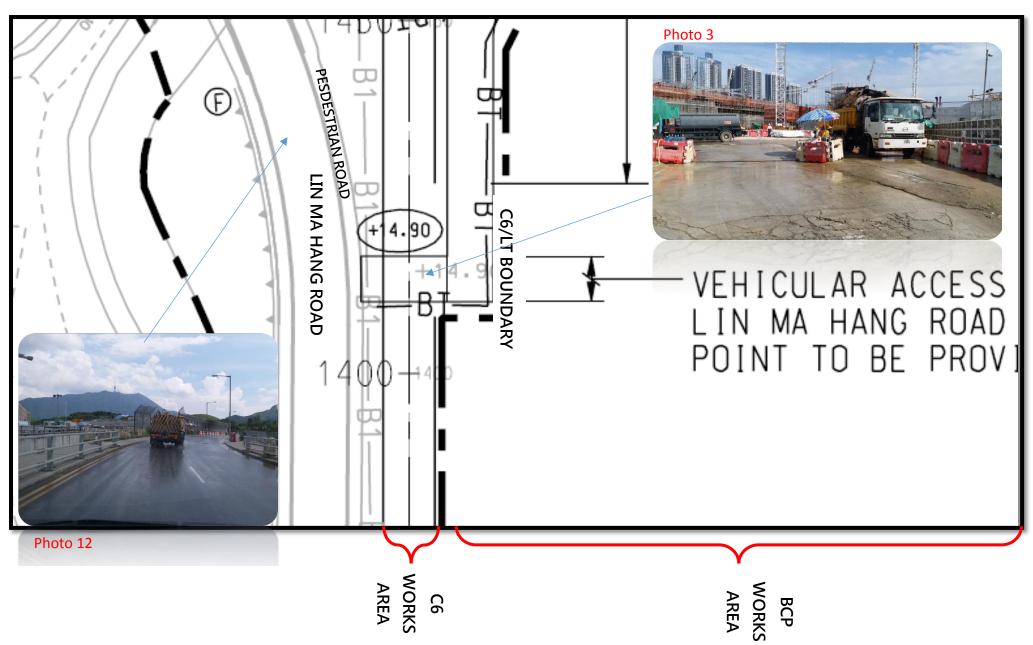



Fax Cover Sheet

To Mr. Jon Kitching Fax No 2752 0696

Company Leighton Contractors (Asia) Limited

cc

From Nicola Hon Date 6 November 2017

Our Ref TCS00769/15/300/F0224a No of Pages 9 (Incl. cover sheet)

RE Architectural Services Department (ArchSD) Contract No: SS C505

Construction of Liantang/Heung Yuen Wai Boundary Control Point (BCP) – BCP

Buildings and Associated Facilities

Investigation Report for Environmental Complaint of Cleanliness of Lin Ma Hang

Road

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear all,

Enclosed please find the investigation report for the captioned for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. William WL Cheng (ASD)

Mr. Justin Cheung (Ronald Lu)

Mr. Antony Wong (IEC, SMEC)

Mr. Simon Leung (ER, AECOM)

By e-mail

By e-mail

By e-mail

Architectural Services Department (ArchSD) Contract No: SS C505 Construction of Liantang/Heung Yuen Wai Boundary Control Point (BCP) – BCP Buildings and Associated Facilities

Log No.	SS C505 – 01	
Received Date by ET	8 September 2017	
Related Contract under Investigation	Contract SS C505	
Complaint Details	Based on the complaint received on 30 August 2017 and supplementary information provided on 8 September 2017, the concerns of the complainant related to the EM&A issues are summarized below: 1. Large amount of dump trucks running on Lin Ma Hang Road causing dirt and debris accumulated on the road. The cleanliness of some construction site exits (especially for Bridge Construction Site) was unsatisfactory. 2. Muddy water was found on Lin Ma Hang Road which suspected to be flowed from /seeped out of construction sites on Lin Ma Hang Road. 3. The air quality of Lin Ma Hang Road was deteriorated by the construction work which affecting the nearby villagers.	
Location	Lin Ma Hang Road (LMH Road)	
Date of Complaint	30 August 2017	
Environmental Aspect	Muddy water and Dust	
Complainant	undisclosed	
Complaint Route	Via CEDD Project Hotline	
Investigation Result	1. There were 3 works contracts along LMH Road namely, LT/C6 and LT/C7 under CEDD and Contract SS C505 under ASD, and the location plan is shown in <i>Figure 1</i> . This Investigation Report is prepared for Contract SS C505 to address the complainant concerns as described in "Complaint Details'. Upon receipt of the complaint, joint site inspection by RE, IEC and ET was carried out on 11 September 2017 along the LMH Road and all related construction site exits for complaint investigation. The observations during site inspection on 11 September 2017 are summarized in below.	
	Concerns 1 and 2	
	Site Exit Gates 1 – 3 (for BCP Contract SS C505 and LT/C6)	
	2. There were three vehicular site exits to access BCP works area, namely Gate 1, Gate 2 and Gate 3. While LT/C6 has some works in between LMH Road and the BCP Contract SS C505 site. All the three gates area shared by Contract SS C505 Contractor (Leighton) and LT/C6 Contractor. Gate 1 and Gate 2 are not in use most of the time. Whereas, Gate 3 is the main access currently maintained by SS C505 Contractor.	
	3. Muddy trails were observed outside Gate 1 which a Grab Lorry was stopped at the entrance and silt was found on the footpath outside both Gates 1 and 2. (<i>Photo 1 & 2</i>) The arrangement of vehicle washing at Gates 1 and 2 was unclear and the condition of vehicle washing facilities should be improved. For Gate 3, wheel washing facilities was properly in place and no muddy trails, debris and muddy water were observed at the exit and adjoined LMH Road. (<i>Photo 3</i>)	

Architectural Services Department (ArchSD) Contract No: SS C505 Construction of Liantang/Heung Yuen Wai Boundary Control Point (BCP) – BCP Buildings and Associated Facilities

Investigation Report on Environmental Complaint / Enquires

Arrangement of Water Tanker and Road Sweeper on LMH Road

4. Contract SS C505 has deployed water tanker continuously running along LMH Road in every normal working day as dust suppression measures. According to weekly site inspection records, no excessive muddy water due to road washing by water tanker was observed. (*Photo 4*) Moreover, Since September 2017, LT/C6 has been deployed been road sweeper on LMH Road in order to remove debris and gravels on road surface and minimize generation of muddy water during rain.

Concern 3

5. According to the observation during weekly site inspection, Leighton has implemented air quality mitigation measures to minimize the dust impact to the public, such as water tanker has been deployed continuously along LMH Road to suppress the fugitive dust which generated during vehicular movement. Moreover, monitoring programme was executed under the project to closely monitor the air quality at the ASR and immediate action would be undertaken in case of exceedance. Having reviewed the air quality monitoring results in the last quarter, no exceedances were triggered at the air quality monitoring locations including AM1b, AM2a and AM3 which located near BCP and Lin Ma Hang Road. It is considered that the dust impact arising from the project was within acceptable level.

Follow up action for Concerns 1 and 2

- 6. The deficiencies identified during the site inspection has been rectified by LT/C6 and the follow up action as observed during site inspection on 26 October 2017 are summarized below:-
 - (a) Site accesses of Gates 1 & 2 were paved with concrete/ steel plate and wheel washing facilities including water jet was provided on the concrete ground near the site exit. (*Photo 5 & 6*) The site maintenance arrangements had agreed by both Contractors and they are summarized below and illustrated in *Annex A*.
 - (i) CCKJV and Leighton handle wheel washing for their own vehicles exit respectively at Gate 1 & 2 while Leighton handle wheel washing at Gate 3.
 - (ii) CCKJV placed concrete blocks at Gate 1 and 2 in front of BCP site exit. When the concrete blocks removed by Leighton to use Gate 1 & 2, wheel washing shall be provided by Leighton;
 - (iii) If the concrete blocks are in place at Gate 1 and 2, CCKJV shall maintain site exit and wheel washing issue.
 - (iv) At Gate 3, if muddy tracks are observed directly from the works area of C6 to Lin Ma Hang Road including the footpath, CCKJV should follow up.
- 7. In our investigation, the recent site inspection revealed that the condition of LMH Road has been improved and the deficiencies found

Architectural Services Department (ArchSD) Contract No: SS C505 Construction of Liantang/Heung Yuen Wai Boundary Control Point (BCP) – BCP Buildings and Associated Facilities

	on the site exits due to unclear arrangement had promptly rectified. Since the site arrangement is subject change all the time, the ET will keep closely inspect the site condition and cleanliness of adjoined roads in subsequent weekly site inspection.	
Prepared By : Designation :	Nicola Hon Environmental Consultant	
Signature :	Aula	
Date:	6 November 2017	_ _

Photo Record



Photo 1 (Gate 1)

During site inspection on 11 September 2017, muddy trails were observed outside Gate 1 which a Grab Lorry was stopped at the entrance and silt was found at the footpath outside Gate1.



Photo 2 (Gate 2)

During site inspection on 11 September 2017, silt was found at the footpath outside Gate 2.



Photo 3 (Gate 3)

During the site inspection on 11 September 2017, wheel washing facilities was properly in place the main exit at Gate 3 and no muddy trails and debris were observed.



Photo 4

During the regular site inspection, it was observed that the road surface of LMH Road was wetted by water bowsers to suppress fugitive dust.



Photo 5 (Gate 1)

During site inspection on 12 October 2017, it was observed that the site access of Gate 1 was paved with concrete and clear of mud and debris. Wheel washing facilities was provided on concrete ground near the site exit.




Photo 6 (Gate 2)


During site inspection on 12 October 2017, it was observed that the site access of Gate 2 was paved with concrete and clear of mud and debris. Wheel washing facilities was provided on concrete ground near the site exit.




Figure 1 Location Plan for Site exits along Lin Ma Hang Road

GATE 1

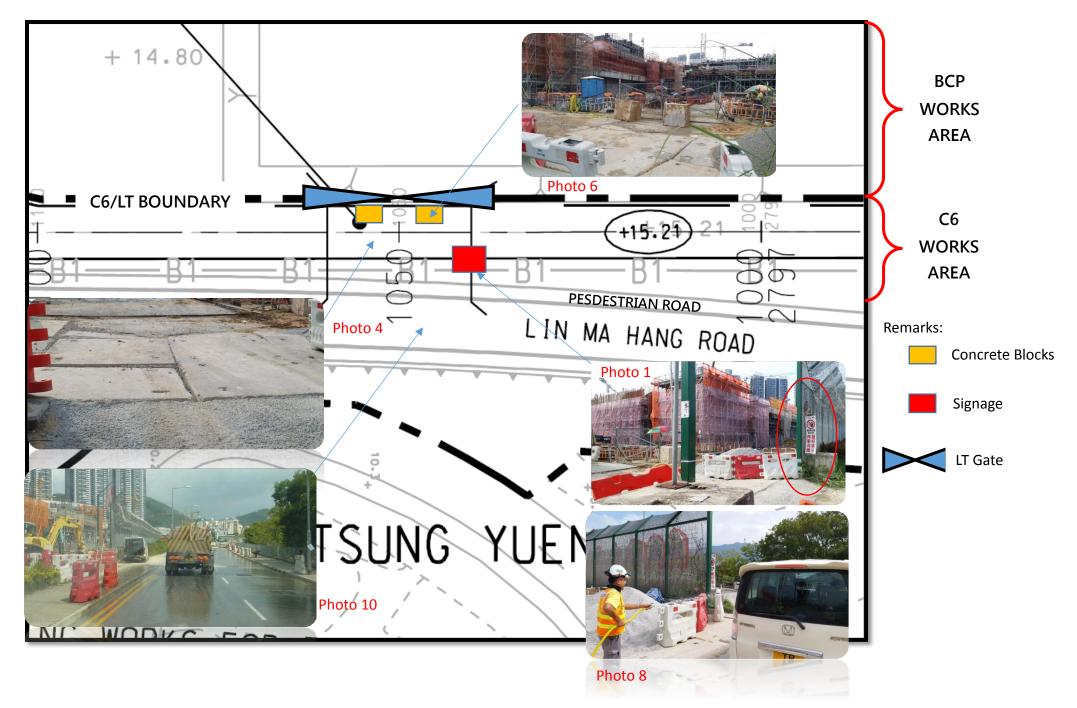

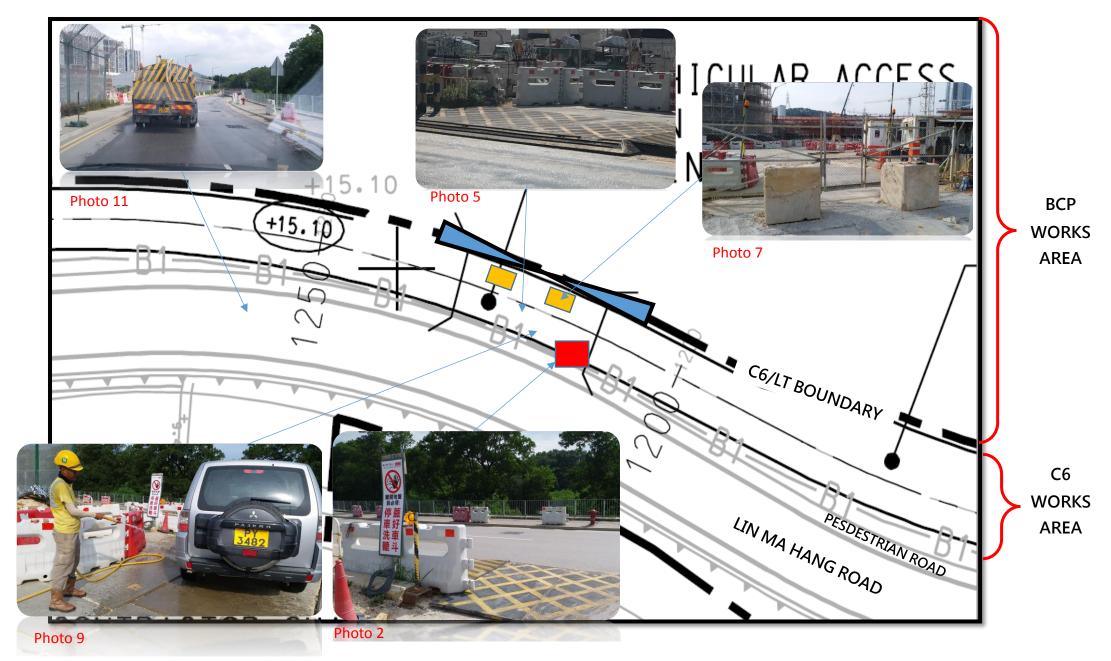

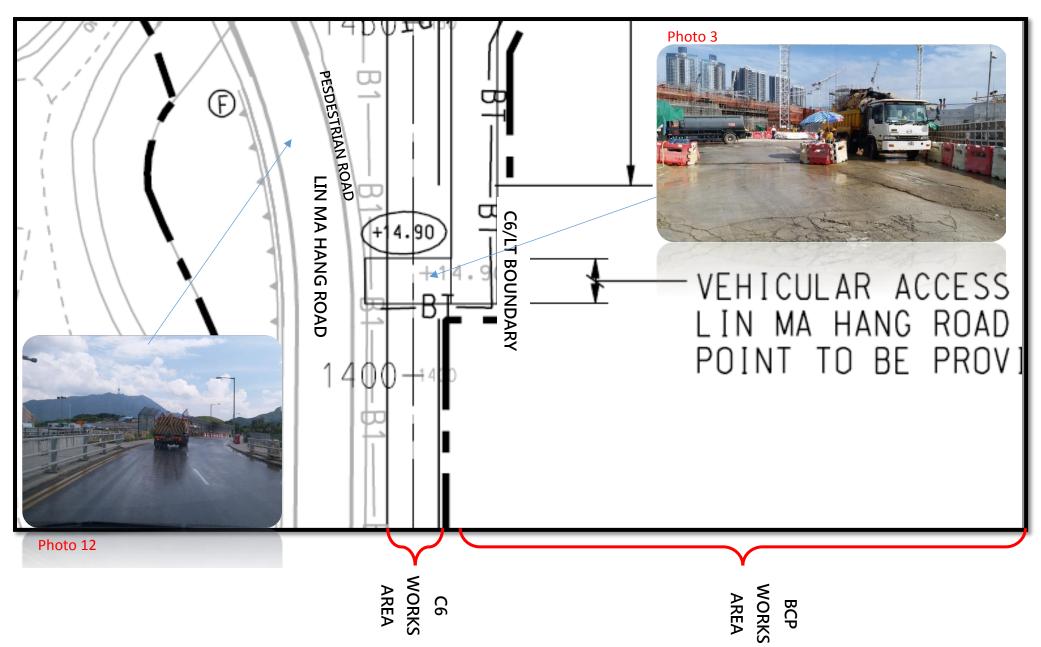



Fax Cover Sheet

To Mr. Matthew Tsang Fax No By email

Company KRSJV

cc

From Nicola Hon Date 9 November 2017

Our Ref TCS00694/13/300/F1289a No of Pages 5 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works Investigation Report for Environmental Complaint of Cleanliness of Lin Ma Hang

Road (Contract 7)

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear all.

Enclosed please find the investigation report for the captioned for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. Michael Chan (CE/BCP, NTEDO, CEDD)

Mr. Simon Leung (ER of C6 and C7, AECOM)

Mr. Antony Wong (IEC, SMEC)

Fax: 3547 1659

Fax: 2551 0698

By email

Log No.	CE 45/2008 – 66	
Received Date by ET	8 September 2017	
Related Contract under Investigation	_	
Complaint Details	Based on the complaint received on 30 August 2017 and supplementary information provided on 8 September 2017, the concerns of the complainant related to the EM&A issues are summarized below:- 1. Large amount of dump trucks running on Lin Ma Hang Road causing dirt and debris accumulated on the road. The cleanliness of some construction site exits (especially for Bridge Construction Site) was unsatisfactory. 2. Muddy water was found on Lin Ma Hang Road which suspected to be flowed from /seeped out of construction sites on Lin Ma Hang Road. 3. The air quality of Lin Ma Hang Road was deteriorated by the construction work which affecting the nearby villagers.	
Location	Lin Ma Hang Road (LMH Road)	
Date of Complaint	30 August 2017	
Environmental Aspect	Muddy water and Dust	
Complainant	undisclosed	
Complaint Route	Via Contract 6's Project Hotline	
Investigation Result	1. There were 3 works contracts along LMH Road namely, LT/C6 and LT/C7 under CEDD and Contract SS C505 under ASD, and the location plan is shown in <i>Figure 1</i> . This Investigation Report is prepared for LT/C7 to address the complainant concerns as described in "Complaint Details'. Upon receipt of the complaint, joint site inspection by RE, IEC, Contractor of C7 (KRSJV) and ET was carried out on 14 September 2017 along the LMH Road and all related construction site exits for complaint investigation. The observations during site inspection on 14 September 2017 are summarized in below.	
	Concerns 1 and 2	
	Site Exit under Contract 7	
	2. There was only one vehicular site exit under Contract 7 to access BCP works area. Wheel washing facilities including water jet were provided at exit site and wheel washing was carried out on a concrete ground before leaving the site. However, it was observed that muddy water accumulated on cracks of the concrete ground and muddy trails were observed at site exit the adjoined Lin Ma Hang Road. (<i>Photo 1 & 2</i>) KRSJV advised that interim mitigation measures would be implemented by the Contractor before completion of the wheel washing facilities modification works in mid-October 2017.	
	3. Subsequent site inspection was conducted by ET on 15, 19 and 29 September 2017 as well as 6 October 2017 to inspect the condition of the site exit. It was observed that the wheel washing facilities moved backward from the public area and wheel washing was carried out on the steel plates to keep away from mud on the ground. No muddy	

Investigation Report on Environmental Complaint / Enquires

trails and debris was observed at the site exit and adjoined LMH Road. (*Photo 3 to 6*)

Concern 3

4. According to the observation during weekly site inspection, KRSJV has implemented air quality mitigation measures to minimize the dust impact arising from the contract works, such as water spraying on haul road to suppress the fugitive dust. (*Photo 7*) Moreover, monitoring programme was executed under the project to closely monitor the air quality at the ASR and immediate action would be undertaken in case of exceedance. Having reviewed the air quality monitoring results in the last quarter, no exceedances were triggered at the air quality monitoring locations including AM1b, AM2a and AM3 which located near BCP and Lin Ma Hang Road. It is considered that the dust impact arising from the project was within acceptable level.

Follow up action for Concerns 1 and 2

- 5. Joint site inspection was carried out on 17 October 2017 to inspect the latest condition of site exits and LMH Road. It was observed that wheel washing facilities had been modified. The site access of Contract 7 was entirely paved with concrete and wheel washing facilities was provided on concrete ground near the site exit. The wastewater from wheel washing was diverted to a sedimentation tank. (*Photo 8 & 9*) No muddy trails were observed at the site exit and the condition of site exit was satisfactory. (*Photo 10*)
- 5. In our investigation, the recent site inspection revealed that the condition of LMH Road has been improved and the deficiencies found on the site exits had promptly rectified. Since the site arrangement is subject change all the time, the ET will keep closely inspect the site condition and cleanliness of adjoined roads in subsequent weekly site inspection.

Prepared By:	Nicola Hon
Designation:	Environmental Consultant
Signature :	Aula
Date:	9 November 2017

Photo Record



Photo 1

During site inspection on 14 September 2017, wheel washing facilities including water jet were provided at exit site and wheel washing was carried out on a concrete ground before leaving the site. However, it was observed that muddy water muddy accumulated on cracks of the concrete ground.



Photo 2

During site inspection on 14 September 2017, it was observed that muddy trails were observed at site exit the adjoined Lin Ma Hang Road.



Photo 3

During site inspection on 15 September 2017, no muddy trails and debris was observed at the site exit and adjoined LMH Road.



Photo 4

During site inspection on 19 September 2017, no muddy trails and debris was observed at the site exit and adjoined LMH Road.



Photo 5

During site inspection on 29 September 2017, no muddy trails and debris was observed at the site exit and adjoined LMH Road.



Photo 6

During site inspection on 6 October 2017, no muddy trails and debris was observed at the site exit and adjoined LMH Road.



Photo 7

According to the observation during weekly site inspection, KRSJV has implemented air quality mitigation measures to minimize the dust impact arising from the contract works, such as water spraying on haul road to suppress the fugitive dust



Photo 9

The wastewater from wheel washing was diverted to a sedimentation tank.



Photo 8

During site inspection on 17 October 2017, it was observed that the site access of Contract 7 was entirely paved with concrete and wheel washing facilities was provided on concrete ground near the site exit.



Photo 10

No muddy trails were observed at the site exit and the condition of site exit was satisfactory.



Figure 1 Location Plan for Site exits along Lin Ma Hang Road



Fax Cover Sheet

To Mr. Vincent Chan Fax No By email

Company CRBC-CEC-Kaden JV

cc

From Nicola Hon Date 13 November 2017

Our Ref TCS00694/13/300/F1308a No of Pages 7 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works Investigation Report for Environmental Complaint of Cleanliness of Lin Ma Hang

Road

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear all,

Enclosed please find the investigation report for the captioned for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Ms. Clara U (EPD) Fax: 2685 1133

Mr. Steve Lo (CE/BCP, NTEDO, CEDD) Fax: 3547 1659 Mr. Simon Leung (ER of C6, AECOM) Fax: 2551 0698

Mr. Antony Wong (IEC, SMEC)

By email

Log No.	CE 45/2008 – 67	
Received Date by ET	26 October 2017	
Contract under Investigation	Contract 6	
Complaint Details	投訴人投訴打鼓嶺警署對出蓮麻坑路(向蓮麻坑,約一公里)正進行工程, 指有關地盤有不同的出入口,每當有大泥頭車進出便有沙塵及沙泥弄髒 附近道路。投訴人亦表示有關人士會派員灑水,但灑出的水會混集沙泥 積於地下,再有車駛過時便會濺起污水,影響環衛衛生。	
Location	Lin Ma Hang Road (LMH Road)	
Date of Complaint	The complaint was received by 1823 on 23 September 2017 and referred to AECOM on 25 October 2017	
Environmental Aspect	Muddy water and Dust	
Complainant	undisclosed	
Complaint Route	Via 1823	
Investigation Result	1. A public complaint was received via 1823 on 23 September 2017 as described in "Complaint Details". The complaint location is shown in <i>Figure 1</i> .	
	2. Joint site inspection by RE, IEC, Contractor of C6 (CCKJV) and ET was carried out on 2 November 2017 along the concerned section of LMH Road and construction site exits for complaint investigation. The observations during site inspection are summarized in below.	
	(a) Starting from Ta Kwu Ling Police Station towards Lin Ma Hang, there were 6 unknown site exits found along LMH Road which all not belong to any Contracts of LT/HYW Project. The condition of these site exit and adjoined LMH road was dusty in which mud and debris were found. The maintenance party/ ownership of these site exits are unknown. (<i>Photo 1 to 6</i>)	
	(b) There were 3 vehicle site exits under LT/C6, namely "Bridge D", "Chuk Yuen Road" and "Bridge Y", along concern section of LMH Road. For these three site exits, wheel washing facilities were provided and properly maintained by CCKJV to avoid carrying of dust and soil to public road by site vehicles. The wastewater generated from wheel washing was directed to catchpit/ AquaSed for de-silting. Moreover, waning sign was erected to remind the drivers to stop and wash the vehicle prior leaving the site. The condition of these site exit and adjoined LMH road was satisfactory without mud and debris. (<i>Photo 7 to 12</i>)	
	(c) CCKJV has deployed water tanker continuously running along LMH Road in every normal working day as dust suppression measures. Moreover, road sweeper would also deploy on LMH Road in order to remove debris and gravels on road surface and minimize generation of muddy water during rain. No over-water spraying and excessive water was observed after road washing (<i>Photo 13 to 14</i>) The route of water tanker and road sweeper are fully covered the works area of LT/C6 which shown in <i>Figure 1</i> .	

- 3. In addition, monitoring programme was executed under the project to closely monitor the air quality at the air sensitive receivers and immediate action would be undertaken in case of exceedance. Having reviewed the air quality monitoring results in the recent quarter of August to October 2017, no exceedances were triggered at the air quality monitoring locations including AM2 and AM3 which located along Lin Ma Hang Road. It is considered that the dust impact arising from the project was within acceptable level.
- 4. In our investigation, CCKJV has implemented dust mitigation measures to control the dust generated under the Project. Since there were many other heavy vehicle apart from the project using LMH Road and the condition of the unknown site exits was dusty with mud and debris found on the road. It is considered that the complaint is not valid to the Project.
- Since the site arrangement is subject change all the time, the ET will keep closely inspect the site condition and cleanliness of adjoined roads in subsequent weekly site inspection.

Prepared By:	Nicola Hon
Designation:	Environmental Consultant
Signature :	Auli
Date ·	13 November 2017

Photo Record



Photo 1 (Unknown Exit 1)

The condition of unknown site exit 1 and adjoined LMH road was dusty in which mud and debris were found. The maintenance party/ ownership of the site exit is unknown.



Photo 2 (Unknown Exit 2)

The condition of unknown site exit 2 and adjoined LMH road was dusty in which mud and debris were found. The maintenance party/ ownership of the site exit is unknown.



Photo 3 (Unknown Exit 3)

The condition of unknown site exit 3 and adjoined LMH road was dusty in which mud and debris were found. The maintenance party/ ownership of the site exit is unknown.



Photo 4 (Unknown Exit 4)

The condition of unknown site exit 4 and adjoined LMH road was dusty in which mud and debris were found. The maintenance party/ ownership of the site exit is unknown.



Photo 5 (Unknown Exit 5)

The condition of unknown site exit 5 and adjoined LMH road was dusty in which mud and debris were found. The maintenance party/ ownership of the site exit is unknown.



Photo 6 (Unknown Exit 6)

The condition of unknown site exit 6 and adjoined LMH road was dusty in which mud and debris were found. The maintenance party/ ownership of the site exit is unknown.



Photo 7 (Bridge D Site Exit under LT/C6)
Wheel weshing facilities were provided

Wheel washing facilities were provided and properly maintained by CCKJV. A bund was provided to prevent muddy water from flowing out of the site.



Photo 8 (Bridge D Site Exit under LT/C6)

The condition of Bridge D Site Exit under LT/C6 and adjoined LMH road was satisfactory without mud and debris.



Photo 9 (Chuk Yuen Rd Site exit under LT/C6)

Wheel washing facilities were provided and properly maintained by CCKJV. The wastewater from wheel washing was directed to catchpit for soakaway



Photo 10 (Chuk Yuen Rd Site exit under LT/C6)

The condition of Chuk Yuen Rd Site Exit under LT/C6 and adjoined LMH road was satisfactory without mud and debris.



Photo 11 (Bridge Y Site Exit under LT/C6)

Wheel washing facilities were provided and properly maintained by CCKJV. The wastewater from wheel washing was directed to AquaSed for de-silting.



Photo 12 (Bridge Y Site Exit under LT/C6)

The condition of Bridge Y Site Exit under LT/C6 and adjoined LMH road was satisfactory without mud and debris.



Photo 13

During the regular site inspection, it was observed that the road surface of LMH Road was wetted by water bowsers to suppress fugitive dust.



Photo 14
Road sweeper would also deploy by CCKJV to enhance the road cleaning work in order to remove debris and gravels on road surface.

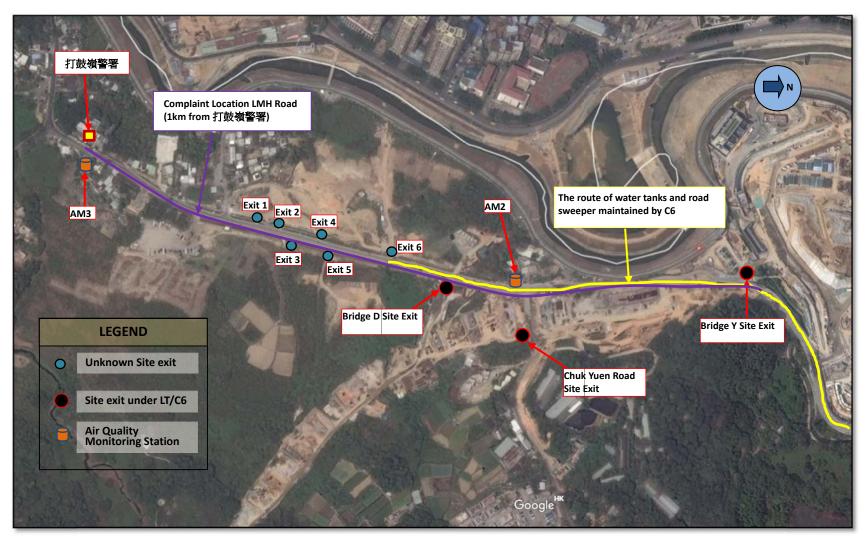


Figure 1 The Complaint Location and site exit along Lin Ma Hang Road